

SampleWorks - 130 Cedar Building, Community Monitoring																					
Sample No.	Sampling Location	Collection Start Date	Collection Time (AM/PM)	Collection End Date	Collection Time (AM/PM)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Total Structure Count			Asbestos < 5 µm	Asbestos ≥ 5 µm	Result (µm/m ³)	Concentration (f/c)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
												All Asbestos	Chrysotile	Amphibole							
5265941	1 - Southeast Corner, Sidewalk Bridge	8/26/2007	8:52 AM	8/26/2007	4:41 PM	476	1,526	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265942	2 - Northeast Corner, Sidewalk Bridge	8/26/2007	8:45 AM	8/26/2007	4:41 PM	476	1,526	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265936	3 - 90 West Courtyard at 2nd Floor Level	8/26/2007	8:20 AM	8/26/2007	4:32 PM	452	2,005	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 8.4	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265944	4 - Abany St 6th Floor Scalloping	8/26/2007	8:13 AM	8/26/2007	4:47 PM	454	1,846	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 8.4	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265945	5 - Washington St 6th Floor Scalloping	8/26/2007	9:27 AM	8/26/2007	4:42	442	1,669	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 8.4	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265946	6 - Cedar St 6th Floor Scalloping	8/26/2007	9:38 AM	8/26/2007	4:51 PM	433	1,570	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265937	7 - Roof, East Facade	8/26/2007	10:05 AM	8/26/2007	4:57 PM	412	1,817	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265938	8 - Roof, North Facade	8/26/2007	9:52 AM	8/26/2007	4:53 PM	423	1,650	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265990	Personnel decon clean room	8/26/2007	7:41 AM	8/26/2007	4:37 PM	474	3,261	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 16.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265991	1 - Southeast Corner, Sidewalk Bridge	8/27/2007	8:32 AM	8/27/2007	4:06 PM	514	1,824	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265992	2 - Northeast Corner, Sidewalk Bridge	8/27/2007	7:11 AM	8/27/2007	4:23 PM	524	1,913	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265987	3 - 90 West Courtyard at 2nd Floor Level	8/27/2007	10:10 AM	8/27/2007	4:37 PM	387	1,635	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 8.4	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265993	4 - Abany St 6th Floor Scalloping	8/27/2007	7:57 AM	8/27/2007	4:13 PM	496	1,947	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 9.8	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265994	5 - Washington St 6th Floor Scalloping	8/27/2007	8:17 AM	8/27/2007	4:15 PM	478	1,829	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265995	6 - Cedar St 6th Floor Scalloping	8/27/2007	8:31 AM	8/27/2007	4:36 PM	461	1,811	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265986	7 - Roof, East Facade	8/27/2007	7:03 AM	8/27/2007	4:36 PM	473	2,297	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	1	1	0	1	11.8	0.002	7/0 µm/m ³	No	OEM shutdown	
5265989	8 - Roof, North Facade	8/27/2007	7:05 AM	8/27/2007	4:38 PM	573	2,361	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	0	0	0	0	0	< 11.8	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265943	Personnel Decon Clean Room	8/27/2007	8:03 AM	8/27/2007	4:08 PM	508	3,283	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/28/2007	2	2	0	2	21.6	0.004	7/0 µm/m ³	No	OEM shutdown	
5265941	1 - Southeast Corner, Sidewalk Bridge	8/28/2007	6:52 AM	8/28/2007	3:42 PM	530	1,828	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265942	2 - Northeast Corner, Sidewalk Bridge	8/28/2007	7:14 AM	8/28/2007	3:45 PM	511	1,916	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265943	3 - 90 West Courtyard at 2nd Floor Level	8/28/2007	6:37 AM	8/28/2007	3:43 PM	504	1,913	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.1	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265943	4 - Abany St 6th Floor Scalloping	8/28/2007	7:35 AM	8/28/2007	3:52 PM	497	1,968	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265944	5 - Washington St 6th Floor Scalloping	8/28/2007	7:52 AM	8/28/2007	3:54 PM	482	1,771	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.1	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265946	6 - Cedar St 6th Floor Scalloping	8/28/2007	8:09 AM	8/28/2007	3:59 PM	470	1,727	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 8.5	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265951	7 - Roof, East Facade	8/28/2007	7:31 AM	8/28/2007	4:06 PM	473	2,072	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.1	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265952	8 - Roof, North Facade	8/28/2007	7:36 AM	8/28/2007	4:10 PM	514	2,083	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	2	2	0	2	21.6	0.004	7/0 µm/m ³	No	OEM shutdown	
5265947	Personnel decon clean room	8/28/2007	7:17 AM	8/28/2007	3:37 PM	500	1,931	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/29/2007	0	0	0	0	0	< 9.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265994	1 - Southeast Corner, Sidewalk Bridge	8/29/2007	6:56 AM	8/29/2007	3:42 PM	481	1,808	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265995	2 - Northeast Corner, Sidewalk Bridge	8/29/2007	6:18 AM	8/29/2007	2:54 PM	481	1,860	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265930	3 - 90 West Courtyard at 2nd Floor Level	8/29/2007	6:36 AM	8/29/2007	2:44 PM	488	1,906	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 9.1	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265931	4 - Abany St 6th Floor Scalloping	8/29/2007	6:32 AM	8/29/2007	3:01 PM	488	1,829	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 9.1	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265936	5 - Washington St 6th Floor Scalloping	8/29/2007	7:52 AM	8/29/2007	3:03 PM	431	1,649	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 8.5	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265938	6 - Cedar St 6th Floor Scalloping	8/29/2007	8:04 AM	8/29/2007	3:05 PM	421	1,526	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 7.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265969	7 - Roof, East Facade	8/29/2007	8:18 AM	8/29/2007	3:07 PM	409	1,423	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 7.7	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265704	8 - Roof, North Facade	8/29/2007	7:29 AM	8/29/2007	3:18 PM	481	1,816	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 7.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265705	9 - Cedar St 6th Floor Scalloping	8/29/2007	7:31 PM	8/29/2007	3:12 PM	461	1,839	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265701	Personnel Decon Clean Room	8/29/2007	7:14 AM	8/29/2007	2:51 PM	457	1,736	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/30/2007	0	0	0	0	0	< 8.5	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265745	1 - Southeast Corner, Sidewalk Bridge	8/30/2007	7:30 AM	8/30/2007	3:36 PM	496	1,690	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/31/2007	0	0	0	0	0	< 8.5	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5263491	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	3:37 PM	8/30/2007	11:34 PM	477	1,679	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	9/1/2007	0	0	0	0	0	< 8.5	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265746	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	7:19 AM	8/30/2007	3:40 PM	501	1,911	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/31/2007	0	0	0	0	0	< 9.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5263492	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	3:41 PM	8/30/2007	11:37 PM	476	1,866	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	9/1/2007	0	0	0	0	0	< 9.1	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5265752	3 - 90 West Courtyard at 2nd Floor Level	8/30/2007	6:30 AM	8/30/2007	2:55 PM	505	1,974	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/31/2007	0	0	0	0	0	< 9.9	< 0.0019	7/0 µm/m ³	No	OEM shutdown
5263493	3 - 90 West Courtyard at 2nd Floor Level	8/30/2007	2:59 PM	8/31/2007	12:54 AM	598	2,322	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	9/1/2007	0	0	0	0	0	< 11.9	< 0.002	7/0 µm/m ³	No	OEM shutdown
5265747	4 - Abany St 6th Floor Scalloping	8/30/2007	6:43 AM	8/30/2007	3:41 PM	488	1,875	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	8/31/2007	0	0	0	0	0	< 8.4	< 0.002	7/0 µm/m ³	No	OEM shutdown
5263494	5 - Washington St 6th Floor Scalloping	8/30/2007	5:46 AM	8/30/2007	11:52 PM	504	1,988	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	9/1/2007	0	0	0	0	0	< 9.1	< 0.008	7/0 µm/m ³	No	OEM shutdown
5265750	5 - Washington St 6th Floor Scalloping	8/30/2007	6:42 AM	8/30/2007	3:30 PM	465	1,643	Asbestos	ASHERA 40 CFR Part												

EPA SW-130 Cedar Building Community Monitoring																				Exceeds Target Air Quality Levels	Exceeds EPA Site Specific Trigger Levels	Comments			
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt	Barium Concentration (µm/m³)	Chromium Concentration (µm/m³)	Manganese Concentration (µm/m³)	Zinc Concentration (µm/m³)	Beryllium Concentration (µm/m³)	Copper Concentration (µm/m³)	Mercury Particulate Concentration (µm/m³)	Cadmium Concentration (µm/m³)				Lead Concentration (µm/m³)	Nickel Concentration (µm/m³)	Antimony Concentration (µm/m³)
Target Air Quality Levels											5.00	60.00	0.50	160.00	0.20	100.00	3.00	2.00	5.00				28.00	14.00	
EPA Site Specific Trigger Levels											0.30	15.00	0.02	0.02	0.02	0.04	0.04	0.04	0.04				0.04	0.04	0.04
5265916	1 - Southeast Corner, Sidewalk Bridge	8/26/2007	9:04 AM	8/27/2007	7:22 AM	1,338	5,196	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0163	0.0416	0.0091	0.157	< 0.0019	0.0241	< 0.0019	< 0.0019	0.0105	0.0167	< 0.0115	No	No		
5265904	2 - Northeast Corner, Sidewalk Bridge	8/26/2007	8:54 AM	8/27/2007	7:03 AM	1,329	5,230	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0183	0.0464	0.0127	0.172	< 0.0019	0.0254	< 0.0019	< 0.0019	0.0139	0.0082	< 0.0115	No	No		
5265912	3 - 90 West Courtyard at 2nd Floor L	8/26/2007	8:23 AM	8/27/2007	9:58 AM	1,835	5,316	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0173	0.0411	0.0103	0.188	< 0.0019	0.0156	< 0.0019	< 0.0019	0.0111	0.0124	< 0.0115	No	No		
5265924	4 - Albany St 6th Floor Scaffold	8/26/2007	9:24 AM	8/27/2007	8:23 AM	1,445	4,954	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0191	0.0491	0.0103	0.187	< 0.0019	0.0169	< 0.0019	< 0.0019	0.0132	0.0121	< 0.0115	No	No		
5265924	5 - Washington St 6th Floor Scaffold	8/26/2007	9:30 AM	8/27/2007	8:09 AM	1,359	5,525	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0152	0.0418	0.01	0.166	< 0.0018	0.0150	< 0.0018	< 0.0018	0.0080	0.0121	< 0.0109	No	No		
5265932	6 - Cedar St 6th Floor Scaffold	8/26/2007	9:40 AM	8/27/2007	8:26 AM	1,366	4,432	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0186	0.0466	0.0123	0.212	< 0.0023	0.0217	< 0.0023	< 0.0023	0.0108	< 0.0138	No	No			
5265908	7 - Roof, East Facade	8/26/2007	10:07 AM	8/27/2007	7:14 AM	1,267	4,562	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0167	0.0447	0.0091	0.176	< 0.0022	0.0137	< 0.0022	< 0.0022	0.0088	0.0136	< 0.0132	No	No		
5265900	8 - Roof, North Facade	8/26/2007	9:57 AM	8/27/2007	7:40 AM	1,303	4,557	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/28/2007	0.0152	0.0456	0.009	0.204	< 0.0022	0.0132	< 0.0022	< 0.0022	< 0.0088	0.0163	< 0.0132	No	No		
5265963	1 - Southeast Corner, Sidewalk Bridge	8/27/2007	7:32 AM	8/28/2007	6:58 AM	1,406	5,427	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0308	< 0.0369	0.0174	0.132	< 0.0018	0.0312	< 0.0018	< 0.0018	0.0158	0.0177	< 0.0111	No	No		
5265963	2 - Northeast Corner, Sidewalk Bridge	8/27/2007	7:11 AM	8/28/2007	7:55 AM	1,448	4,832	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0320	< 0.0365	0.0119	0.178	< 0.0018	0.0285	< 0.0018	< 0.0018	0.0143	0.0113	< 0.0108	No	No		
5265975	3 - 90 West Courtyard at 2nd Floor L	8/27/2007	10:02 AM	8/28/2007	6:37 AM	1,235	4,376	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0271	< 0.0457	0.0128	0.184	< 0.0023	0.0293	< 0.0023	< 0.0023	0.0122	0.0161	< 0.0137	No	No		
5265971	4 - Albany St 6th Floor Scaffold	8/27/2007	7:57 AM	8/28/2007	7:38 AM	1,421	4,978	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0325	< 0.0402	0.0178	0.103	< 0.0020	0.0274	< 0.0020	< 0.0020	0.0119	0.0202	< 0.0121	No	No		
5263488	5 - Washington St 6th Floor Scaffold	8/27/2007	9:06 AM	8/28/2007	7:56 AM	1,370	5,172	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0291	< 0.0387	0.0186	0.167	< 0.0019	0.0302	< 0.0019	< 0.0019	0.0165	0.0195	< 0.0161	No	No		
5265963	6 - Cedar St 6th Floor Scaffold	8/27/2007	8:33 AM	8/28/2007	8:13 AM	1,420	4,598	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0297	< 0.0435	0.0228	0.175	< 0.0022	0.0261	< 0.0022	< 0.0022	0.0121	0.0182	< 0.0130	No	No		
5265959	7 - Roof, East Facade	8/27/2007	7:22 AM	8/28/2007	7:43 AM	1,461	5,511	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0375	0.0432	0.0206	0.215	< 0.0022	0.0355	< 0.0018	< 0.0018	0.0141	0.0379	< 0.0109	No	No		
5265959	8 - Roof, North Facade	8/27/2007	7:48 AM	8/28/2007	7:48 AM	1,448	4,865	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/29/2007	0.0347	< 0.0445	0.0144	0.187	< 0.0020	0.0287	< 0.0020	< 0.0020	0.0132	0.0192	< 0.0132	No	No		
5265904	1 - Southeast Corner, Sidewalk Bridge	8/28/2007	7:06 AM	8/29/2007	7:00 AM	1,434	5,619	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0413	0.0467	0.0212	0.140	< 0.0018	0.0658	< 0.0018	< 0.0018	0.0105	0.0116	< 0.0107	No	No		
5265608	2 - Northeast Corner, Sidewalk Bridge	8/28/2007	7:26 AM	8/29/2007	7:16 AM	1,430	5,772	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0425	0.0467	0.0244	0.177	< 0.0017	0.0679	< 0.0017	< 0.0017	0.0131	0.0129	< 0.0104	No	No		
5265633	3 - 90 West Courtyard at 2nd Floor L	8/28/2007	6:47 AM	8/29/2007	6:42 AM	1,435	5,058	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0368	< 0.0395	0.0184	0.148	< 0.0020	0.0560	< 0.0020	< 0.0020	0.0157	0.0119	< 0.0119	No	No		
5265612	4 - Albany St 6th Floor Scaffold	8/28/2007	7:45 AM	8/29/2007	7:37 AM	1,432	5,102	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0415	0.0352	0.0184	0.152	< 0.0020	0.0630	< 0.0020	< 0.0020	0.0103	0.0127	< 0.0111	No	No		
5265616	5 - Washington St 6th Floor Scaffold	8/28/2007	7:59 AM	8/29/2007	8:08 AM	1,449	5,636	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0357	< 0.0355	0.017	0.139	< 0.0018	0.0606	< 0.0018	< 0.0018	0.0095	0.0127	< 0.0106	No	No		
5265621	6 - Cedar St 6th Floor Scaffold	8/28/2007	8:18 AM	8/29/2007	8:23 AM	1,446	4,865	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0374	< 0.0411	0.0177	0.134	< 0.0021	0.0599	< 0.0021	< 0.0021	0.0103	0.0131	< 0.0123	No	No		
5265629	7 - Roof, East Facade	8/28/2007	7:51 AM	8/29/2007	7:37 AM	1,426	5,447	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0407	< 0.0367	0.0189	0.144	< 0.0018	0.0611	< 0.0018	< 0.0018	0.0128	0.0124	< 0.0110	No	No		
5265625	8 - Roof, North Facade	8/28/2007	8:13 AM	8/29/2007	8:00 AM	1,427	4,944	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/30/2007	0.0429	< 0.0405	0.019	0.149	< 0.0020	0.0694	< 0.0020	< 0.0020	0.0118	0.0150	< 0.0121	No	No		
5265654	1 - Southeast Corner, Sidewalk Bridge	8/29/2007	7:03 AM	8/30/2007	7:25 AM	1,462	5,613	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0425	< 0.0356	0.0202	0.210	< 0.0018	0.0401	< 0.0018	< 0.0018	0.0170	0.0206	< 0.0107	No	No		
5265658	2 - Northeast Corner, Sidewalk Bridge	8/29/2007	7:22 AM	8/30/2007	7:13 AM	1,431	5,801	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0380	< 0.0345	0.0194	0.178	< 0.0017	0.0394	< 0.0017	< 0.0017	0.0179	0.0166	< 0.0103	No	No		
5265662	3 - 90 West Courtyard at 2nd Floor L	8/29/2007	6:50 AM	8/30/2007	6:36 AM	1,426	4,954	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0335	< 0.0404	0.015	0.184	< 0.0020	0.0370	< 0.0020	< 0.0020	0.0195	0.0155	< 0.0121	No	No		
5265666	4 - Albany St 6th Floor Scaffold	8/29/2007	7:42 AM	8/30/2007	7:48 AM	1,448	5,507	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0412	< 0.0395	0.0205	0.209	< 0.0020	0.0408	< 0.0020	< 0.0020	0.0211	0.0216	< 0.0119	No	No		
5265674	5 - Washington St 6th Floor Scaffold	8/29/2007	7:52 AM	8/30/2007	8:00 AM	1,448	5,566	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0353	< 0.0359	0.0183	0.251	< 0.0018	0.0375	< 0.0018	< 0.0018	0.0175	0.0165	< 0.0108	No	No		
5265670	6 - Albany St 6th Floor Scaffold	8/29/2007	8:13 AM	8/30/2007	8:05 AM	1,432	5,457	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0343	< 0.0366	0.0179	0.170	< 0.0018	0.0381	< 0.0018	< 0.0018	0.0175	0.0165	< 0.0110	No	No		
5265678	7 - Cedar St 6th Floor Scaffold	8/29/2007	8:30 AM	8/30/2007	8:17 AM	1,427	4,457	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0377	< 0.0449	0.0193	0.245	< 0.0022	0.0375	< 0.0022	< 0.0022	0.0184	0.0197	< 0.0135	No	No		
5265682	8 - Roof, East Facade	8/29/2007	7:46 AM	8/30/2007	7:33 AM	1,427	5,442	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0371	< 0.0368	0.0184	0.173	< 0.0018	0.0379	< 0.0018	< 0.0018	0.0179	0.0175	< 0.0107	No	No		
5265686	9 - Roof, North Facade	8/29/2007	8:09 AM	8/30/2007	7:55 AM	1,428	4,832	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	8/31/2007	0.0373	< 0.0414	0.0181	0.181	< 0.0021	0.0396	< 0.0021	< 0.0021	0.0200	0.0124	< 0.0124	No	No		
5265708	1 - Southeast Corner, Sidewalk Bridge	8/30/2007	7:30 AM	8/31/2007	7:25 AM	1,435	5,505	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0454	0.0437	0.0192	0.175	< 0.0018	0.0501	< 0.0018	< 0.0018	0.0195	0.0126	< 0.0109	No	No		
5265712	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	7:19 AM	8/31/2007	7:07 AM	1,428	5,096	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0555	< 0.496	0.0227	0.192	< 0.0018	0.0449	< 0.0018	< 0.0018	0.0254	0.0136	< 0.0109	No	No		
5265716	3 - 90 West Courtyard at 2nd Floor L	8/30/2007	6:45 AM	8/31/2007	6:46 AM	1,441	4,966	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0405	0.0427	0.0157	0.285	< 0.0020	0.0324	< 0.0020	< 0.0020	0.0241	0.0156	< 0.0121	No	No		
5265720	4 - Albany St 6th Floor Scaffold	8/30/2007	7:54 AM	8/31/2007	7:50 AM	1,436	4,972	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0413	< 0.0402	0.0178	0.182	< 0.0020	0.0362	< 0.0020	< 0.0020	0.0215	0.0124	< 0.0121	No	No		
5265724	5 - Washington St 6th Floor Scaffold	8/30/2007	8:10 AM	8/31/2007	8:03 AM	1,433	5,549	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0405	< 0.0390	0.019	0.280	< 0.0018	0.0374	< 0.0018	< 0.0018	0.0157	0.0125	< 0.0108	No	No		
5265728	6 - Albany St 6th Floor Scaffold	8/30/2007	8:22 AM	8/31/2007	8:23 AM	1,446	5,516	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0428	0.0484	0.0216	0.291	< 0.0021	0.0386	< 0.0021	< 0.0021	0.0158	0.0128	< 0.0128	No	No		
5265733	7 - Roof, East Facade	8/30/2007	7:41 AM	8/31/2007	7:37 AM	1,436	5,517	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0441	< 0.0453	0.0204	0.280	< 0.0023	0.0329	< 0.0023	< 0.0023	0.0274	0.0152	< 0.0136	No	No		
5265737	8 - Roof, North Facade	8/30/2007	8:04 AM	8/31/2007	8:03 AM	1,439	4,722	Metals	IOSH 7300 Modified ICP-MR/JLIG Metals	9/1/2007	0.0422	0.0441	0.0216	0.197	< 0.0021	1.3000	< 0.0021	< 0.0021	0.3660	0.0227	< 0.0127	No	No		
5265771	1 - Southeast Corner, Sidewalk Bridge	8/31/2007	7																						

MasterWorks - 130 Cedar Building, Community Monitoring															
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Mercury Concentration (ng/m ³)	EPA Site Specific Trigger Level for Mercury (ng/m ³)	Exceeds Target Air quality or EPA Site Air Quality?	Comments
5265919	1 - Southeast Corner, Sidewalk Bridge	8/26/2007	9:02 AM	8/27/2007	7:22 AM	1,340	516	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	7	3000 ng/m ³	No	
5265907	2 - Northeast Corner, Sidewalk Bridge	8/26/2007	8:53 AM	8/27/2007	7:03 AM	1,330	519	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 6	3000 ng/m ³	No	
5265915	3 - 90 West Courtyard at 2nd Floor Level	8/26/2007	8:31 AM	8/27/2007	6:58 AM	1,527	611	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	9	3000 ng/m ³	No	
5265923	4 - Albany St 6th Floor Scaffolding	8/26/2007	9:21 AM	8/27/2007	6:15 AM	1,254	470	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 7	3000 ng/m ³	No	
5265927	5 - Washington St 6th Floor Scaffolding	8/26/2007	9:34 AM	8/27/2007	7:16 AM	1,302	508	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 6	3000 ng/m ³	No	
5265935	6 - Cedar St 6th Floor Scaffolding	8/26/2007	9:46 AM	8/27/2007	8:26 AM	1,360	544	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 6	3000 ng/m ³	No	
5265911	7 - Roof, East Facade	8/26/2007	10:15 AM	8/27/2007	7:14 AM	1,259	523	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 6	3000 ng/m ³	No	
5265903	8 - Roof, North Facade	8/26/2007	9:59 AM	8/27/2007	7:31 AM	1,292	510	Mercury	EPA 324/1631 mod.	BRL	08/28/2007	< 6	3000 ng/m ³	No	
5265986	1 - Southeast Corner, Sidewalk Bridge	8/27/2007	7:32 AM	8/28/2007	6:58 AM	1,406	562	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265982	2 - Northeast Corner, Sidewalk Bridge	8/27/2007	7:11 AM	8/28/2007	7:19 AM	1,448	579	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265974	3 - 90 West Courtyard at 2nd Floor Level	8/27/2007	10:02 AM	8/28/2007	6:37 AM	1,235	494	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265974	4 - Albany St 6th Floor Scaffolding	8/27/2007	7:57 AM	8/28/2007	7:38 AM	1,421	568	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	9	3000 ng/m ³	No	
5265970	5 - Washington St 6th Floor Scaffolding	8/27/2007	8:17 AM	8/28/2007	7:56 AM	1,419	568	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265966	6 - Cedar St 6th Floor Scaffolding	8/27/2007	8:33 AM	8/28/2007	8:13 AM	1,420	568	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	6	3000 ng/m ³	No	
5265962	7 - Roof, East Facade	8/27/2007	7:22 AM	8/28/2007	7:43 AM	1,461	584	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265956	8 - Roof, North Facade	8/27/2007	7:48 AM	8/28/2007	8:05 AM	1,457	576	Mercury	EPA 324/1631 mod.	BRL	08/29/2007	< 5	3000 ng/m ³	No	
5265607	1 - Southeast Corner, Sidewalk Bridge	8/28/2007	7:06 AM	8/29/2007	7:00 AM	1,434	559	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	6	3000 ng/m ³	No	
5265611	2 - Northeast Corner, Sidewalk Bridge	8/28/2007	7:26 AM	8/29/2007	7:16 AM	1,430	572	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	< 6	3000 ng/m ³	No	
5265636	3 - 90 West Courtyard at 2nd Floor Level	8/28/2007	6:47 AM	8/29/2007	6:42 AM	1,435	567	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	6	3000 ng/m ³	No	
5265615	4 - Albany St 6th Floor Scaffolding	8/28/2007	7:45 AM	8/29/2007	7:37 AM	1,432	573	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	< 7	3000 ng/m ³	No	
5265620	5 - Washington St 6th Floor Scaffolding	8/28/2007	7:59 AM	8/29/2007	8:08 AM	1,449	580	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	< 6	3000 ng/m ³	No	
5265624	6 - Cedar St 6th Floor Scaffolding	8/28/2007	8:18 AM	8/29/2007	8:24 AM	1,446	578	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	5	3000 ng/m ³	No	
5265632	7 - Roof, East Facade	8/28/2007	7:51 AM	8/29/2007	7:37 AM	1,426	563	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	< 6	3000 ng/m ³	No	
5265628	8 - Roof, North Facade	8/28/2007	8:13 AM	8/29/2007	8:00 AM	1,427	578	Mercury	EPA 324/1631 mod.	BRL	08/30/2007	5	3000 ng/m ³	No	
5265657	1 - Southeast Corner, Sidewalk Bridge	8/29/2007	7:03 AM	8/30/2007	7:25 AM	1,462	578	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265661	2 - Northeast Corner, Sidewalk Bridge	8/29/2007	7:22 AM	8/30/2007	7:13 AM	1,431	565	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265665	3 - 90 West Courtyard at 2nd Floor Level	8/29/2007	6:50 AM	8/30/2007	6:36 AM	1,426	563	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265669	4 - Albany St 6th Floor Scaffolding	8/29/2007	7:42 AM	8/30/2007	7:48 AM	1,446	578	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265673	5 - Washington St 6th Floor Scaffolding	8/29/2007	8:13 AM	8/30/2007	8:05 AM	1,432	559	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 6	3000 ng/m ³	No	
5265677	6 - Cedar St 6th Floor Scaffolding	8/29/2007	8:52 AM	8/30/2007	8:00 AM	1,388	555	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 6	3000 ng/m ³	No	
5265681	7 - Roof, East Facade	8/29/2007	8:30 AM	8/30/2007	8:17 AM	1,427	571	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265685	8 - Roof, North Facade	8/29/2007	7:46 AM	8/30/2007	7:33 AM	1,427	549	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 6	3000 ng/m ³	No	
5265689	8 - Roof, North Facade	8/29/2007	8:09 AM	8/30/2007	7:55 AM	1,426	570	Mercury	EPA 324/1631 mod.	BRL	08/31/2007	< 5	3000 ng/m ³	No	
5265711	1 - Southeast Corner, Sidewalk Bridge	8/30/2007	7:30 AM	8/31/2007	7:25 AM	1,435	574	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265715	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	7:19 AM	8/31/2007	7:07 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265719	3 - 90 West Courtyard at 2nd Floor Level	8/30/2007	6:45 AM	8/31/2007	6:46 AM	1,441	569	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265723	4 - Albany St 6th Floor Scaffolding	8/30/2007	7:54 AM	8/31/2007	7:50 AM	1,436	567	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265727	5 - Washington St 6th Floor Scaffolding	8/30/2007	8:10 AM	8/31/2007	8:03 AM	1,433	573	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265732	6 - Cedar St 6th Floor Scaffolding	8/30/2007	8:22 AM	8/31/2007	8:23 AM	1,441	562	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265736	7 - Roof, East Facade	8/30/2007	7:41 AM	8/31/2007	7:37 AM	1,436	287	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 11	3000 ng/m ³	No	Power interruption - reduced sample volume/time
5265740	8 - Roof, North Facade	8/30/2007	8:04 AM	8/31/2007	8:03 AM	1,439	568	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265774	1 - Southeast Corner, Sidewalk Bridge	8/31/2007	7:31 AM	9/1/2007	8:47 AM	1,516	591	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265778	2 - Northeast Corner, Sidewalk Bridge	8/31/2007	7:14 AM	9/1/2007	8:39 AM	1,525	610	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265782	3 - 90 West Courtyard at 2nd Floor Level	8/31/2007	6:54 AM	9/1/2007	8:31 AM	1,537	599	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265790	4 - Albany St 6th Floor Scaffolding	8/31/2007	7:55 AM	9/1/2007	9:12 AM	1,517	607	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265796	5 - Washington St 6th Floor Scaffolding	8/31/2007	8:13 AM	9/1/2007	9:28 AM	1,515	606	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265503	6 - Cedar St 6th Floor Scaffolding	8/31/2007	8:29 AM	9/1/2007	9:39 AM	1,510	589	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265507	7 - Roof, East Facade	8/31/2007	7:47 AM	9/1/2007	9:35 AM	1,548	653	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265511	8 - Roof, North Facade	8/31/2007	8:14 AM	9/1/2007	9:23 AM	1,509	611	Mercury	EPA 324/1631 mod.	BRL	09/04/2007	< 5	3000 ng/m ³	No	
5265532	1 - Southeast Corner, Sidewalk Bridge	9/1/2007	8:51 AM	9/2/2007	8:47 AM	1,436	574	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265536	2 - Northeast Corner, Sidewalk Bridge	9/1/2007	8:40 AM	9/2/2007	8:33 AM	1,433	573	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265540	3 - 90 West Courtyard at 2nd Floor Level	9/1/2007	8:38 AM	9/2/2007	8:33 AM	1,435	567	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265544	4 - Albany St 6th Floor Scaffolding	9/1/2007	9:16 AM	9/2/2007	9:04 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265548	5 - Washington St 6th Floor Scaffolding	9/1/2007	9:30 AM	9/2/2007	9:17 AM	1,427	571	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265552	6 - Cedar St 6th Floor Scaffolding	9/1/2007	9:42 AM	9/2/2007	9:30 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	
5265556	7 - Roof, East Facade	9/1/2007	9:40 AM	9/2/2007	9:14 AM	1,414	530	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 6	3000 ng/m ³	No	
5265560	8 - Roof, North Facade	9/1/2007	9:28 AM	9/2/2007	9:28 AM	1,440	562	Mercury	EPA 324/1631 mod.	BRL	09/05/2007	< 5	3000 ng/m ³	No	

MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Asbestos Concentration (f/cc)	MMVF Concentration (f/cc)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
5265918	1 - Southeast Corner, Sidewalk Bridge	8/26/2007	9:07 AM	8/27/2007	7:22 AM	1,335	4,789	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265906	2 - Northeast Corner, Sidewalk Bridge	8/26/2007	8:50 AM	8/27/2007	7:03 AM	1,333	4,364	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	0.00003	<-0.00003	0.0009 f/cc	No	
5265914	3 - 90 West Courtyard at 2nd Floor Level	8/26/2007	8:25 AM	8/27/2007	9:58 AM	1,533	5,409	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265922	4 - Albany St 6th Floor Scaffolding	8/26/2007	9:23 AM	8/27/2007	7:49 AM	1,346	4,924	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	0.00003	0.00006	0.0009 f/cc	No	
5265926	5 - Washington St 6th Floor Scaffolding	8/26/2007	9:29 AM	8/27/2007	8:09 AM	1,360	4,675	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265934	6 - Cedar St 6th Floor Scaffolding	8/26/2007	9:42 AM	8/27/2007	8:26 AM	1,364	5,524	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265910	7 - Roof, East Facade	8/26/2007	10:12 AM	8/27/2007	7:14 AM	1,262	4,492	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265902	8 - Roof, North Facade	8/26/2007	9:55 AM	8/27/2007	7:40 AM	1,305	4,371	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/28/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265985	1 - Southeast Corner, Sidewalk Bridge	8/27/2007	7:32 AM	8/28/2007	6:58 AM	1,406	5,158	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	0.00003	0.00015	0.0009 f/cc	No	
5265981	2 - Northeast Corner, Sidewalk Bridge	8/27/2007	7:11 AM	8/28/2007	7:19 AM	1,448	5,037	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265977	3 - 90 West Courtyard at 2nd Floor Level	8/27/2007	10:02 AM	8/28/2007	6:37 AM	1,235	4,812	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265973	4 - Albany St 6th Floor Scaffolding	8/27/2007	7:57 AM	8/28/2007	7:38 AM	1,421	5,280	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265969	5 - Washington St 6th Floor Scaffolding	8/27/2007	8:17 AM	8/28/2007	7:56 AM	1,419	4,937	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265965	6 - Cedar St 6th Floor Scaffolding	8/27/2007	8:33 AM	8/28/2007	8:13 AM	1,420	5,226	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265961	7 - Roof, East Facade	8/27/2007	7:22 AM	8/28/2007	7:43 AM	1,461	5,038	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	0.00006	0.0009 f/cc	No	
5265955	8 - Roof, North Facade	8/27/2007	7:48 AM	8/28/2007	8:05 AM	1,457	4,780	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/29/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265606	1 - Southeast Corner, Sidewalk Bridge	8/28/2007	7:06 AM	8/29/2007	7:00 AM	1,434	5,312	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265610	2 - Northeast Corner, Sidewalk Bridge	8/28/2007	7:26 AM	8/29/2007	7:16 AM	1,430	4,661	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265635	3 - 90 West Courtyard at 2nd Floor Level	8/28/2007	6:47 AM	8/29/2007	6:42 AM	1,435	5,506	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	0.00008	0.0009 f/cc	No	
5265614	4 - Albany St 6th Floor Scaffolding	8/28/2007	7:45 AM	8/29/2007	7:37 AM	1,432	5,505	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265619	5 - Washington St 6th Floor Scaffolding	8/28/2007	7:59 AM	8/29/2007	8:08 AM	1,449	5,043	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265623	6 - Cedar St 6th Floor Scaffolding	8/28/2007	8:18 AM	8/29/2007	8:24 AM	1,446	5,805	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00002	0.00005	0.0009 f/cc	No	
5265631	7 - Roof, East Facade	8/28/2007	7:51 AM	8/29/2007	7:37 AM	1,426	5,090	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265627	8 - Roof, North Facade	8/28/2007	8:13 AM	8/29/2007	8:00 AM	1,427	4,646	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/30/2007	<0.00003	0.00013	0.0009 f/cc	No	
5265656	1 - Southeast Corner, Sidewalk Bridge	8/29/2007	7:03 AM	8/30/2007	7:25 AM	1,462	5,291	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265660	2 - Northeast Corner, Sidewalk Bridge	8/29/2007	7:22 AM	8/30/2007	7:13 AM	1,431	4,667	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	0.00006	0.0009 f/cc	No	
5265664	3 - 90 West Courtyard at 2nd Floor Level	8/29/2007	6:50 AM	8/30/2007	6:36 AM	1,426	5,693	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265668	4 - Albany St 6th Floor Scaffolding	8/29/2007	7:42 AM	8/30/2007	7:48 AM	1,446	5,258	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265672	5 - Washington St 6th Floor Scaffolding	8/29/2007	8:13 AM	8/30/2007	8:05 AM	1,432	4,923	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	0.00003	0.00003	0.0009 f/cc	No	
5265676	5 - Washington St 6th Floor Scaffolding	8/29/2007	7:52 AM	8/30/2007	8:00 AM	1,448	4,835	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265680	6 - Cedar St 6th Floor Scaffolding	8/29/2007	8:30 AM	8/30/2007	8:17 AM	1,427	4,231	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00004	<-0.00004	0.0009 f/cc	No	
5265684	7 - Roof, East Facade	8/29/2007	7:46 AM	8/30/2007	7:33 AM	1,427	4,888	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	0.00006	0.0009 f/cc	No	
5265688	8 - Roof, North Facade	8/29/2007	8:09 AM	8/30/2007	7:55 AM	1,426	4,645	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	8/31/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265710	1 - Southeast Corner, Sidewalk Bridge	8/30/2007	7:30 AM	8/31/2007	7:25 AM	1,435	4,775	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	0.00006	<-0.00003	0.0009 f/cc	No	
5265714	2 - Northeast Corner, Sidewalk Bridge	8/30/2007	7:19 AM	8/31/2007	7:07 AM	1,428	4,258	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	<0.00004	<-0.00004	0.0009 f/cc	No	
5265718	3 - 90 West Courtyard at 2nd Floor Level	8/30/2007	6:45 AM	8/31/2007	6:46 AM	1,441	5,256	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265722	4 - Albany St 6th Floor Scaffolding	8/30/2007	7:54 AM	8/31/2007	7:50 AM	1,436	5,198	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265726	5 - Washington St 6th Floor Scaffolding	8/30/2007	8:10 AM	8/31/2007	8:03 AM	1,433	4,571	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	0.00001	<-0.00003	0.0009 f/cc	No	
5265731	6 - Cedar St 6th Floor Scaffolding	8/30/2007	8:22 AM	8/31/2007	8:23 AM	1,441	4,125	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	<0.00004	<-0.00004	0.0009 f/cc	No	
5265735	7 - Roof, East Facade	8/30/2007	7:41 AM	8/31/2007	7:37 AM	1,436	4,503	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	0.00003	0.00003	0.0009 f/cc	No	
5265739	8 - Roof, North Facade	8/30/2007	8:04 AM	8/31/2007	8:03 AM	1,439	4,465	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/1/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265773	1 - Southeast Corner, Sidewalk Bridge	8/31/2007	7:31 AM	9/1/2007	8:57 AM	1,526	5,434	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265777	2 - Northeast Corner, Sidewalk Bridge	8/31/2007	7:14 AM	9/1/2007	8:34 AM	1,520	4,647	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	0.00003	<-0.00003	0.0009 f/cc	No	
5265781	3 - 90 West Courtyard at 2nd Floor Level	8/31/2007	6:54 AM	9/1/2007	8:03 AM	1,509	5,508	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	0.00013	0.00018	0.0009 f/cc	No	
5265789	4 - Albany St 6th Floor Scaffolding	8/31/2007	7:55 AM	9/1/2007	9:07 AM	1,512	5,763	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	0.00003	0.00003	0.0009 f/cc	No	
5265785	5 - Washington St 6th Floor Scaffolding	8/31/2007	8:13 AM	9/1/2007	9:22 AM	1,509	5,151	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265502	6 - Cedar St 6th Floor Scaffolding	8/31/2007	8:29 AM	9/1/2007	9:34 AM	1,505	5,151	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265506	7 - Roof, East Facade	8/31/2007	7:47 AM	9/1/2007	9:35 AM	1,548	5,147	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	0.00003	<-0.00003	0.0009 f/cc	No	
5265510	8 - Roof, North Facade	8/31/2007	8:14 AM	9/1/2007	9:23 AM	1,509	4,680	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/4/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265531	1 - Southeast Corner, Sidewalk Bridge	9/1/2007	8:58 AM	9/2/2007	8:44 AM	1,426	5,027	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265535	2 - Northeast Corner, Sidewalk Bridge	9/1/2007	8:35 AM	9/2/2007	8:31 AM	1,436	4,452	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	0.00003	0.0009 f/cc	No	
5265539	3 - 90 West Courtyard at 2nd Floor Level	9/1/2007	8:38 AM	9/2/2007	8:33 AM	1,435	5,414	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	0.00008	0.0009 f/cc	No	
5265543	4 - Albany St 6th Floor Scaffolding	9/1/2007	9:07 AM	9/2/2007	9:02 AM	1,435	5,345	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265547	5 - Washington St 6th Floor Scaffolding	9/1/2007	9:23 AM	9/2/2007	9:14 AM	1,431	5,223	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265551	6 - Cedar St 6th Floor Scaffolding	9/1/2007	9:35 AM	9/2/2007	9:28 AM	1,433	4,872	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265555	7 - Roof, East Facade	9/1/2007	9:40 AM	9/2/2007	9:14 AM	1,414	5,037	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00003	<-0.00003	0.0009 f/cc	No	
5265559	8 - Roof, North Facade	9/1/2007	9:28 AM	9/2/2007	9:28 AM	1,440	4,320	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/5/2007	<0.00004	0.00004	0.0009 f/cc	No	


Sample No.	Sampling Location	Collection Start Date	Time on (Collection)	Collection End Date	Time off (Collection)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Respirable Dust Concentration (mg/m ³)	Respirable Quartz Concentration (mg/m ³)	Target Air quality Level for Respirable Quartz (mg/m ³)	EPA Site Specific Trigger Level for Respirable Quartz (mg/m ³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5265917	1- Southeast Corner, Sidewalk Bridge	8/26/2007	9:05 AM	8/27/2007	7:22 AM	1,337	3,476	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.29	< .001	0.01	0.01	No	
5265905	2- Northeast Corner, Sidewalk Bridge	8/26/2007	8:46 AM	8/27/2007	7:03 AM	1,337	3,376	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.30	< .001	0.01	0.01	No	
5265913	3- 90 West Courtyard at 2nd Floor Level	8/26/2007	8:26 AM	8/27/2007	9:58 AM	1,532	3,830	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.28	< .001	0.01	0.01	No	
5265921	4- Albany St 6th Floor Scalloiding	8/26/2007	9:16 AM	8/27/2007	7:49 AM	1,353	3,518	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.26	< .001	0.01	0.01	No	
5265925	5- Washington St 6th Floor Scalloiding	8/26/2007	9:32 AM	8/27/2007	8:09 AM	1,357	3,599	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.28	< .001	0.01	0.01	No	
5265933	6- Cedar St 6th Floor Scalloiding	8/26/2007	9:44 AM	8/27/2007	8:26 AM	1,362	3,677	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.27	< .001	0.01	0.01	No	
5265909	7- Roof, East Facade	8/26/2007	10:09 AM	8/27/2007	7:14 AM	1,265	3,099	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.32	< .002	0.01	0.01	No	
5265901	8- Roof, North Facade	8/26/2007	9:55 AM	8/27/2007	7:40 AM	1,305	3,263	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/28/2007	< 0.31	< .002	0.01	0.01	No	
5265984	1- Southeast Corner, Sidewalk Bridge	8/27/2007	7:32 AM	8/28/2007	6:58 AM	1,406	3,515	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	< 0.28	< .001	0.01	0.01	No	
5265980	2- Northeast Corner, Sidewalk Bridge	8/27/2007	7:11 AM	8/28/2007	7:19 AM	1,448	3,620	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	0.30	< .001	0.01	0.01	No	
5265976	3- 90 West Courtyard at 2nd Floor Level	8/27/2007	10:02 AM	8/28/2007	6:37 AM	1,235	3,088	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	< 0.32	< .002	0.01	0.01	No	
5265972	4- Albany St 6th Floor Scalloiding	8/27/2007	7:26 AM	8/29/2007	7:16 AM	1,430	3,647	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	0.421	< 0.028	0.01	0.01	No	
5265968	5- Washington St 6th Floor Scalloiding	8/27/2007	8:17 AM	8/28/2007	7:56 AM	1,419	3,548	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	0.030	< .001	0.01	0.01	No	
5265964	6- Cedar St 6th Floor Scalloiding	8/27/2007	8:33 AM	8/28/2007	8:13 AM	1,420	3,550	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	0.420	< .001	0.01	0.01	No	
5265960	7- Roof, East Facade	8/27/2007	7:22 AM	8/28/2007	7:43 AM	1,461	3,726	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	0.029	< .001	0.01	0.01	No	
5265954	8- Roof, North Facade	8/27/2007	7:48 AM	8/28/2007	8:05 AM	1,457	3,643	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/29/2007	< 0.27	< .001	0.01	0.01	No	
5265905	1- Southeast Corner, Sidewalk Bridge	8/28/2007	7:06 AM	8/29/2007	7:06 AM	1,434	3,513	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	0.434	< 0.028	0.01	0.01	No	
5265909	2- Northeast Corner, Sidewalk Bridge	8/28/2007	7:26 AM	8/29/2007	7:16 AM	1,430	3,647	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	0.429	< .001	0.01	0.01	No	
5265634	3- 90 West Courtyard at 2nd Floor Level	8/28/2007	6:47 AM	8/29/2007	6:42 AM	1,435	3,659	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	< 0.27	< .001	0.01	0.01	No	
5265613	4- Albany St 6th Floor Scalloiding	8/28/2007	7:45 AM	8/29/2007	7:37 AM	1,427	3,652	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	< 0.27	< .001	0.01	0.01	No	
5265618	5- Washington St 6th Floor Scalloiding	8/28/2007	7:59 AM	8/29/2007	8:08 AM	1,449	3,623	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	< 0.028	< .001	0.01	0.01	No	
5265622	6- Cedar St 6th Floor Scalloiding	8/28/2007	8:18 AM	8/29/2007	8:24 AM	1,446	3,724	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	< 0.27	< .001	0.01	0.01	No	
5265630	7- Roof, East Facade	8/28/2007	7:51 AM	8/29/2007	7:37 AM	1,426	3,565	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	0.028	< .001	0.01	0.01	No	
5265626	8- Roof, North Facade	8/28/2007	8:13 AM	8/29/2007	8:30 AM	1,427	3,568	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/30/2007	< 0.028	< .001	0.01	0.01	No	
5265655	1- Southeast Corner, Sidewalk Bridge	8/29/2007	7:03 AM	8/30/2007	7:25 AM	1,462	3,655	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.27	< .001	0.01	0.01	No	
5265659	2- Northeast Corner, Sidewalk Bridge	8/29/2007	7:22 AM	8/30/2007	7:13 AM	1,431	3,578	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.028	< .001	0.01	0.01	No	
5265663	3- 90 West Courtyard at 2nd Floor Level	8/29/2007	6:50 AM	8/30/2007	6:36 AM	1,426	3,708	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.027	< .001	0.01	0.01	No	
5265667	4- Albany St 6th Floor Scalloiding	8/29/2007	7:42 AM	8/30/2007	7:48 AM	1,446	3,615	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.28	< .001	0.01	0.01	No	
5265671	5- Washington St 6th Floor Scalloiding	8/29/2007	8:13 AM	8/30/2007	8:05 AM	1,432	3,590	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.028	< .001	0.01	0.01	No	
5265675	6- Cedar St 6th Floor Scalloiding	8/29/2007	7:52 AM	8/30/2007	8:00 AM	1,448	3,673	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.028	< .001	0.01	0.01	No	
5265679	7- Roof, East Facade	8/29/2007	8:30 AM	8/30/2007	8:17 AM	1,427	3,389	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.30	< .001	0.01	0.01	No	
5265683	8- Roof, North Facade	8/29/2007	7:46 AM	8/30/2007	7:33 AM	1,427	3,568	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	0.028	< .001	0.01	0.01	No	
5265687	9- Roof, North Facade	8/29/2007	8:09 AM	8/30/2007	7:56 AM	1,426	3,565	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	8/31/2007	< 0.028	< .001	0.01	0.01	No	
5265709	1- Southeast Corner, Sidewalk Bridge	8/30/2007	7:30 AM	8/31/2007	7:25 AM	1,435	3,731	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.051	< .001	0.01	0.01	No	
5265713	2- Northeast Corner, Sidewalk Bridge	8/30/2007	7:18 AM	8/31/2007	7:07 AM	1,428	3,427	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.048	< .001	0.01	0.01	No	
5265717	3- 90 West Courtyard at 2nd Floor Level	8/30/2007	6:45 AM	8/31/2007	6:46 AM	1,441	3,603	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.040	< .001	0.01	0.01	No	
5265721	4- Albany St 6th Floor Scalloiding	8/30/2007	7:54 AM	8/31/2007	7:50 AM	1,436	3,590	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.044	< .001	0.01	0.01	No	
5265725	5- Washington St 6th Floor Scalloiding	8/30/2007	8:10 AM	8/31/2007	8:03 AM	1,433	3,726	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.042	< .001	0.01	0.01	No	
5265730	6- Cedar St 6th Floor Scalloiding	8/30/2007	8:22 AM	8/31/2007	8:23 AM	1,441	3,603	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.038	< .001	0.01	0.01	No	
5265734	7- Roof, East Facade	8/30/2007	7:41 AM	8/31/2007	7:37 AM	1,436	3,590	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.049	< .001	0.01	0.01	No	
5265738	8- Roof, North Facade	8/30/2007	8:04 AM	8/31/2007	8:03 AM	1,439	3,526	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/1/2007	0.047	< .001	0.01	0.01	No	
5265772	1- Southeast Corner, Sidewalk Bridge	8/31/2007	7:31 AM	9/1/2007	8:54 AM	1,523	3,808	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	< 0.028	< .001	0.01	0.01	No	
5265776	2- Northeast Corner, Sidewalk Bridge	8/31/2007	7:14 AM	9/1/2007	8:32 AM	1,518	3,795	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.027	< .001	0.01	0.01	No	
5265780	3- 90 West Courtyard at 2nd Floor Level	8/31/2007	6:54 AM	9/1/2007	8:31 AM	1,537	3,843	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.050	< .001	0.01	0.01	No	
5265788	4- Albany St 6th Floor Scalloiding	8/31/2007	7:55 AM	9/1/2007	9:04 AM	1,509	3,773	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.028	< .001	0.01	0.01	No	
5265784	5- Washington St 6th Floor Scalloiding	8/31/2007	8:13 AM	9/1/2007	9:25 AM	1,512	3,780	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.027	< .001	0.01	0.01	No	
5265801	6- Cedar St 6th Floor Scalloiding	8/31/2007	8:28 AM	9/1/2007	9:37 AM	1,508	3,770	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.028	< .001	0.01	0.01	No	
5265505	7- Roof, East Facade	8/31/2007	7:47 AM	9/1/2007	9:35 AM	1,548	3,870	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	< 0.026	< .001	0.01	0.01	No	
5265509	8- Roof, North Facade	8/31/2007	8:14 AM	9/1/2007	9:23 AM	1,509	3,773	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/4/2007	0.028	< .001	0.01	0.01	No	
5265530	1- Southeast Corner, Sidewalk Bridge	9/1/2007	8:55 AM	9/2/2007	8:45 AM	1,430	3,575	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265534	2- Northeast Corner, Sidewalk Bridge	9/1/2007	8:33 AM	9/2/2007	8:29 AM	1,436	3,590	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.436	< .001	0.01	0.01	No	
5265538	3- 90 West Courtyard at 2nd Floor Level	9/1/2007	8:38 AM	9/2/2007	8:33 AM	1,435	3,588	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265542	4- Albany St 6th Floor Scalloiding	9/1/2007	9:05 AM	9/2/2007	9:05 AM	1,435	3,588	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265546	5- Washington St 6th Floor Scalloiding	9/1/2007	9:26 AM	9/2/2007	9:15 AM	1,429	3,644	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265550	6- Cedar St 6th Floor Scalloiding	9/1/2007	9:38 AM	9/2/2007	9:27 AM	1,429	3,573	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265554	7- Roof, East Facade	9/1/2007	9:40 AM	9/2/2007	9:14 AM	1,414	3,535	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	
5265558	8- Roof, North Facade	9/1/2007	9:28 AM	9/2/2007	9:28 AM	1,440	3,600	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/5/2007	< 0.028	< .001	0.01	0.01	No	

MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM _{2.5} Avg. Concentration (µg/m ³)	EPA Site Specific Trigger Level for PM _{2.5} (µg/m ³)	Exceeds Target Air Quality or EPA Site Specific Level?	Comments
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	14	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	15	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	14	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	13	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	14	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	14	65	No	
N/A	7 - Roof, East	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	13	65	No	
N/A	8 - Roof, North	8/26/2007	12:00 AM	8/27/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	14	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	11	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	11	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	10	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	11	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	10	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	11	65	No	
N/A	7 - Roof, East	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	11	65	No	
N/A	8 - Roof, North	8/27/2007	12:00 AM	8/28/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	15	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	14	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	13	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	14	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	13	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	13	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	14	65	No	
N/A	7 - Roof, East	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	13	65	No	
N/A	8 - Roof, North	8/28/2007	12:00 AM	8/29/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	12	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	16	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	16	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	15	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	16	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	15	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	16	65	No	
N/A	7 - Roof, East	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	14	65	No	
N/A	8 - Roof, North	8/29/2007	12:00 AM	8/30/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	19	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	23	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	24	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	21	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	22	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	22	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	23	65	No	
N/A	7 - Roof, East	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	21	65	No	
N/A	8 - Roof, North	8/30/2007	12:00 AM	8/31/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	25	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	21	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	20	65	No	
N/A	3 - Courtyard, 2nd Floor Level	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	19	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	19	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	19	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	20	65	No	
N/A	7 - Roof, East	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	19	65	No	
N/A	8 - Roof, North	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	18	65	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F6698	N/A	10	65	No	
N/A	2 - Northeast Corner Sidewalk Bridge	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G6699	N/A	11	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4526	N/A	10	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4728	N/A	10	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4729	N/A	10	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # G4527	N/A	11	65	No	
N/A	7 - Roof, East	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # F5003	N/A	9	65	No	
N/A	8 - Roof, North	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM2.5	Direct Read	Met One E-BAM Unit # E3363	N/A	13	65	No	

MasterWorks - 130 Cedar Building, Community Monitoring														
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM ₁₀ Avg. Concentration (µg/m ³)	EPA Site Specific Trigger Level for PM ₁₀ (µg/m ³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	16	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	18	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	31	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	17	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	18	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	18	150	No	
N/A	7 - Roof, East	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	19	150	No	
N/A	8 - Roof, North	8/26/2007	12:00 AM	08/27/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	26	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	16	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	16	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	19	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	15	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	19	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	24	150	No	
N/A	7 - Roof, East	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,435	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	20	150	No	
N/A	8 - Roof, North	8/27/2007	12:00 AM	08/28/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	21	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	20	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	19	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	19	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	17	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	20	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	24	150	No	
N/A	7 - Roof, East	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	27	150	No	
N/A	8 - Roof, North	8/28/2007	12:00 AM	08/29/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	29	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	25	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	23	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	19	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	21	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	22	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	23	150	No	
N/A	7 - Roof, East	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	24	150	No	
N/A	8 - Roof, North	8/29/2007	12:00 AM	08/30/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	31	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	31	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	29	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	26	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	26	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	27	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	27	150	No	
N/A	7 - Roof, East	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	31	150	No	
N/A	8 - Roof, North	8/30/2007	12:00 AM	08/31/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	27	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	27	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	27	150	No	
N/A	3 - Courtyard, 2nd Floor Level	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	34	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	32	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	29	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	31	150	No	
N/A	7 - Roof, East	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	30	150	No	
N/A	8 - Roof, North	8/31/2007	12:00 AM	9/1/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	33	150	No	
N/A	1 - Southeast Corner 2nd Floor Sidewalk Bridge	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4607	N/A	13	150	No	
N/A	2 - Northeast Corner Sidewalk Bridge	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G3586	N/A	14	150	No	
N/A	3 - Courtyard, 2nd Floor Level	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4606	N/A	14	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4731	N/A	13	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4604	N/A	14	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # G4605	N/A	17	150	No	
N/A	7 - Roof, East	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # E3364	N/A	16	150	No	
N/A	8 - Roof, North	9/1/2007	12:00 AM	9/2/2007	12:00 AM	1,440	PM10	Direct Read	Met One E-BAM Unit # F5001	N/A	18	150	No	

Mercury Vapor (Hg⁰) Air Results for Outdoor Community
Monitoring Stations by Location as recorded by the Lumex Analyzer

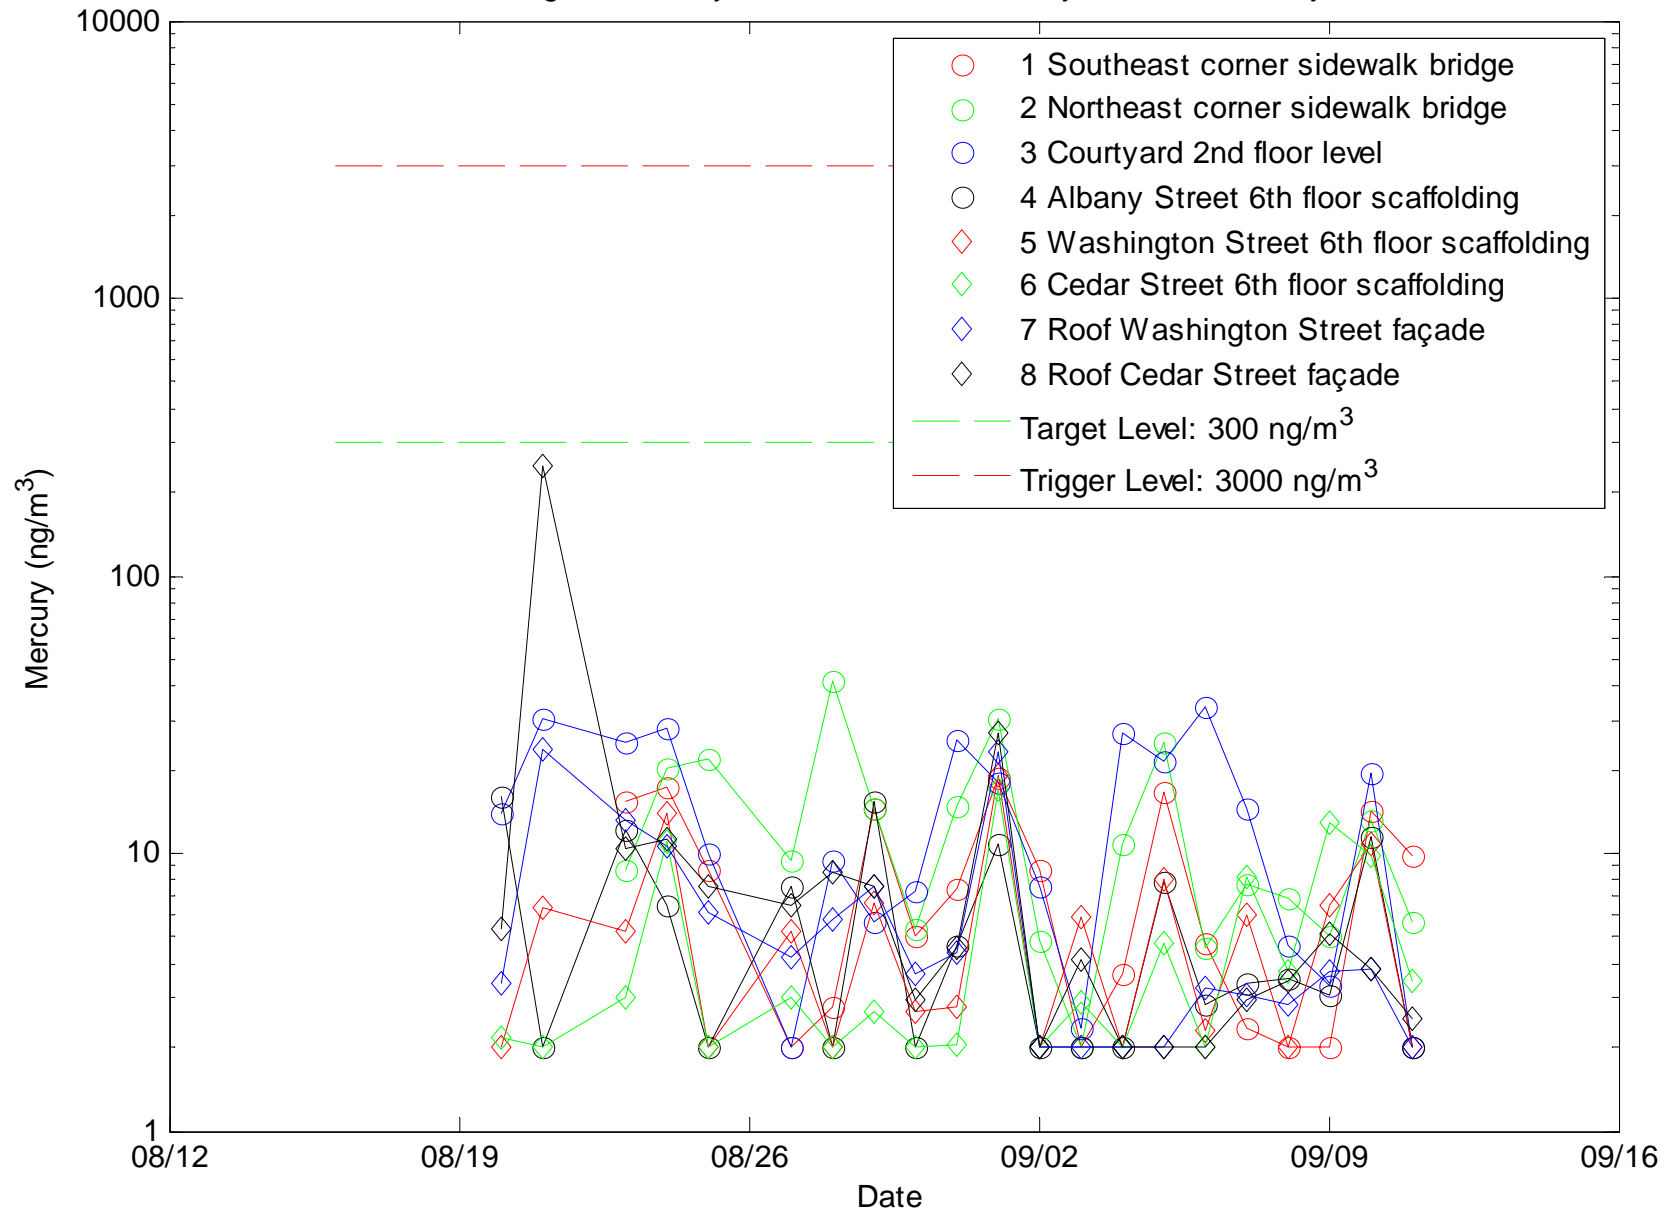

Report Summary

Air Mercury Results (Hg⁰, ng/m³) as recorded by the Lumex RA915+ analyzer

Week of 08/26/07 to 09/01/07

Date	Mercury (Hg ⁰) ng/m ³ 30-sec readings	1 Southeast corner sidewalk bridge	2 Northeast corner sidewalk bridge	3 Courtyard 2nd floor level	4 Albany Street 6th floor scaffolding	5 Washington Street 6th floor scaffolding	6 Cedar Street 6th floor scaffolding	7 Roof Washington Street façade	8 Roof Cedar Street façade
27-Aug-07	# Samples	9	9	9	9	9	9	9	9
	Average	<2	9	<2	8	5	3	4	6
	Maximum	<2	11	<2	8	6	3	5	8
28-Aug-07	# Samples	9	9	9	9	9	9	9	9
	Average	3	42	9	<2	<2	2	6	9
	Maximum	3	46	12	2	2	2	6	9
29-Aug-07	# Samples	9	9	9	9	9	9	9	9
	Average	14	15	6	15	7	3	8	8
	Maximum	16	15	6	17	8	4	9	9
30-Aug-07	# Samples	18	18	18	18	18	18	18	18
	Average	5	5	7	<2	3	<2	4	3
	Maximum	8	9	12	4	4	2	6	5
31-Aug-07	# Samples	36	39	36	36	36	36	36	36
	Average	7	15	26	5	3	2	4	5
	Maximum	17	24	48	14	8	6	9	12
1-Sep-07	# Samples	18	18	18	18	18	18	18	18
	Average	19	31	18	11	19	17	23	27
	Maximum	39	34	32	23	39	44	52	55