

MasterWorks - 130 Cedar Building, Community Monitoring																					
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Total Structure Count			Asbestos < 5 µm	Asbestos ≥ 5 µm	Result (S/mm <sup>2</sup> )	Concentration (S/cc)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
												All Asbestos	Chrysotile	Amphibole							
5266605	3 - 90 West Courtyard at 2nd Floor Level	9/9/2007	7:55 AM	9/9/2007	12:29 PM	274	2,672	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 12.7	< 0.0018	70 S/mm2	No	
5266606	4 - Albany St 6th Floor Scaffolding	9/9/2007	8:12 AM	9/9/2007	1:11 PM	299	2,990	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 14.3	< 0.0018	70 S/mm2	No	
5266607	5 - Washington St 6th Floor Scaffolding	9/9/2007	8:05 AM	9/9/2007	1:09 PM	304	2,888	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 14.3	< 0.0019	70 S/mm2	No	
5266608	6 - Cedar St 6th Floor Scaffolding	9/9/2007	8:05 AM	9/9/2007	1:05 PM	300	2,775	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 14.3	< 0.002	70 S/mm2	No	
5266609	7 - Roof, East Facade	9/9/2007	7:45 AM	9/9/2007	1:17 PM	332	3,279	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 16.4	< 0.0019	70 S/mm2	No	
5266610	8 - Roof, North Facade	9/9/2007	7:46 AM	9/9/2007	1:19 PM	333	3,247	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 16.4	< 0.0019	70 S/mm2	No	
5266658	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	7:05 AM	9/10/2007	3:23 PM	498	1,768	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.0019	70 S/mm2	No	
5266690	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	3:23 PM	9/10/2007	9:18 PM	355	1,243	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.4	< 0.002	70 S/mm2	No	
5266659	4 - Albany St 6th Floor Scaffolding	9/10/2007	7:16 AM	9/10/2007	3:30 PM	494	1,791	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.0019	70 S/mm2	No	
5266691	4 - Albany St 6th Floor Scaffolding	9/10/2007	3:30 PM	9/10/2007	9:37 PM	367	1,312	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.7	< 0.002	70 S/mm2	No	
5266660	5 - Washington St 6th Floor Scaffolding	9/10/2007	7:19 AM	9/10/2007	3:32 PM	493	1,750	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.0019	70 S/mm2	No	
5266692	5 - Washington St 6th Floor Scaffolding	9/10/2007	3:32 PM	9/10/2007	9:40 PM	368	1,325	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.7	< 0.002	70 S/mm2	No	
5266661	6 - Cedar St 6th Floor Scaffolding	9/10/2007	7:21 AM	9/10/2007	3:33 PM	492	1,747	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.0019	70 S/mm2	No	
5266693	6 - Cedar St 6th Floor Scaffolding	9/10/2007	3:33 PM	9/10/2007	9:47 PM	374	1,328	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.7	< 0.002	70 S/mm2	No	
5266662	7 - Roof, East Facade	9/10/2007	7:27 AM	9/10/2007	3:36 PM	489	1,736	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.002	70 S/mm2	No	
5266694	7 - Roof, East Facade	9/10/2007	3:36 PM	9/10/2007	9:56 PM	380	1,316	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.7	< 0.002	70 S/mm2	No	
5266663	8 - Roof, North Facade	9/10/2007	7:29 AM	9/10/2007	3:37 PM	488	1,757	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	0	0	0	0	0	< 8.8	< 0.0019	70 S/mm2	No	
5266695	8 - Roof, North Facade	9/10/2007	3:37 PM	9/10/2007	9:59 PM	382	1,433	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 6.4	< 0.0017	70 S/mm2	No	
5266611	Personnel decon clean room	9/10/2007	7:12 AM	9/10/2007	3:44 PM	512	1,811	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/11/2007	1	1	0	1	0	8.8	0.0019	70 S/mm2	No	
5266687	Personnel decon clean room	9/10/2007	3:44 PM	9/10/2007	10:12 PM	388	1,421	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	3	3	0	2	1	21.5	0.0056	70 S/mm2	No	
5266863	3 - 90 West Courtyard at 2nd Floor Level	9/11/2007	7:22 AM	9/11/2007	2:12 PM	410	3,793	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 19.1	< 0.0019	70 S/mm2	No	
5266864	4 - Albany St 6th Floor Scaffolding	9/11/2007	8:04 AM	9/11/2007	2:19 PM	375	3,000	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 14.3	< 0.0018	70 S/mm2	No	
5266865	5 - Washington St 6th Floor Scaffolding	9/11/2007	8:10 AM	9/11/2007	2:21 PM	371	3,061	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 14.3	< 0.0018	70 S/mm2	No	
5266866	6 - Cedar St 6th Floor Scaffolding	9/11/2007	8:15 AM	9/11/2007	2:22 PM	367	3,395	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 16.4	< 0.0018	70 S/mm2	No	
5266867	7 - Roof, East Facade	9/11/2007	8:27 AM	9/11/2007	2:26 PM	359	3,411	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 16.4	< 0.0018	70 S/mm2	No	
5266868	8 - Roof, North Facade	9/11/2007	8:32 AM	9/11/2007	2:28 PM	356	3,204	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/12/2007	0	0	0	0	0	< 16.4	< 0.002	70 S/mm2	No	
5266830	3 - 90 West Courtyard at 2nd Floor Level	9/12/2007	9:12 AM	9/12/2007	12:56 PM	224	2,240	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	1	1	0	1	0	10.4	0.0019	70 S/mm2	No	
5266831	4 - Albany St 6th Floor Scaffolding	9/12/2007	9:28 AM	9/12/2007	1:05 PM	217	2,116	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	0	0	0	0	0	< 10.4	< 0.0018	70 S/mm2	No	
5266832	5 - Washington St 6th Floor Scaffolding	9/12/2007	9:26 AM	9/12/2007	1:07 PM	221	2,155	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	0	0	0	0	0	< 10.4	< 0.0019	70 S/mm2	No	
5266833	6 - Cedar St 6th Floor Scaffolding	9/12/2007	9:30 AM	9/12/2007	1:09 PM	219	2,190	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	1	1	0	1	0	10.4	0.002	70 S/mm2	No	
5266834	7 - Roof, East Facade	9/12/2007	9:38 AM	9/12/2007	1:14 PM	216	2,133	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	0	0	0	0	0	< 11.4	< 0.002	70 S/mm2	No	
5266828	8 - Roof, North Facade	9/12/2007	9:40 AM	9/12/2007	1:16 PM	216	2,052	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	0	0	0	0	0	< 11.4	< 0.002	70 S/mm2	No	
5266835	8 - Roof, North Facade	9/12/2007	9:43 AM	9/12/2007	1:17 PM	214	2,140	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	0	0	0	0	0	< 10.4	< 0.0019	70 S/mm2	No	
5266836	Personnel decon clean room	9/12/2007	9:21 AM	9/12/2007	1:02 PM	221	2,155	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/13/2007	1	1	0	0	1	10.4	0.0019	70 S/mm2	No	
5266929	3 - 90 West Courtyard at 2nd Floor Level	9/13/2007	7:28 AM	9/13/2007	1:16 PM	348	2,088	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	0	0	0	0	0	< 10.4	< 0.0019	70 S/mm2	No	
5266930	4 - Albany St 6th Floor Scaffolding	9/13/2007	8:14 AM	9/13/2007	1:30 PM	316	1,896	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	0	0	0	0	0	< 9.5	< 0.0019	70 S/mm2	No	
5266931	5 - Washington St 6th Floor Scaffolding	9/13/2007	8:21 AM	9/13/2007	1:31 PM	310	1,860	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	1	1	0	1	1	9.5	0.002	70 S/mm2	No	
5266932	6 - Cedar St 6th Floor Scaffolding	9/13/2007	8:18 AM	9/13/2007	1:33 PM	315	1,890	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	1	1	0	1	0	9.5	0.0019	70 S/mm2	No	
5266933	7 - Roof, East Facade	9/13/2007	8:28 AM	9/13/2007	1:37 PM	309	1,970	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	0	0	0	0	0	< 9.5	< 0.0019	70 S/mm2	No	
5266934	8 - Roof, North Facade	9/13/2007	8:30 AM	9/13/2007	1:38 PM	308	1,887	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	0	0	0	0	0	< 9.5	< 0.0019	70 S/mm2	No	
5266936	Personnel decon clean room	9/13/2007	8:06 AM	9/13/2007	1:27 PM	321	1,926	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/14/2007	0	0	0	0	0	< 9.5	< 0.0019	70 S/mm2	No	
5266968	3 - 90 West Courtyard at 2nd Floor Level	9/14/2007	7:24 AM	9/14/2007	2:19 PM	415	2,428	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 11.4	< 0.0018	70 S/mm2	No	
5266969	4 - Albany St 6th Floor Scaffolding	9/14/2007	7:58 AM	9/14/2007	3:06 PM	428	2,451	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 12.7	< 0.002	70 S/mm2	No	
5266970	5 - Washington St 6th Floor Scaffolding	9/14/2007	8:13 AM	9/14/2007	2:58 PM	405	2,516	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 12.7	< 0.0019	70 S/mm2	No	
5266971	6 - Cedar St 6th Floor Scaffolding	9/14/2007	8:32 AM	9/14/2007	2:52 PM	380	2,396	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 11.4	< 0.0018	70 S/mm2	No	
5266972	7 - Roof, East Facade	9/14/2007	8:31 AM	9/14/2007	2:40 PM	479	2,972	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 14.3	< 0.0019	70 S/mm2	No	
5266973	8 - Roof, North Facade	9/14/2007	7:08 AM	9/14/2007	2:42 PM	456	2,805	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 14.3	< 0.002	70 S/mm2	No	
5266974	Personnel decon clean room	9/14/2007	7:02 AM	9/14/2007	3:28 PM	506	2,974	Asbestos	AHERA, 40 CFR, Part 763, October 30, 1987 (Modified)	RJLG TEM	9/15/2007	0	0	0	0	0	< 14.3	< 0.0019	70 S/mm2	No	

Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Barium Concentration (µg/m <sup>3</sup> )	Chromium Concentration (µg/m <sup>3</sup> )	Manganese Concentration (µg/m <sup>3</sup> )	Zinc Concentration (µg/m <sup>3</sup> )	Beryllium Concentration (µg/m <sup>3</sup> )	Copper Concentration (µg/m <sup>3</sup> )	Mercury Particulate Concentration (µg/m <sup>3</sup> )	Cadmium Concentration (µg/m <sup>3</sup> )	Lead Concentration (µg/m <sup>3</sup> )	Nickel Concentration (µg/m <sup>3</sup> )	Antimony Concentration (µg/m <sup>3</sup> )	Exceeds Target Air Quality Levels	Exceeds EPA Site Specific Trigger Levels	Comments
												Target Air Quality Levels				EPA Site Specific Trigger Levels									
												5.00	6.00	0.50	160.00	0.02	10.00	3.00	0.04	1.50	0.20	5.00			
5266614	3 - 90 West Courtyard at 2nd Floor Level	9/9/2007	10:01 AM	9/10/2007	6:57 AM	1,256	4,163	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.019	< 0.0480	< 0.0096	0.103	< 0.0024	0.026	< 0.0024	< 0.0024	< 0.0096	0.0149	< 0.0144	No	No	
5266618	4 - Albany St 6th Floor Scaffolding	9/9/2007	8:22 AM	9/10/2007	7:33 AM	1,391	4,773	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.019	< 0.0419	0.0086	0.087	< 0.0021	0.020	< 0.0021	< 0.0021	< 0.0084	0.0084	< 0.0126	No	No	
5266622	5 - Washington St 6th Floor Scaffolding	9/9/2007	8:44 AM	9/10/2007	7:47 AM	1,383	4,852	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.018	0.0593	0.0095	0.092	< 0.0021	0.020	< 0.0021	< 0.0021	< 0.0084	0.0084	< 0.0126	No	No	
5266626	6 - Cedar St 6th Floor Scaffolding	9/9/2007	9:01 AM	9/10/2007	8:03 AM	1,382	4,391	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.023	0.0615	0.0132	0.124	< 0.0023	0.026	< 0.0023	< 0.0023	0.0122	0.0097	< 0.0137	No	No	
5266630	7 - Roof, East Facade	9/9/2007	8:01 AM	9/10/2007	7:46 AM	1,425	4,913	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.019	0.0459	0.0113	0.089	< 0.0020	0.020	< 0.0020	< 0.0020	< 0.0081	0.0097	< 0.0123	No	No	
5266634	8 - Roof, North Facade	9/9/2007	8:18 AM	9/10/2007	8:07 AM	1,429	4,874	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/11/2007	0.023	0.0469	0.0137	0.087	< 0.0021	0.021	< 0.0021	< 0.0021	< 0.0082	0.0083	< 0.0123	No	No	
5266645	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	7:06 AM	9/11/2007	7:17 AM	1,451	4,857	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.104	0.0468	0.0164	0.204	< 0.0021	0.031	< 0.0021	< 0.0021	0.0232	0.0118	< 0.0124	No	No	
5266650	4 - Albany St 6th Floor Scaffolding	9/10/2007	7:40 AM	9/11/2007	8:09 AM	1,469	5,067	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.047	0.0399	0.0167	0.113	< 0.0020	0.031	< 0.0020	< 0.0020	0.0150	0.0112	< 0.0118	No	No	
5266668	5 - Washington St 6th Floor Scaffolding	9/10/2007	7:53 AM	9/11/2007	8:22 AM	1,469	5,319	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.028	0.0417	0.0153	0.089	< 0.0019	0.022	< 0.0019	< 0.0019	0.0128	0.0083	< 0.0113	No	No	
5266675	6 - Cedar St 6th Floor Scaffolding	9/10/2007	8:08 AM	9/11/2007	8:36 AM	1,468	5,080	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.025	0.0425	0.0137	0.089	< 0.0020	0.021	< 0.0020	< 0.0020	0.0104	0.0091	< 0.0118	No	No	
5266679	7 - Roof, East Facade	9/10/2007	7:52 AM	9/11/2007	7:27 AM	1,415	4,938	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.049	0.0497	0.0217	0.118	< 0.0020	0.029	< 0.0020	< 0.0020	0.0181	0.0241	< 0.0121	No	No	
5266684	8 - Roof, North Facade	9/10/2007	8:13 AM	9/11/2007	7:45 AM	1,412	4,966	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/12/2007	0.035	< 0.0403	0.0165	0.088	< 0.0020	0.025	< 0.0020	< 0.0020	0.0139	0.0093	< 0.0121	No	No	
5266824	3 - 90 West Courtyard at 2nd Floor Level	9/11/2007	7:23 AM	9/12/2007	7:00 AM	1,417	4,579	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.017	< 0.0437	< 0.0087	0.231	< 0.0022	0.018	< 0.0022	< 0.0022	< 0.0087	0.0095	< 0.0131	No	No	
5266820	4 - Albany St 6th Floor Scaffolding	9/11/2007	8:14 AM	9/12/2007	7:33 AM	1,399	4,649	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.020	< 0.0429	< 0.0086	0.116	< 0.0021	0.021	< 0.0021	< 0.0021	< 0.0086	0.0096	< 0.0129	No	No	
5266816	5 - Washington St 6th Floor Scaffolding	9/11/2007	8:27 AM	9/12/2007	7:42 AM	1,395	4,809	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.018	0.0437	< 0.0083	0.099	< 0.0021	0.020	< 0.0021	< 0.0021	< 0.0083	0.0084	< 0.0125	No	No	
5266812	6 - Cedar St 6th Floor Scaffolding	9/11/2007	8:41 AM	9/12/2007	7:52 AM	1,391	4,788	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.015	< 0.0418	< 0.0084	0.091	< 0.0021	0.018	< 0.0021	< 0.0021	< 0.0084	0.0172	< 0.0125	No	No	
5266808	7 - Roof, East Facade	9/11/2007	7:35 AM	9/12/2007	6:45 AM	1,390	4,807	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.017	0.025	< 0.0083	0.203	< 0.0021	0.019	< 0.0021	< 0.0021	< 0.0083	0.0087	< 0.0125	No	No	
5266800	8 - Roof, North Facade	9/11/2007	7:51 AM	9/12/2007	7:22 AM	1,411	4,464	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/13/2007	0.018	0.0451	< 0.0090	0.130	< 0.0022	0.021	< 0.0022	< 0.0022	< 0.0090	0.0090	< 0.0134	No	No	
5266894	3 - 90 West Courtyard at 2nd Floor Level	9/12/2007	7:07 AM	9/13/2007	7:29 AM	1,462	4,583	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.014	0.0489	< 0.0087	0.104	< 0.0022	0.028	< 0.0022	< 0.0022	< 0.0087	0.0087	< 0.0131	No	No	
5266890	4 - Albany St 6th Floor Scaffolding	9/12/2007	7:36 AM	9/13/2007	8:11 AM	1,475	4,899	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.022	< 0.0408	0.0148	0.208	< 0.0020	0.124	< 0.0020	< 0.0020	< 0.0082	0.0098	< 0.0122	No	No	
5266886	5 - Washington St 6th Floor Scaffolding	9/12/2007	7:46 AM	9/13/2007	8:21 AM	1,475	5,173	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.016	0.0449	0.0104	0.086	< 0.0020	0.283	< 0.0020	< 0.0020	< 0.0077	0.0077	< 0.0116	No	No	
5266882	6 - Cedar St 6th Floor Scaffolding	9/12/2007	7:57 AM	9/13/2007	8:33 AM	1,476	5,569	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.019	0.0408	0.0144	0.090	< 0.0018	0.097	< 0.0018	< 0.0018	< 0.0072	0.0072	< 0.0108	No	No	
5262883	7 - Roof, East Facade	9/12/2007	6:52 AM	9/13/2007	7:21 AM	1,469	4,856	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.019	0.0424	0.0117	0.166	< 0.0021	0.060	< 0.0021	< 0.0021	< 0.0082	0.0082	< 0.0124	No	No	
5266874	8 - Roof, North Facade	9/12/2007	7:31 AM	9/13/2007	7:45 AM	1,454	4,924	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.019	< 0.0406	0.0125	0.080	< 0.0020	0.150	< 0.0020	< 0.0020	< 0.0081	0.0146	< 0.0122	No	No	
5266838	8 - Roof, North Facade	9/12/2007	7:48 AM	9/13/2007	7:58 AM	1,450	5,452	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/14/2007	0.021	0.0448	0.0144	0.108	< 0.0018	0.111	< 0.0018	< 0.0018	< 0.0073	0.0073	< 0.0110	No	No	
5266924	3 - 90 West Courtyard at 2nd Floor Level	9/13/2007	7:35 AM	9/14/2007	7:18 AM	1,423	4,389	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.039	0.0602	0.0236	0.274	< 0.0023	0.382	< 0.0023	< 0.0023	0.2860	0.0384	< 0.0137	No	No	
5266920	4 - Albany St 6th Floor Scaffolding	9/13/2007	8:15 AM	9/14/2007	7:52 AM	1,417	4,724	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.042	0.0532	0.0166	0.200	< 0.0021	0.048	< 0.0021	< 0.0021	0.0133	0.0116	< 0.0127	No	No	
5266916	5 - Washington St 6th Floor Scaffolding	9/13/2007	8:26 AM	9/14/2007	8:08 AM	1,422	5,020	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.026	0.0466	0.0123	0.078	< 0.0020	0.026	< 0.0020	< 0.0020	< 0.0080	0.0080	< 0.0120	No	No	
5266912	6 - Cedar St 6th Floor Scaffolding	9/13/2007	8:38 AM	9/14/2007	8:27 AM	1,429	5,667	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.043	0.0508	0.0193	0.142	< 0.0018	0.034	< 0.0018	< 0.0018	< 0.0099	0.0105	< 0.0108	No	No	
5266908	7 - Roof, East Facade	9/13/2007	7:33 AM	9/14/2007	6:47 AM	1,394	4,645	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.034	0.0459	0.0181	0.102	< 0.0022	0.028	< 0.0022	< 0.0022	< 0.0086	0.0086	< 0.0129	No	No	
5266904	8 - Roof, North Facade	9/13/2007	7:51 AM	9/14/2007	7:12 AM	1,401	4,719	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/15/2007	0.027	0.0481	0.013	0.141	< 0.0021	0.022	< 0.0021	< 0.0021	0.0296	0.0085	< 0.0127	No	No	
5266939	3 - 90 West Courtyard at 2nd Floor Level	9/14/2007	7:24 AM	9/15/2007	8:24 AM	1,500	4,691	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.013	0.0519	< 0.0085	0.079	< 0.0021	0.014	< 0.0021	< 0.0021	< 0.0085	0.0085	< 0.0128	No	No	
5266943	4 - Albany St 6th Floor Scaffolding	9/14/2007	7:58 AM	9/15/2007	8:45 AM	1,487	5,182	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.029	0.0505	0.0172	0.107	< 0.0019	0.024	< 0.0019	< 0.0019	0.0136	0.0080	< 0.0116	No	No	
5266947	5 - Washington St 6th Floor Scaffolding	9/14/2007	8:13 AM	9/15/2007	8:53 AM	1,480	5,266	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.018	0.0404	0.0108	0.084	< 0.0019	0.016	< 0.0019	< 0.0019	0.0095	0.0076	< 0.0114	No	No	
5266951	6 - Cedar St 6th Floor Scaffolding	9/14/2007	8:32 AM	9/15/2007	9:06 AM	1,474	6,709	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.018	0.0375	0.0092	0.069	< 0.0015	0.015	< 0.0015	< 0.0015	< 0.0060	0.0060	< 0.0089	No	No	
5266955	7 - Roof, East Facade	9/14/2007	6:55 AM	9/15/2007	7:11 AM	1,456	5,060	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.018	0.0566	0.0102	0.107	< 0.0020	0.015	< 0.0020	< 0.0020	0.0080	0.0079	< 0.0119	No	No	
5266959	8 - Roof, North Facade	9/14/2007	7:28 AM	9/15/2007	7:32 AM	1,444	4,666	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	9/17/2007	0.024	0.0511	0.0133	0.12										

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Mercury Concentration (ng/m <sup>3</sup> )	EPA Site Specific Trigger Level for Mercury (ng/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5266617	3 - 90 West Courtyard at 2nd Floor Level	9/9/2007	10:02 AM	9/10/2007	6:57 AM	1,255	490	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 6	3000 ng/m3	No	
5266643	4 - Albany St 6th Floor Scaffolding	9/9/2007	9:44 AM	9/10/2007	7:33 AM	1,309	524	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 6	3000 ng/m3	No	
5266625	5 - Washington St 6th Floor Scaffolding	9/9/2007	8:41 AM	9/10/2007	7:47 AM	1,386	548	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 6	3000 ng/m3	No	
5266629	6 - Cedar St 6th Floor Scaffolding	9/9/2007	9:06 AM	9/10/2007	8:03 AM	1,377	537	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 6	3000 ng/m3	No	
5266633	7 - Roof, East Facade	9/9/2007	8:08 AM	9/10/2007	7:46 AM	1,418	560	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 5	3000 ng/m3	No	
5266637	8 - Roof, North Facade	9/9/2007	8:22 AM	9/10/2007	8:07 AM	1,425	584	Mercury	EPA 324/1631 mod.	BRL	09/11/2007	< 5	3000 ng/m3	No	
5266648	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	7:06 AM	9/11/2007	7:17 AM	1,451	566	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	11	3000 ng/m3	No	
5266653	4 - Albany St 6th Floor Scaffolding	9/10/2007	7:40 AM	9/11/2007	8:09 AM	1,469	573	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	< 5	3000 ng/m3	No	
5266671	5 - Washington St 6th Floor Scaffolding	9/10/2007	7:53 AM	9/11/2007	8:22 AM	1,469	573	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	< 5	3000 ng/m3	No	
5266678	6 - Cedar St 6th Floor Scaffolding	9/10/2007	8:08 AM	9/11/2007	8:36 AM	1,468	587	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	< 5	3000 ng/m3	No	
5266682	7 - Roof, East Facade	9/10/2007	7:52 AM	9/11/2007	4:30 AM	1,238	446	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	< 7	3000 ng/m3	No	
5266667	8 - Roof, North Facade	9/10/2007	8:13 AM	9/11/2007	4:45 AM	1,232	437	Mercury	EPA 324/1631 mod.	BRL	09/12/2007	< 7	3000 ng/m3	No	
5266827	3 - 90 West Courtyard at 2nd Floor Level	9/11/2007	7:23 AM	9/12/2007	7:00 AM	1,417	567	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 5	3000 ng/m3	No	
5266823	4 - Albany St 6th Floor Scaffolding	9/11/2007	8:14 AM	9/12/2007	7:33 AM	1,399	560	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 5	3000 ng/m3	No	
5266819	5 - Washington St 6th Floor Scaffolding	9/11/2007	8:27 AM	9/12/2007	7:42 AM	1,395	558	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 6	3000 ng/m3	No	
5266815	6 - Cedar St 6th Floor Scaffolding	9/11/2007	8:41 AM	9/12/2007	7:52 AM	1,391	612	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 5	3000 ng/m3	No	
5266811	7 - Roof, East Facade	9/11/2007	7:35 AM	9/12/2007	6:45 AM	1,390	549	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 6	3000 ng/m3	No	
5266803	8 - Roof, North Facade	9/11/2007	7:51 AM	9/12/2007	7:22 AM	1,411	572	Mercury	EPA 324/1631 mod.	BRL	09/13/2007	< 5	3000 ng/m3	No	
5266897	3 - 90 West Courtyard at 2nd Floor Level	9/12/2007	7:07 AM	9/13/2007	7:29 AM	1,462	578	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	< 5	3000 ng/m3	No	
5266893	4 - Albany St 6th Floor Scaffolding	9/12/2007	7:36 AM	9/13/2007	8:11 AM	1,475	575	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	< 5	3000 ng/m3	No	
5266889	5 - Washington St 6th Floor Scaffolding	9/12/2007	7:46 AM	9/13/2007	8:21 AM	1,475	583	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	6	3000 ng/m3	No	
5266885	6 - Cedar St 6th Floor Scaffolding	9/12/2007	7:57 AM	9/13/2007	2:28 AM	1,111	444	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	< 7	3000 ng/m3	No	
5262886	7 - Roof, East Facade	9/12/2007	6:52 AM	9/13/2007	7:21 AM	1,469	595	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	6	3000 ng/m3	No	
5266841	8 - Roof, North Facade	9/12/2007	8:02 AM	9/13/2007	7:58 AM	1,436	517	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	< 6	3000 ng/m3	No	
5266877	8 - Roof, North Facade	9/12/2007	7:31 AM	9/13/2007	7:45 AM	1,454	574	Mercury	EPA 324/1631 mod.	BRL	09/14/2007	< 5	3000 ng/m3	No	
5266927	3 - 90 West Courtyard at 2nd Floor Level	9/13/2007	7:35 AM	9/14/2007	7:18 AM	1,423	527	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	9	3000 ng/m3	No	
5266923	4 - Albany St 6th Floor Scaffolding	9/13/2007	8:15 AM	9/14/2007	7:52 AM	1,417	524	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	< 6	3000 ng/m3	No	
5266919	5 - Washington St 6th Floor Scaffolding	9/13/2007	8:26 AM	9/14/2007	8:08 AM	1,422	476	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	< 6	3000 ng/m3	No	
5266915	6 - Cedar St 6th Floor Scaffolding	9/13/2007	8:38 AM	9/14/2007	8:27 AM	1,429	536	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	< 6	3000 ng/m3	No	
5266911	7 - Roof, East Facade	9/13/2007	7:33 AM	9/14/2007	6:47 AM	1,394	613	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	< 5	3000 ng/m3	No	
5266907	8 - Roof, North Facade	9/13/2007	7:51 AM	9/14/2007	7:12 AM	1,401	539	Mercury	EPA 324/1631 mod.	BRL	09/15/2007	< 6	3000 ng/m3	No	
5266942	3 - 90 West Courtyard at 2nd Floor Level	9/14/2007	7:24 AM	9/15/2007	8:24 AM	1,500	600	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 5	3000 ng/m3	No	
5266946	4 - Albany St 6th Floor Scaffolding	9/14/2007	7:58 AM	9/15/2007	8:45 AM	1,487	587	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 5	3000 ng/m3	No	
5266950	5 - Washington St 6th Floor Scaffolding	9/14/2007	8:13 AM	9/15/2007	8:53 AM	1,480	389	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 8	3000 ng/m3	No	
5266954	6 - Cedar St 6th Floor Scaffolding	9/14/2007	8:32 AM	9/15/2007	9:06 AM	1,474	590	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 5	3000 ng/m3	No	
5266958	7 - Roof, East Facade	9/14/2007	6:55 AM	9/15/2007	7:11 AM	1,456	561	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 5	3000 ng/m3	No	
5266962	8 - Roof, North Facade	9/14/2007	7:28 AM	9/15/2007	7:32 AM	1,444	362	Mercury	EPA 324/1631 mod.	BRL	09/17/2007	< 8	3000 ng/m3	No	

Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Asbestos Concentration (f/cc)	MMVF Concentration (f/cc)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
5266616	3 - 90 West Courtyard at 2nd Floor Level	9/9/2007	10:03 AM	9/10/2007	6:57 AM	1,254	4,104	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00004	0.00004	0.0009 f/cc	No	
5266620	4 - Albany St 6th Floor Scaffolding	9/9/2007	8:25 AM	9/10/2007	7:33 AM	1,388	4,367	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266624	5 - Washington St 6th Floor Scaffolding	9/9/2007	8:50 AM	9/10/2007	7:47 AM	1,377	4,757	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266628	6 - Cedar St 6th Floor Scaffolding	9/9/2007	9:08 AM	9/10/2007	8:03 AM	1,375	4,605	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266632	7 - Roof, East Facade	9/9/2007	8:02 AM	9/10/2007	7:46 AM	1,424	4,961	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266636	8 - Roof, North Facade	9/9/2007	8:18 AM	9/10/2007	8:07 AM	1,429	5,131	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/11/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266647	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	7:06 AM	9/11/2007	7:17 AM	1,451	5,174	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	<0.00003	0.00006	0.0009 f/cc	No	
5266652	4 - Albany St 6th Floor Scaffolding	9/10/2007	7:40 AM	9/11/2007	8:09 AM	1,469	4,824	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266670	5 - Washington St 6th Floor Scaffolding	9/10/2007	7:53 AM	9/11/2007	8:22 AM	1,469	4,978	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	<0.00003	0.00003	0.0009 f/cc	No	
5266677	6 - Cedar St 6th Floor Scaffolding	9/10/2007	8:08 AM	9/11/2007	8:36 AM	1,468	4,980	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266681	7 - Roof, East Facade	9/10/2007	7:52 AM	9/11/2007	7:27 AM	1,415	4,693	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	0.00003	<0.00003	0.0009 f/cc	No	
5266666	8 - Roof, North Facade	9/10/2007	8:13 AM	9/11/2007	7:45 AM	1,412	4,885	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/12/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266826	3 - 90 West Courtyard at 2nd Floor Level	9/11/2007	7:23 AM	9/12/2007	7:00 AM	1,417	4,551	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	0.00003	0.00003	0.0009 f/cc	No	
5266822	4 - Albany St 6th Floor Scaffolding	9/11/2007	8:14 AM	9/12/2007	7:33 AM	1,399	4,217	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5266818	5 - Washington St 6th Floor Scaffolding	9/11/2007	8:27 AM	9/12/2007	7:42 AM	1,395	4,747	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266814	6 - Cedar St 6th Floor Scaffolding	9/11/2007	8:41 AM	9/12/2007	7:52 AM	1,391	4,935	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266810	7 - Roof, East Facade	9/11/2007	7:35 AM	9/12/2007	6:45 AM	1,390	4,703	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266802	8 - Roof, North Facade	9/11/2007	7:51 AM	9/12/2007	7:22 AM	1,411	5,255	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/13/2007	<0.00003	0.00003	0.0009 f/cc	No	
5266896	3 - 90 West Courtyard at 2nd Floor Level	9/12/2007	7:07 AM	9/13/2007	7:29 AM	1,462	4,997	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266892	4 - Albany St 6th Floor Scaffolding	9/12/2007	7:36 AM	9/13/2007	8:11 AM	1,475	4,524	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266888	5 - Washington St 6th Floor Scaffolding	9/12/2007	7:46 AM	9/13/2007	8:21 AM	1,475	4,524	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	0.00003	0.0009 f/cc	No	
5266884	6 - Cedar St 6th Floor Scaffolding	9/12/2007	7:57 PM	9/13/2007	8:33 AM	1,476	5,437	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	0.00003	0.0009 f/cc	No	
5262885	7 - Roof, East Facade	9/12/2007	6:52 AM	9/13/2007	7:21 AM	1,469	4,888	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	0.00003	0.0009 f/cc	No	
5266840	8 - Roof, North Facade	9/12/2007	7:48 AM	9/13/2007	7:58 AM	1,450	5,192	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	<0.00003	0.00003	0.0009 f/cc	No	
5266876	8 - Roof, North Facade	9/12/2007	7:31 AM	9/13/2007	7:45 AM	1,454	4,912	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/14/2007	0.00003	<0.00003	0.0009 f/cc	No	
5266926	3 - 90 West Courtyard at 2nd Floor Level	9/13/2007	7:35 AM	9/14/2007	7:18 AM	1,423	4,617	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266922	4 - Albany St 6th Floor Scaffolding	9/13/2007	8:15 AM	9/14/2007	7:52 AM	1,417	4,581	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266918	5 - Washington St 6th Floor Scaffolding	9/13/2007	8:26 AM	9/14/2007	8:08 AM	1,422	5,070	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266914	6 - Cedar St 6th Floor Scaffolding	9/13/2007	8:38 AM	9/14/2007	8:27 AM	1,429	5,107	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266910	7 - Roof, East Facade	9/13/2007	7:33 AM	9/14/2007	6:47 AM	1,394	4,712	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266906	8 - Roof, North Facade	9/13/2007	7:51 AM	9/14/2007	7:12 AM	1,401	4,976	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/15/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266941	3 - 90 West Courtyard at 2nd Floor Level	9/14/2007	7:24 AM	9/15/2007	8:24 AM	1,500	4,731	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266945	4 - Albany St 6th Floor Scaffolding	9/14/2007	7:58 AM	9/15/2007	8:45 AM	1,487	4,780	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266949	5 - Washington St 6th Floor Scaffolding	9/14/2007	8:13 AM	9/15/2007	8:53 AM	1,480	4,968	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266953	6 - Cedar St 6th Floor Scaffolding	9/14/2007	8:32 AM	9/15/2007	9:06 AM	1,474	5,023	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266957	7 - Roof, East Facade	9/14/2007	6:55 AM	9/15/2007	7:11 AM	1,456	4,897	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5266961	8 - Roof, North Facade	9/14/2007	7:28 AM	9/15/2007	7:32 AM	1,444	4,983	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	9/17/2007	<0.00003	<0.00003	0.0009 f/cc	No	

Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Respirable Dust Concentration (mg/m <sup>3</sup> )	Respirable Quartz Concentration (mg/m <sup>3</sup> )	Target Air quality Level for Respirable Quartz (mg/m <sup>3</sup> )	EPA Site Specific Trigger Level for Respirable Quartz (mg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5266615	3 - 90 West Courtyard at 2nd Floor Level	9/9/2007	9:58 AM	9/10/2007	6:57 AM	1,259	3,022	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	< .033	< .002	0.01	0.01	No	
5266619	4 - Albany St 6th Floor Scaffolding	9/9/2007	8:19 AM	9/10/2007	7:33 AM	1,394	3,276	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	0.031	< .002	0.01	0.01	No	
5266623	5 - Washington St 6th Floor Scaffolding	9/9/2007	8:48 AM	9/10/2007	7:47 AM	1,379	3,241	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	< .031	< .002	0.01	0.01	No	
5266627	6 - Cedar St 6th Floor Scaffolding	9/9/2007	9:15 AM	9/10/2007	8:03 AM	1,368	3,420	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	< .029	< .001	0.01	0.01	No	
5266631	7 - Roof, East Facade	9/9/2007	8:01 AM	9/10/2007	7:46 AM	1,425	3,563	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	< .028	< .001	0.01	0.01	No	
5266635	8 - Roof, North Facade	9/9/2007	8:17 AM	9/10/2007	8:07 AM	1,430	3,289	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/11/2007	< .03	< .002	0.01	0.01	No	
5266646	3 - 90 West Courtyard at 2nd Floor Level	9/10/2007	7:06 AM	9/11/2007	7:17 AM	1,451	3,628	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	0.047	< .001	0.01	0.01	No	
5266651	4 - Albany St 6th Floor Scaffolding	9/10/2007	7:40 AM	9/11/2007	8:09 AM	1,469	3,673	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	0.03	< .001	0.01	0.01	No	
5266669	5 - Washington St 6th Floor Scaffolding	9/10/2007	7:53 AM	9/11/2007	8:22 AM	1,469	3,599	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	0.031	< .001	0.01	0.01	No	
5266676	6 - Cedar St 6th Floor Scaffolding	9/10/2007	8:08 AM	9/11/2007	8:36 AM	1,468	3,670	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	< .027	< .001	0.01	0.01	No	
5266680	7 - Roof, East Facade	9/10/2007	7:52 AM	9/11/2007	7:27 AM	1,415	3,538	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	< .028	< .001	0.01	0.01	No	
5266665	8 - Roof, North Facade	9/10/2007	8:13 AM	9/11/2007	7:45 AM	1,412	3,248	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/12/2007	0.048	< .002	0.01	0.01	No	
5266825	3 - 90 West Courtyard at 2nd Floor Level	9/11/2007	7:23 AM	9/12/2007	7:00 AM	1,417	3,684	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	0.031	< .001	0.01	0.01	No	
5266821	4 - Albany St 6th Floor Scaffolding	9/11/2007	8:14 AM	9/12/2007	7:33 AM	1,399	3,498	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	< .028	< .001	0.01	0.01	No	
5266817	5 - Washington St 6th Floor Scaffolding	9/11/2007	8:27 AM	9/12/2007	7:42 AM	1,395	3,488	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	0.029	< .001	0.01	0.01	No	
5266813	6 - Cedar St 6th Floor Scaffolding	9/11/2007	8:41 AM	9/12/2007	7:52 AM	1,391	3,478	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	< .029	< .001	0.01	0.01	No	
5266809	7 - Roof, East Facade	9/11/2007	7:35 AM	9/12/2007	6:45 AM	1,390	3,475	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	0.03	< .001	0.01	0.01	No	
5266801	8 - Roof, North Facade	9/11/2007	7:51 AM	9/12/2007	7:22 AM	1,411	3,034	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/13/2007	< .033	< .002	0.01	0.01	No	
5266895	3 - 90 West Courtyard at 2nd Floor Level	9/12/2007	7:07 AM	9/13/2007	7:29 AM	1,462	3,655	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .027	< .001	0.01	0.01	No	
5266891	4 - Albany St 6th Floor Scaffolding	9/12/2007	7:36 AM	9/13/2007	8:11 AM	1,475	3,688	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .027	< .001	0.01	0.01	No	
5266887	5 - Washington St 6th Floor Scaffolding	9/12/2007	7:46 AM	9/13/2007	8:21 AM	1,475	3,688	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .027	< .001	0.01	0.01	No	
5266883	6 - Cedar St 6th Floor Scaffolding	9/12/2007	7:57 AM	9/13/2007	8:33 AM	1,476	3,690	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .027	< .001	0.01	0.01	No	
5262884	7 - Roof, East Facade	9/12/2007	6:52 AM	9/13/2007	7:21 AM	1,469	3,673	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .027	< .001	0.01	0.01	No	
5266839	8 - Roof, North Facade	9/12/2007	7:48 AM	9/13/2007	7:58 AM	1,450	3,951	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .025	< .001	0.01	0.01	No	
5266875	8 - Roof, North Facade	9/12/2007	7:31 AM	9/13/2007	7:45 AM	1,454	3,635	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/14/2007	< .028	< .001	0.01	0.01	No	
5266925	3 - 90 West Courtyard at 2nd Floor Level	9/13/2007	7:35 AM	9/14/2007	7:18 AM	1,423	3,629	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .028	< .001	0.01	0.01	No	
5266921	4 - Albany St 6th Floor Scaffolding	9/13/2007	8:15 AM	9/14/2007	7:52 AM	1,417	3,543	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .028	< .001	0.01	0.01	No	
5266917	5 - Washington St 6th Floor Scaffolding	9/13/2007	8:26 AM	9/14/2007	8:08 AM	1,422	3,555	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .028	< .001	0.01	0.01	No	
5266913	6 - Cedar St 6th Floor Scaffolding	9/13/2007	8:38 AM	9/14/2007	8:27 AM	1,429	3,573	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .028	< .001	0.01	0.01	No	
5266909	7 - Roof, East Facade	9/13/2007	7:33 AM	9/14/2007	6:47 AM	1,394	3,555	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .028	< .001	0.01	0.01	No	
5266905	8 - Roof, North Facade	9/13/2007	7:51 AM	9/14/2007	7:12 AM	1,401	3,292	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/15/2007	< .03	< .002	0.01	0.01	No	
5266940	3 - 90 West Courtyard at 2nd Floor Level	9/14/2007	7:24 AM	9/15/2007	8:24 AM	1,500	3,750	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	< .027	< .001	0.01	0.01	No	
5266944	4 - Albany St 6th Floor Scaffolding	9/14/2007	7:58 AM	9/15/2007	8:45 AM	1,487	3,643	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	0.028	< .001	0.01	0.01	No	
5266948	5 - Washington St 6th Floor Scaffolding	9/14/2007	8:13 AM	9/15/2007	8:53 AM	1,480	3,700	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	< .027	< .001	0.01	0.01	No	
5266952	6 - Cedar St 6th Floor Scaffolding	9/14/2007	8:32 AM	9/15/2007	9:06 AM	1,474	3,685	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	< .027	< .001	0.01	0.01	No	
5266956	7 - Roof, East Facade	9/14/2007	6:55 AM	9/15/2007	7:11 AM	1,456	3,640	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	< .027	< .001	0.01	0.01	No	
5266960	8 - Roof, North Facade	9/14/2007	7:28 AM	9/15/2007	7:32 AM	1,444	3,249	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	9/17/2007	< .031	< .002	0.01	0.01	No	

Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>2.5</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>2.5</sub> (µg/m <sup>3</sup> )	Exceeds Target Air Quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	10	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	9	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	10	65	No	
N/A	7 - Roof, East	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	10	65	No	
N/A	8 - Roof, North	9/9/2007	12:00 AM	9/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	11	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	17	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	17	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	16	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	17	65	No	
N/A	7 - Roof, East	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	22	65	No	
N/A	8 - Roof, North	9/10/2007	12:00 AM	9/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	18	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	19	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	20	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	27	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	20	65	No	
N/A	7 - Roof, East	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	39	65	No	
N/A	8 - Roof, North	9/11/2007	12:00 AM	9/12/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	33	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	9	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	9	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	11	65	No	
N/A	7 - Roof, East	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	8	65	No	
N/A	8 - Roof, North	9/12/2007	12:00 AM	9/13/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	10	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	10	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	10	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	11	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	11	65	No	
N/A	7 - Roof, East	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	9	65	No	
N/A	8 - Roof, North	9/13/2007	12:00 AM	9/14/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	12	65	No	
N/A	3 - Courtyard, 2nd Floor Level	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	11	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	11	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	12	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	11	65	No	
N/A	7 - Roof, East	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	10	65	No	
N/A	8 - Roof, North	9/14/2007	12:00 AM	9/15/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	10	65	No	


Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>10</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>10</sub> (µg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?
N/A	3 - Courtyard, 2nd Floor Level	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	20	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	26	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	24	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	26	150	No
N/A	7 - Roof, East	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	23	150	No
N/A	8 - Roof, North	9/9/2007	12:00 AM	09/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	23	150	No
N/A	3 - Courtyard, 2nd Floor Level	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	23	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	25	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	24	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	26	150	No
N/A	7 - Roof, East	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	39	150	No
N/A	8 - Roof, North	9/10/2007	12:00 AM	09/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	27	150	No
N/A	3 - Courtyard, 2nd Floor Level	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	30	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	25	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	25	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	24	150	No
N/A	7 - Roof, East	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	36	150	No
N/A	8 - Roof, North	9/11/2007	12:00 AM	09/12/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	46	150	No
N/A	3 - Courtyard, 2nd Floor Level	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	21	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	14	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	13	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	16	150	No
N/A	7 - Roof, East	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	14	150	No
N/A	8 - Roof, North	9/12/2007	12:00 AM	09/13/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	17	150	No
N/A	3 - Courtyard, 2nd Floor Level	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	14	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	13	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	14	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	14	150	No
N/A	7 - Roof, East	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	16	150	No
N/A	8 - Roof, North	9/13/2007	12:00 AM	09/14/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	17	150	No
N/A	3 - Courtyard, 2nd Floor Level	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	16	150	No
N/A	4 - Albany St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	14	150	No
N/A	5 - Washington St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	15	150	No
N/A	6 - Cedar St 6th Floor Level Scaffolding	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	15	150	No
N/A	7 - Roof, East	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	16	150	No
N/A	8 - Roof, North	9/14/2007	12:00 AM	09/15/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	19	150	No

Note: Sampling program postponed on September 14, 2007 - awaiting D.O.B. variance.

350 Hochberg Road, Monroeville, PA 15146  
Phone: (724) 325-1776 Fax: (724) 733-1799

Mercury Vapor ( $Hg^0$ ) Air Results for Outdoor Community  
Monitoring Stations by Location as recorded by the Lumex Analyzer

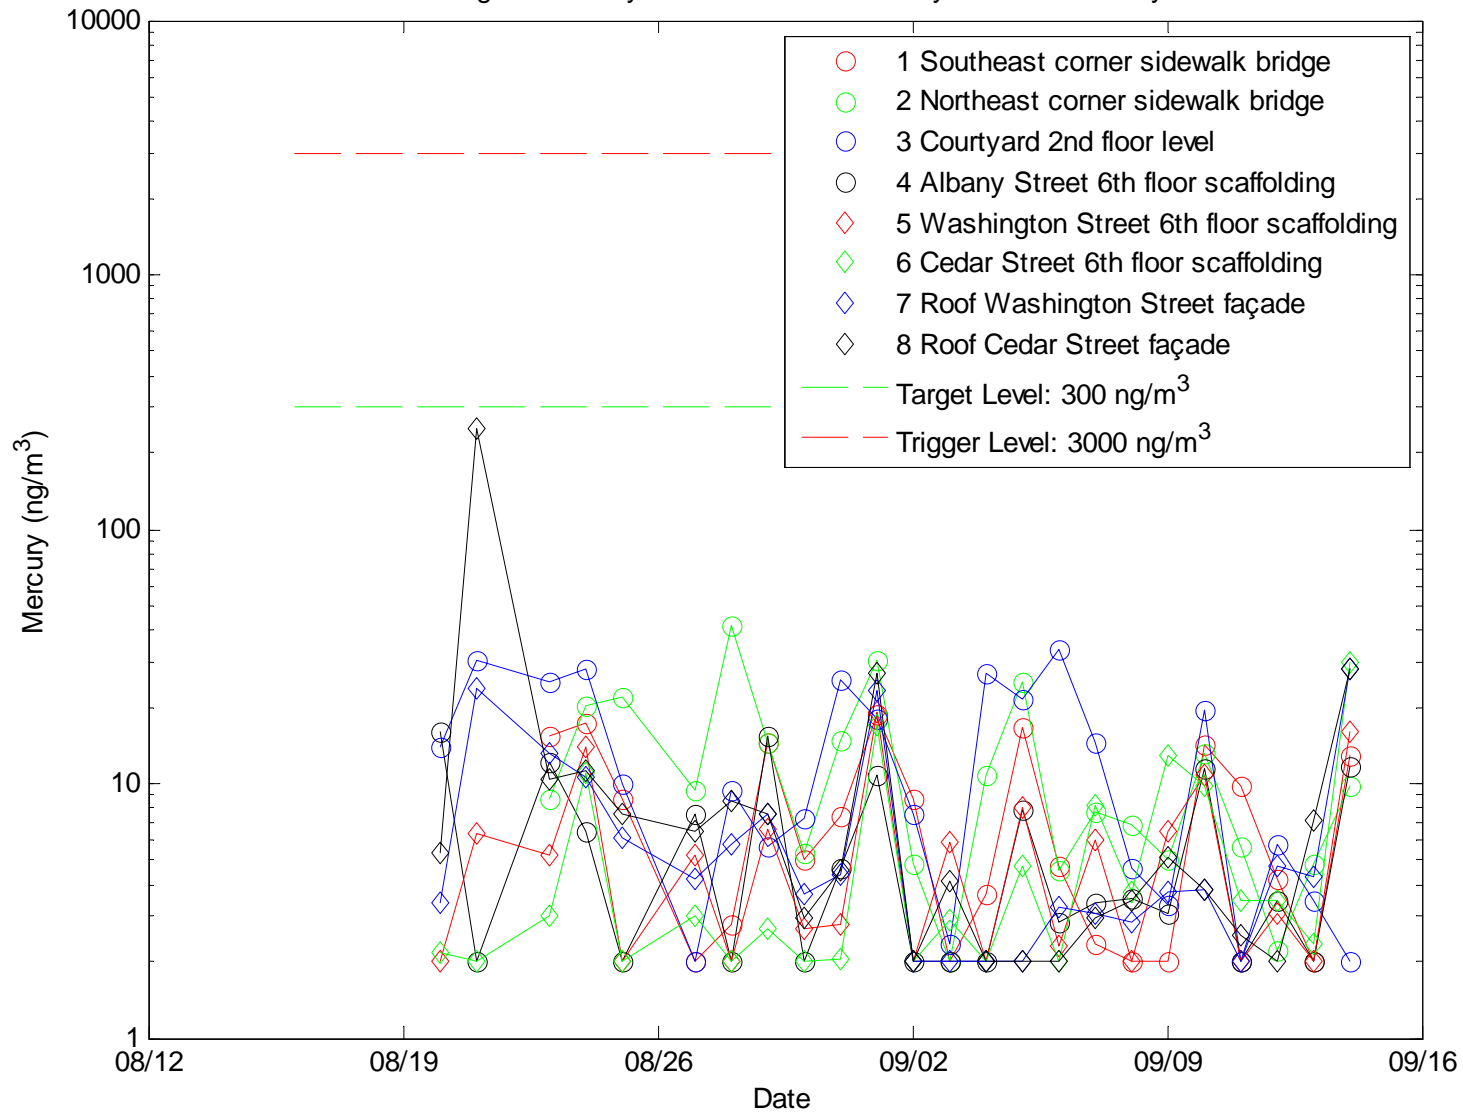

## Report Summary

Air Mercury Results (Hg<sup>0</sup>, ng/m<sup>3</sup>) as recorded by the Lumex RA915+ analyzer  
Week of 09/09/07 to 09/15/07

Date	Mercury (Hg <sup>0</sup> ) ng/m <sup>3</sup> 30-sec readings	1 Southeast corner sidewalk bridge	2 Northeast corner sidewalk bridge	3 Courtyard 2nd floor level	4 Albany Street 6th floor scaffolding	5 Washington Street 6th floor scaffolding	6 Cedar Street 6th floor scaffolding	7 Roof Washington Street façade	8 Roof Cedar Street façade
9-Sep-07	# Samples	9	9	9	9	9	9	9	9
	Average	<2	5	3	3	6	13	4	5
	Maximum	<2	8	4	4	7	16	4	7
10-Sep-07	# Samples	36	36	36	36	36	39	45	27
	Average	14	13	20	12	11	10	4	4
	Maximum	28	30	35	22	26	31	8	10
11-Sep-07	# Samples	9	9	9	9	9	9	9	9
	Average	10	6	2	<2	<2	3	<2	3
	Maximum	11	7	3	<2	2	6	2	3
12-Sep-07	# Samples	9	9	9	9	9	9	9	9
	Average	4	2	6	3	3	3	5	<2
	Maximum	5	5	7	4	5	4	6	2
13-Sep-07	# Samples	9	9	9	9	9	9	9	9
	Average	<2	5	3	<2	<2	2	4	7
	Maximum	<2	6	4	2	<2	3	4	8
14-Sep-07	# Samples	9	9	9	9	9	9	9	9
	Average	13	10	2	12	16	30	28	28
	Maximum	14	11	2	12	17	32	29	29