

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Total Structure Count			Asbestos < 5 µm	Asbestos ≥ 5 µm	Result (S/m <sup>3</sup> )	Concentration (S/c)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
												All Asbestos	Chrysotile	Amphibole							
526082	3-90 West Courtyard at 2nd Floor Level	11/18/2007	7:19 AM	11/18/2007	12:28 PM	309	1,854	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 9.6	< .002	70 S/m <sup>2</sup>	No	
5260983	4-Albany St 6th Floor Scaffolding	11/18/2007	7:38 AM	11/18/2007	12:40 PM	302	1,699	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260984	5-Washington St 6th Floor Scaffolding	11/18/2007	7:41 AM	11/18/2007	12:41 PM	300	1,800	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260985	6-Cedar St 6th Floor Scaffolding	11/18/2007	7:43 AM	11/18/2007	12:43 PM	300	1,698	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260986	7-Roof, East Facade	11/18/2007	7:07 AM	11/18/2007	12:47 PM	340	1,404	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 7.2	< .002	70 S/m <sup>2</sup>	No	
5260987	8-Roof, North Facade	11/18/2007	7:26 AM	11/18/2007	12:48 PM	322	1,384	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 7.2	< .002	70 S/m <sup>2</sup>	No	
5260972	3-90 West Courtyard at 2nd Floor Level	11/19/2007	7:30 AM	11/19/2007	3:48 PM	498	1,768	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	2	2	0	2	0	17.7	0.0039	70 S/m <sup>2</sup>	No	
5260973	4-Albany St 6th Floor Scaffolding	11/19/2007	7:12 AM	11/19/2007	3:30 PM	498	1,768	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	2	2	0	2	0	17.7	0.0039	70 S/m <sup>2</sup>	No	
5260974	5-Washington St 6th Floor Scaffolding	11/19/2007	7:14 AM	11/19/2007	3:31 PM	493	1,764	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	2	2	0	2	0	17.7	0.0039	70 S/m <sup>2</sup>	No	
5260975	6-Cedar St 6th Floor Scaffolding	11/19/2007	7:17 AM	11/19/2007	3:33 PM	496	1,764	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 8.8	< .002	70 S/m <sup>2</sup>	No	
5260976	7-Roof, East Facade	11/19/2007	7:20 AM	11/19/2007	3:37 PM	497	1,764	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260977	8-Roof, North Facade	11/19/2007	7:21 AM	11/19/2007	3:39 PM	498	1,743	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/20/2007	2	2	0	2	0	17.7	0.0039	70 S/m <sup>2</sup>	No	
5260906	3-90 West Courtyard at 2nd Floor Level	11/19/2007	3:48 PM	11/19/2007	11:07 PM	439	1,537	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	1	1	0	0	1	7.7	0.0019	70 S/m <sup>2</sup>	No	
5260907	4-Albany St 6th Floor Scaffolding	11/19/2007	3:30 PM	11/19/2007	11:11 AM	461	1,632	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	1	1	0	0	1	8.2	< .0019	70 S/m <sup>2</sup>	No	
5260908	5-Washington St 6th Floor Scaffolding	11/19/2007	3:31 PM	11/19/2007	11:15 PM	464	1,589	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	1	1	0	1	0	8.2	0.002	70 S/m <sup>2</sup>	No	
5260909	6-Cedar St 6th Floor Scaffolding	11/19/2007	3:33 PM	11/19/2007	11:17 PM	464	1,624	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260910	7-Roof, East Facade	11/19/2007	3:37 PM	11/19/2007	11:22 PM	465	1,628	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	2	2	0	1	1	16.4	0.0039	70 S/m <sup>2</sup>	No	
5260911	8-Roof, North Facade	11/19/2007	3:39 PM	11/19/2007	11:24 PM	465	1,639	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/21/2007	1	1	0	1	0	8.2	0.0019	70 S/m <sup>2</sup>	No	
5260912	3-90 West Courtyard at 2nd Floor Level	11/20/2007	7:04 AM	11/20/2007	3:48 PM	501	1,914	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260962	4-Albany St 6th Floor Scaffolding	11/20/2007	7:04 AM	11/20/2007	3:28 PM	504	1,777	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260963	5-Washington St 6th Floor Scaffolding	11/20/2007	7:06 AM	11/20/2007	3:30 PM	504	1,789	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260964	6-Cedar St 6th Floor Scaffolding	11/20/2007	7:08 AM	11/20/2007	3:32 PM	504	1,820	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260965	7-Roof, East Facade	11/20/2007	7:10 AM	11/20/2007	3:36 PM	508	1,829	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260966	8-Roof, North Facade	11/20/2007	7:12 AM	11/20/2007	3:39 PM	509	1,825	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/22/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260950	3-90 West Courtyard at 2nd Floor Level	11/20/2007	3:48 PM	11/20/2007	11:28 PM	460	1,702	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260951	4-Albany St 6th Floor Scaffolding	11/20/2007	3:28 PM	11/20/2007	11:05 PM	457	1,611	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .002	70 S/m <sup>2</sup>	No	
5260952	5-Washington St 6th Floor Scaffolding	11/20/2007	3:30 PM	11/20/2007	11:06 PM	456	1,642	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260953	6-Cedar St 6th Floor Scaffolding	11/20/2007	3:32 PM	11/20/2007	11:08 PM	456	1,653	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260954	7-Roof, East Facade	11/20/2007	3:38 PM	11/20/2007	11:12 PM	457	1,657	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260955	8-Roof, North Facade	11/20/2007	3:39 PM	11/20/2007	11:14 PM	455	1,684	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260939	3-90 West Courtyard at 2nd Floor Level	11/21/2007	7:50 AM	11/21/2007	3:44 PM	474	1,706	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .002	70 S/m <sup>2</sup>	No	
5260940	4-Albany St 6th Floor Scaffolding	11/21/2007	7:37 AM	11/21/2007	3:26 PM	469	1,688	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260941	5-Washington St 6th Floor Scaffolding	11/21/2007	7:38 AM	11/21/2007	3:27 PM	469	1,685	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260942	6-Cedar St 6th Floor Scaffolding	11/21/2007	7:39 AM	11/21/2007	3:29 PM	471	1,685	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.2	< .0019	70 S/m <sup>2</sup>	No	
5260925	6-Cedar St 6th Floor Scaffolding	11/21/2007	8:08 AM	11/21/2007	3:29 PM	441	1,786	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.8	< .0019	70 S/m <sup>2</sup>	No	
5260943	7-Roof, East Facade	11/21/2007	7:42 AM	11/21/2007	3:35 PM	473	1,703	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.8	< .002	70 S/m <sup>2</sup>	No	
5260944	8-Roof, North Facade	11/21/2007	7:43 AM	11/21/2007	3:37 PM	474	1,706	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/23/2007	0	0	0	0	0	< 8.8	< .002	70 S/m <sup>2</sup>	No	
5260901	3-90 West Courtyard at 2nd Floor Level	11/21/2007	3:44 PM	11/21/2007	10:06 PM	382	1,337	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260902	4-Albany St 6th Floor Scaffolding	11/21/2007	3:26 PM	11/21/2007	9:54 PM	387	1,458	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260903	5-Washington St 6th Floor Scaffolding	11/21/2007	3:27 PM	11/21/2007	9:54 PM	387	1,355	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260904	6-Cedar St 6th Floor Scaffolding	11/21/2007	3:28 PM	11/21/2007	9:52 PM	384	1,344	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260954	7-Roof, East Facade	11/21/2007	3:35 PM	11/21/2007	9:49 PM	371	1,290	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.4	< .0019	70 S/m <sup>2</sup>	No	
5260955	8-Roof, North Facade	11/21/2007	3:37 PM	11/21/2007	9:48 PM	374	1,299	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.4	< .0019	70 S/m <sup>2</sup>	No	
5260928	3-90 West Courtyard at 2nd Floor Level	11/22/2007	7:33 AM	11/22/2007	12:11 PM	273	1,405	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260933	4-Albany St 6th Floor Scaffolding	11/22/2007	7:35 AM	11/22/2007	12:09 PM	274	1,370	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260938	5-Washington St 6th Floor Scaffolding	11/22/2007	7:38 AM	11/22/2007	12:11 PM	273	1,365	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260943	6-Cedar St 6th Floor Scaffolding	11/22/2007	7:40 AM	11/22/2007	12:12 PM	272	1,360	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260948	7-Roof, East Facade	11/22/2007	6:48 AM	11/22/2007	11:20 AM	272	1,363	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260953	8-Roof, North Facade	11/22/2007	6:50 AM	11/22/2007	11:23 PM	272	1,630	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 6.8	< .0019	70 S/m <sup>2</sup>	No	
5260917	3-90 West Courtyard at 2nd Floor Level	11/23/2007	7:38 AM	11/23/2007	3:48 PM	490	1,740	Asbestos	AHERA 40 CFR, Part 763, October 30, 1987 (Modified)	R/LG TEM	11/24/2007	0	0	0	0	0	< 8.8	< .002	70 S/m <sup>2</sup>	No	
5260918	4-Albany St 6th Floor Scaffolding	11/23/2007	7:13 AM	11/23/2007	3:29 PM	496	1,736	Asbestos	AHERA 40 CFR, Part 763, October 30,												

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Barium Concentration ( $\mu\text{g}/\text{m}^3$ )	Chromium Concentration ( $\mu\text{g}/\text{m}^3$ )	Manganese Concentration ( $\mu\text{g}/\text{m}^3$ )	Zinc Concentration ( $\mu\text{g}/\text{m}^3$ )	Beryllium Concentration ( $\mu\text{g}/\text{m}^3$ )	Copper Concentration ( $\mu\text{g}/\text{m}^3$ )	Mercury Particulate Concentration ( $\mu\text{g}/\text{m}^3$ )	Cadmium Concentration ( $\mu\text{g}/\text{m}^3$ )	Lead Concentration ( $\mu\text{g}/\text{m}^3$ )	Nickel Concentration ( $\mu\text{g}/\text{m}^3$ )	Antimony Concentration ( $\mu\text{g}/\text{m}^3$ )	Exceeds Target Air Quality Levels	Exceeds EPA Site Specific Trigger Levels	Comments											
Target Air Quality Levels												5.00	0.60	0.50	16.00	0.02	10.00	0.30	0.04	1.50	0.20	5.00														
EPA Site Specific Trigger Levels												5.00	60.00	0.50	160.00	0.20	100.00	3.00	2.00	5.00	28.00	14.00														
5261269	3 - 90 West Courtyard at 2nd Floor Level	11/18/2007	7:12 AM	11/19/2007	7:02 AM	1,430	4,719	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.018	< 0.042	0.012	0.15	< 0.0021	0.020	< 0.0020	< 0.0020	< 0.008	0.015	< 0.012	No	No												
5261277	4 - Albany St 6th Floor Scaffolding	11/18/2007	7:55 AM	11/19/2007	7:29 AM	1,414	5,020	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.018	< 0.040	0.022	0.13	< 0.0020	0.019	< 0.0020	< 0.0020	< 0.008	0.015	< 0.012	No	No												
5261281	6 - Cedar St 6th Floor Scaffolding	11/18/2007	8:40 AM	11/19/2007	8:02 AM	1,402	5,012	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.017	< 0.040	0.012	0.14	< 0.0020	0.019	< 0.0020	< 0.0020	< 0.008	0.016	< 0.012	No	No												
5261289	5 - Washington St 6th Floor Scaffolding	11/18/2007	8:20 AM	11/19/2007	7:45 AM	1,405	4,637	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.017	< 0.043	0.013	0.14	< 0.0022	0.019	< 0.0022	< 0.0022	0.009	0.018	< 0.013	No	No												
5261297	7 - Roof, East Facade	11/18/2007	7:07 AM	11/19/2007	7:20 AM	1,453	5,212	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.015	< 0.038	0.013	0.11	< 0.0019	0.015	< 0.0019	< 0.0019	< 0.008	0.014	< 0.012	No	No												
5261315	8 - Roof, North Facade	11/18/2007	7:53 AM	11/19/2007	7:53 AM	1,467	5,246	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/20/2007	0.018	< 0.038	0.013	0.14	< 0.0019	0.023	< 0.0019	< 0.0019	0.009	0.016	< 0.011	No	No												
5266520	3 - 90 West Courtyard at 2nd Floor Level	11/19/2007	7:11 AM	11/20/2007	6:56 AM	1,425	4,667	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.043	< 0.043	0.020	0.16	< 0.0021	0.056	< 0.0021	< 0.0021	0.021	0.022	< 0.013	No	No												
5266524	4 - Albany St 6th Floor Scaffolding	11/19/2007	7:37 AM	11/20/2007	7:14 AM	1,417	5,030	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.034	< 0.040	0.020	0.14	< 0.0020	0.244	< 0.0020	< 0.0020	0.017	0.021	< 0.012	No	No												
5266528	5 - Washington St 6th Floor Scaffolding	11/19/2007	7:51 AM	11/20/2007	7:27 AM	1,416	4,744	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.028	< 0.042	0.019	0.14	< 0.0021	0.226	< 0.0021	< 0.0021	0.016	0.018	< 0.013	No	No												
5266534	6 - Cedar St 6th Floor Scaffolding	11/19/2007	8:05 AM	11/20/2007	7:56 AM	1,431	5,331	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.031	< 0.038	0.020	0.13	< 0.0019	0.079	< 0.0019	< 0.0019	0.014	0.018	< 0.012	No	No												
5266538	7 - Roof, East Facade	11/19/2007	7:32 AM	11/20/2007	7:36 AM	1,444	5,298	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.027	< 0.038	0.018	0.11	< 0.0019	0.073	< 0.0019	< 0.0019	0.014	0.018	< 0.011	No	No												
5266543	8 - Roof, North Facade	11/19/2007	8:03 AM	11/20/2007	8:14 AM	1,451	5,200	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/21/2007	0.030	< 0.039	0.018	0.12	< 0.0019	0.140	< 0.0019	< 0.0019	0.014	0.019	< 0.012	No	No												
5266547	3 - 90 West Courtyard at 2nd Floor Level	11/20/2007	7:01 AM	11/21/2007	6:59 AM	1,438	4,781	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.028	0.049	0.013	0.18	< 0.0021	0.037	< 0.0021	< 0.0021	0.013	0.019	< 0.013	No	No												
5266551	4 - Albany St 6th Floor Scaffolding	11/20/2007	7:20 AM	11/21/2007	7:17 AM	1,437	5,245	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.032	0.046	0.013	0.13	< 0.0019	0.033	< 0.0019	< 0.0019	0.010	0.019	< 0.011	No	No												
5266555	5 - Washington St 6th Floor Scaffolding	11/20/2007	7:37 AM	11/21/2007	7:26 AM	1,429	4,787	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.038	0.052	0.017	0.15	< 0.0021	0.037	< 0.0021	< 0.0021	0.016	0.019	< 0.013	No	No												
5266560	6 - Cedar St 6th Floor Scaffolding	11/20/2007	8:00 AM	11/21/2007	7:38 AM	1,418	5,247	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.036	0.050	0.015	0.30	< 0.0019	0.042	< 0.0019	< 0.0019	0.012	0.022	< 0.011	No	No												
5266564	7 - Roof, East Facade	11/20/2007	7:49 AM	11/21/2007	6:52 AM	1,383	4,916	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.030	0.050	0.013	0.16	< 0.0020	0.060	< 0.0020	< 0.0020	0.013	0.017	< 0.012	No	No												
5266570	8 - Roof, North Facade	11/20/2007	8:23 AM	11/21/2007	7:32 AM	1,389	5,010	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/23/2007	0.033	0.056	0.013	0.16	< 0.0020	0.071	< 0.0020	< 0.0020	0.011	0.021	< 0.012	No	No												
5269655	3 - 90 West Courtyard at 2nd Floor Level	11/21/2007	7:05 AM	11/22/2007	7:20 AM	1,455	4,874	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.068	< 0.041	0.027	0.18	< 0.0021	0.053	< 0.0021	< 0.0021	0.022	0.022	< 0.012	No	No												
5269635	4 - Albany St 6th Floor Scaffolding	11/21/2007	7:21 AM	11/22/2007	7:44 AM	1,463	5,377	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.076	0.039	0.031	0.16	< 0.0019	0.063	< 0.0019	< 0.0019	0.024	0.022	0.016	No	No												
5269615	5 - Washington St 6th Floor Scaffolding	11/21/2007	7:31 AM	11/22/2007	7:53 AM	1,462	4,825	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.074	< 0.042	0.033	0.17	< 0.0021	0.070	< 0.0021	< 0.0021	0.022	0.025	< 0.012	No	No												
5269094	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:54 AM	11/22/2007	8:09 AM	1,455	4,765	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.078	0.050	0.039	0.20	< 0.0021	0.074	< 0.0021	< 0.0021	0.027	0.025	0.015	No	No												
5269619	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:43 AM	11/22/2007	8:02 AM	1,459	4,596	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.081	< 0.044	0.038	0.20	< 0.0022	0.070	< 0.0022	< 0.0022	0.024	0.025	< 0.013	No	No												
5269663	7 - Roof, East Facade	11/21/2007	7:02 AM	11/22/2007	7:00 AM	1,438	5,118	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.062	< 0.040	0.037	0.17	< 0.0020	0.055	< 0.0020	< 0.0020	0.020	0.023	< 0.012	No	No												
5269627	8 - Roof, North Facade	11/21/2007	7:44 AM	11/22/2007	7:30 AM	1,426	5,122	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.065	0.040	0.031	0.17	< 0.0020	0.063	< 0.0020	< 0.0020	0.019	0.023	0.013	No	No												
5269929	3 - 90 West Courtyard at 2nd Floor Level	11/22/2007	7:24 AM	11/23/2007	7:04 AM	1,420	4,722	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.017	0.068	0.010	0.06	< 0.0021	0.019	< 0.0021	< 0.0021	< 0.009	0.009	< 0.013	No	No												
5269934	4 - Albany St 6th Floor Scaffolding	11/22/2007	7:48 AM	11/23/2007	7:22 AM	1,414	5,126	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.015	0.045	< 0.008	0.06	< 0.0020	0.017	< 0.0020	< 0.0020	< 0.008	0.009	< 0.012	No	No												
5269939	5 - Washington St 6th Floor Scaffolding	11/22/2007	7:53 AM	11/23/2007	7:33 AM	1,420	4,615	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.012	0.052	< 0.009	< 0.04	< 0.0022	0.013	< 0.0022	< 0.0022	< 0.009	0.009	< 0.013	No	No												
5269944	6 - Cedar St 6th Floor Scaffolding	11/22/2007	8:13 AM	11/23/2007	7:43 AM	1,410	4,406	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.016	< 0.045	0.010	0.07	< 0.0023	0.021	< 0.0023	< 0.0023	0.021	0.011	< 0.014	No	No												
5269949	7 - Roof, East Facade	11/22/2007	7:10 AM	11/23/2007	6:44 AM	1,414	4,960	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.015	0.045	0.009	0.05	< 0.0020	0.016	< 0.0020	< 0.0020	< 0.008	0.009	< 0.012	No	No												
5269954	8 - Roof, North Facade	11/22/2007	7:39 AM	11/23/2007	7:15 AM	1,416	4,854	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/24/2007	0.011	0.055	< 0.009	0.08	< 0.0021	0.013	< 0.0021	< 0.0021	< 0.008	0.008	< 0.012	No	No												
5261336	3 - 90 West Courtyard at 2nd Floor Level	11/23/2007	7:08 AM	11/24/2007	6:56 AM	1,428	4,748	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.016	< 0.042	0.011	0.13	< 0.0021	0.018	< 0.0021	< 0.0021	0.012	0.009	< 0.013	No	No												
5269683	4 - Albany St 6th Floor Scaffolding	11/23/2007	7:27 AM	11/24/2007	7:15 AM	1,428	5,034	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.010	< 0.040	< 0.008	0.10	< 0.0020	0.014	< 0.0020	< 0.0020	< 0.008	0.008	0.012	No	No												
5269639	5 - Washington St 6th Floor Scaffolding	11/23/2007	7:37 AM	11/24/2007	7:25 AM	1,428	4,391	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.013	< 0.046	0.018	0.10	< 0.0023	0.015	< 0.0023	< 0.0023	< 0.009	0.009	< 0.014	No	No												
5269691	6 - Cedar St 6th Floor Scaffolding	11/23/2007	7:51 AM	11/24/2007	7:38 AM	1,427	4,959	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.011	0.043	0.012	0.11	< 0.0020	0.015	< 0.0020	< 0.0020	< 0.008	0.012	< 0.012	No	No												
5269623	7 - Roof, East Facade	11/23/2007	6:54 AM	11/24/2007	6:42 AM	1,428	5,177	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.012	< 0.039	0.010	0.10	< 0.0019	0.017	< 0.0019	< 0.0019	0.012	0.008	< 0.012	No	No												
5269651	8 - Roof, North Facade	11/23/2007	7:25 AM	11/24/2007	7:14 AM	1,429	5,142	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/26/2007	0.014	< 0.039	0.011	0.11	< 0.0019	0.021	< 0.0019	< 0.0019	0.010	0.008	< 0.012	No	No												
5269631	3 - 90 West Courtyard at 2nd Floor Level	11/24/2007	7:01 AM	11/25/2007	9:15 AM	1,574	5,273	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/27/2007	0.020	< 0.038	0.008	0.10	< 0.0019	0.022	< 0.0019	< 0.0019	0.011	0.014	< 0.011	No	No												
5269611	4 - Albany St 6th Floor Scaffolding	11/24/2007	7:20 AM	11/25/2007	7:31 AM	1,451	5,042	Metals	NIOSH 7300 Modified ICP-MS	RJLG Metals	11/27/2007	0.025	< 0.040	0.010	0.12	< 0.0020	0.027	< 0.0020	< 0.0020	0.010	0.019	< 0.012	No	No												
5266510	5 - Washington St 6th Floor Scaffolding	11/24/2007	7:45 AM	11/25/2007	7:58 AM	1,453	4,577	Met																												

MasterWorks - 130 Cedar Building, Community Monitoring																
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Mercury Concentration (ng/m³)	EPA Site Specific Trigger Level for Mercury (ng/m³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments	
5261272	3 - 90 West Courtyard at 2nd Floor Level	11/18/2007	7:12 AM	11/19/2007	7:02 AM	1,430	558	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	< 6	3000 ng/m3	No		
5261280	4 - Albany St 6th Floor Scaffolding	11/18/2007	7:55 AM	11/19/2007	8:17 AM	1,462	556	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	< 6	3000 ng/m3	No		
5261284	6 - Cedar St 6th Floor Scaffolding	11/18/2007	8:40 AM	11/19/2007	8:32 AM	1,432	580	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	< 5	3000 ng/m3	No		
5261292	5 - Washington St 6th Floor Scaffolding	11/18/2007	8:20 AM	11/19/2007	8:26 AM	1,446	564	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	< 5	3000 ng/m3	No		
5261300	7 - Roof, East Facade	11/18/2007	7:07 AM	11/19/2007	7:20 AM	1,453	581	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	< 5	3000 ng/m3	No		
5261318	8 - Roof, North Facade	11/18/2007	7:26 AM	11/19/2007	7:53 AM	N/A	N/A	Mercury	EPA 324/1631 mod.	BRL	11/20/2007	N/A	N/A	N/A	Sample Voided - Sampling Error	
5266523	3 - 90 West Courtyard at 2nd Floor Level	11/19/2007	7:11 AM	11/20/2007	6:56 AM	1,425	542	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 6	3000 ng/m3	No		
5266527	4 - Albany St 6th Floor Scaffolding	11/19/2007	8:22 AM	11/20/2007	7:14 AM	1,372	549	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 6	3000 ng/m3	No		
5266531	5 - Washington St 6th Floor Scaffolding	11/19/2007	8:29 AM	11/20/2007	7:27 AM	1,378	551	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 6	3000 ng/m3	No		
5266537	6 - Cedar St 6th Floor Scaffolding	11/19/2007	8:35 AM	11/20/2007	7:56 AM	1,401	560	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 5	3000 ng/m3	No		
5266541	7 - Roof, East Facade	11/19/2007	7:32 AM	11/20/2007	7:36 AM	1,444	563	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 5	3000 ng/m3	No		
5266546	8 - Roof, North Facade	11/19/2007	8:03 AM	11/20/2007	8:14 AM	1,451	559	Mercury	EPA 324/1631 mod.	BRL	11/21/2007	< 6	3000 ng/m3	No		
5266550	3 - 90 West Courtyard at 2nd Floor Level	11/20/2007	7:01 AM	11/21/2007	6:59 AM	1,438	518	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 6	3000 ng/m3	No		
5266554	4 - Albany St 6th Floor Scaffolding	11/20/2007	7:20 AM	11/21/2007	7:17 AM	1,437	575	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 5	3000 ng/m3	No		
5266558	5 - Washington St 6th Floor Scaffolding	11/20/2007	7:37 AM	11/21/2007	7:26 AM	1,429	600	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 5	3000 ng/m3	No		
5266563	6 - Cedar St 6th Floor Scaffolding	11/20/2007	8:00 AM	11/21/2007	7:38 AM	1,418	589	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 5	3000 ng/m3	No		
5266567	7 - Roof, East Facade	11/20/2007	7:49 AM	11/21/2007	6:52 AM	1,383	546	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 6	3000 ng/m3	No		
5266573	8 - Roof, North Facade	11/20/2007	8:23 AM	11/21/2007	7:32 AM	1,389	549	Mercury	EPA 324/1631 mod.	BRL	11/23/2007	< 6	3000 ng/m3	No		
5269658	3 - 90 West Courtyard at 2nd Floor Level	11/21/2007	7:05 AM	11/22/2007	7:20 AM	1,455	546	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	8	3000 ng/m3	No		
5269638	4 - Albany St 6th Floor Scaffolding	11/21/2007	7:21 AM	11/22/2007	7:44 AM	1,463	585	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269618	5 - Washington St 6th Floor Scaffolding	11/21/2007	7:31 AM	11/22/2007	7:53 AM	1,462	585	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269097	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:54 AM	11/22/2007	8:09 AM	1,455	582	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269622	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:43 AM	11/22/2007	8:02 AM	1,459	584	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269666	7 - Roof, East Facade	11/21/2007	7:02 AM	11/22/2007	7:00 AM	1,438	568	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269630	8 - Roof, North Facade	11/21/2007	7:44 AM	11/22/2007	7:30 AM	1,426	556	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 6	3000 ng/m3	No		
5269932	3 - 90 West Courtyard at 2nd Floor Level	11/22/2007	7:24 AM	11/23/2007	7:04 AM	1,420	426	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 7	3000 ng/m3	No		
5269937	4 - Albany St 6th Floor Scaffolding	11/22/2007	7:48 AM	11/23/2007	7:22 AM	1,414	566	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269942	5 - Washington St 6th Floor Scaffolding	11/22/2007	7:53 AM	11/23/2007	7:33 AM	1,420	561	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269947	6 - Cedar St 6th Floor Scaffolding	11/22/2007	8:13 AM	11/23/2007	7:43 AM	1,410	578	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	< 5	3000 ng/m3	No		
5269952	7 - Roof, East Facade	11/22/2007	7:10 AM	11/23/2007	6:44 AM	1,414	559	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	8	3000 ng/m3	No		
5269957	8 - Roof, North Facade	11/22/2007	7:39 AM	11/23/2007	7:15 AM	1,416	574	Mercury	EPA 324/1631 mod.	BRL	11/24/2007	6	3000 ng/m3	No		
5261339	3 - 90 West Courtyard at 2nd Floor Level	11/23/2007	8:02 AM	11/24/2007	6:56 AM	1,374	550	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	< 6	3000 ng/m3	No		
5269686	4 - Albany St 6th Floor Scaffolding	11/23/2007	7:27 AM	11/24/2007	7:15 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	6	3000 ng/m3	No		
5269642	5 - Washington St 6th Floor Scaffolding	11/23/2007	7:37 AM	11/24/2007	7:25 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	< 5	3000 ng/m3	No		
5269694	6 - Cedar St 6th Floor Scaffolding	11/23/2007	7:51 AM	11/24/2007	7:38 AM	1,427	571	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	< 5	3000 ng/m3	No		
5269626	7 - Roof, East Facade	11/23/2007	6:54 AM	11/24/2007	6:42 AM	1,428	564	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	< 5	3000 ng/m3	No		
5269654	8 - Roof, North Facade	11/23/2007	7:25 AM	11/24/2007	7:14 AM	1,429	579	Mercury	EPA 324/1631 mod.	BRL	11/26/2007	6	3000 ng/m3	No		
5269634	3 - 90 West Courtyard at 2nd Floor Level	11/24/2007	7:01 AM	11/25/2007	9:15 AM	1,574	559	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	< 6	3000 ng/m3	No		
5269614	4 - Albany St 6th Floor Scaffolding	11/24/2007	7:20 AM	11/25/2007	7:31 AM	1,451	530	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	< 6	3000 ng/m3	No		
5269670	5 - Washington St 6th Floor Scaffolding	11/24/2007	7:30 AM	11/25/2007	7:58 AM	1,468	529	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	< 6	3000 ng/m3	No		
5269674	6 - Cedar St 6th Floor Scaffolding	11/24/2007	7:45 AM	11/25/2007	8:30 AM	1,485	520	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	< 6	3000 ng/m3	No		
5269698	7 - Roof, East Facade	11/24/2007	6:53 AM	11/25/2007	8:16 AM	1,523	594	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	< 5	3000 ng/m3	No		
5269678	8 - Roof, North Facade	11/24/2007	7:24 AM	11/25/2007	8:35 AM	1,511	589	Mercury	EPA 324/1631 mod.	BRL	11/27/2007	13	3000 ng/m3	No		

MasterWorks - 130 Cedar Building, Community Monitoring																
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Asbestos Concentration (f/cc)	MMVF Concentration (f/cc)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
5261271	3 - 90 West Courtyard at 2nd Floor Level	11/18/2007	7:12 AM	11/19/2007	7:02 AM	1,430	4,505	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5261279	4 - Albany St 6th Floor Scaffolding	11/18/2007	7:55 AM	11/19/2007	7:29 AM	1,414	5,020	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5261291	5 - Washington St 6th Floor Scaffolding	11/18/2007	8:20 AM	11/19/2007	7:45 AM	1,405	4,707	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5261283	6 - Cedar St 6th Floor Scaffolding	11/18/2007	8:40 AM	11/19/2007	8:02 AM	1,402	4,592	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5261299	7 - Roof, East Facade	11/18/2007	7:07 AM	11/19/2007	7:20 AM	1,453	5,043	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5261317	8 - Roof, North Facade	11/18/2007	7:26 AM	11/19/2007	7:53 AM	1,467	5,055	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/20/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5266522	3 - 90 West Courtyard at 2nd Floor Level	11/19/2007	7:11 AM	11/20/2007	6:56 AM	1,425	4,489	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266526	4 - Albany St 6th Floor Scaffolding	11/19/2007	7:37 AM	11/20/2007	7:14 AM	1,417	4,889	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5266530	5 - Washington St 6th Floor Scaffolding	11/19/2007	7:51 AM	11/20/2007	7:27 AM	1,416	4,460	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	0.00005	<0.00005	0.0009 f/cc	No	
5266536	6 - Cedar St 6th Floor Scaffolding	11/19/2007	8:05 AM	11/20/2007	7:56 AM	1,431	4,508	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266540	7 - Roof, East Facade	11/19/2007	7:32 AM	11/20/2007	7:36 AM	1,444	4,922	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5266545	8 - Roof, North Facade	11/19/2007	8:03 AM	11/20/2007	8:14 AM	1,451	5,004	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/21/2007	0.00004	<0.00004	0.0009 f/cc	No	
5266549	3 - 90 West Courtyard at 2nd Floor Level	11/20/2007	7:01 AM	11/21/2007	6:59 AM	1,438	4,242	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266553	4 - Albany St 6th Floor Scaffolding	11/20/2007	7:20 AM	11/21/2007	7:17 AM	1,437	4,311	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266557	5 - Washington St 6th Floor Scaffolding	11/20/2007	7:37 AM	11/21/2007	7:26 AM	1,429	4,323	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266562	6 - Cedar St 6th Floor Scaffolding	11/20/2007	8:00 AM	11/21/2007	7:38 AM	1,418	4,219	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266566	7 - Roof, East Facade	11/20/2007	7:49 AM	11/21/2007	6:52 AM	1,383	4,168	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5266571	8 - Roof, North Facade	11/20/2007	8:23 AM	11/21/2007	7:32 AM	1,389	3,933	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/23/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269657	3 - 90 West Courtyard at 2nd Floor Level	11/21/2007	7:05 AM	11/22/2007	7:20 AM	1,455	4,074	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269637	4 - Albany St 6th Floor Scaffolding	11/21/2007	7:21 AM	11/22/2007	7:44 AM	1,463	4,133	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	0.00005	0.0009 f/cc	No	
5269617	5 - Washington St 6th Floor Scaffolding	11/21/2007	7:31 AM	11/22/2007	7:53 AM	1,462	3,947	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	0.00010	0.00005	0.0009 f/cc	No	
5269096	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:54 AM	11/22/2007	8:09 AM	1,455	4,001	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	0.00010	0.0009 f/cc	No	
5269621	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:43 AM	11/22/2007	8:02 AM	1,459	4,195	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269665	7 - Roof, East Facade	11/21/2007	7:02 AM	11/22/2007	7:00 AM	1,438	3,751	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	0.00005	<0.00005	0.0009 f/cc	No	
5269629	8 - Roof, North Facade	11/21/2007	7:44 AM	11/22/2007	7:30 AM	1,426	4,309	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269931	3 - 90 West Courtyard at 2nd Floor Level	11/22/2007	7:24 AM	11/23/2007	7:04 AM	1,420	4,189	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269936	4 - Albany St 6th Floor Scaffolding	11/22/2007	7:48 AM	11/23/2007	7:22 AM	1,414	4,030	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269941	5 - Washington St 6th Floor Scaffolding	11/22/2007	7:53 AM	11/23/2007	7:33 AM	1,420	4,225	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269946	6 - Cedar St 6th Floor Scaffolding	11/22/2007	8:13 AM	11/23/2007	7:43 AM	1,410	4,124	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269951	7 - Roof, East Facade	11/22/2007	7:10 AM	11/23/2007	6:44 AM	1,414	4,852	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269956	8 - Roof, North Facade	11/22/2007	7:39 AM	11/23/2007	7:15 AM	1,416	4,150	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/24/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5261338	3 - 90 West Courtyard at 2nd Floor Level	11/23/2007	7:08 AM	11/24/2007	6:56 AM	1,428	4,248	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269685	4 - Albany St 6th Floor Scaffolding	11/23/2007	7:27 AM	11/24/2007	7:15 AM	1,428	4,213	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269641	5 - Washington St 6th Floor Scaffolding	11/23/2007	7:37 AM	11/24/2007	7:25 AM	1,428	4,284	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269693	6 - Cedar St 6th Floor Scaffolding	11/23/2007	7:51 AM	11/24/2007	7:38 AM	1,427	4,138	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269625	7 - Roof, East Facade	11/23/2007	6:54 AM	11/24/2007	6:42 AM	1,428	4,345	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269653	8 - Roof, North Facade	11/23/2007	7:25 AM	11/24/2007	7:14 AM	1,429	4,323	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269633	3 - 90 West Courtyard at 2nd Floor Level	11/24/2007	7:01 AM	11/25/2007	9:15 AM	1,574	4,958	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269613	4 - Albany St 6th Floor Scaffolding	11/24/2007	7:20 AM	11/25/2007	7:31 AM	1,451	4,389	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5269669	5 - Washington St 6th Floor Scaffolding	11/24/2007	7:30 AM	11/25/2007	7:58 AM	1,468	4,551	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00004	0.00004	0.0009 f/cc	No	
5269673	6 - Cedar St 6th Floor Scaffolding	11/24/2007	7:45 AM	11/25/2007	8:30 AM	1,485	4,604	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269697	7 - Roof, East Facade	11/24/2007	6:53 AM	11/25/2007	8:16 AM	1,523	4,734	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269677	8 - Roof, North Facade	11/24/2007	7:24 AM	11/25/2007	8:35 AM	1,511	4,816	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/27/2007	<0.00004	<0.00004	0.0009 f/cc	No	

MasterWorks - 130 Cedar Building, Community Monitoring																	
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Respirable Dust Concentration (mg/m <sup>3</sup> )	Respirable Quartz Concentration (mg/m <sup>3</sup> )	Target Air quality Level for Respirable Quartz (mg/m <sup>3</sup> )	EPA Site Specific Trigger Level for Respirable Quartz (mg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5261270	3 - 90 West Courtyard at 2nd Floor Level	11/18/2007	7:12 AM	11/19/2007	7:02 AM	1,430	3,718	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	< 0.027	< 0.001	0.01	0.01	No	
5261278	4 - Albany St 6th Floor Scaffolding	11/18/2007	7:55 AM	11/19/2007	7:29 AM	1,414	3,535	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	0.029	< 0.001	0.01	0.01	No	
5261282	6 - Cedar St 6th Floor Scaffolding	11/18/2007	8:40 AM	11/19/2007	8:02 AM	1,402	3,505	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	< 0.029	< 0.001	0.01	0.01	No	
5261290	5 - Washington St 6th Floor Scaffolding	11/18/2007	8:20 AM	11/19/2007	7:45 AM	1,405	3,513	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	< 0.028	< 0.001	0.01	0.01	No	
5261298	7 - Roof, East Facade	11/18/2007	7:07 AM	11/19/2007	7:20 AM	1,453	3,633	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	0.039	< 0.001	0.01	0.01	No	
5261316	8 - Roof, North Facade	11/18/2007	7:26 AM	11/19/2007	7:53 AM	1,467	3,668	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/20/2007	< 0.027	< 0.001	0.01	0.01	No	
5266521	3 - 90 West Courtyard at 2nd Floor Level	11/19/2007	7:11 AM	11/20/2007	6:56 AM	1,425	3,563	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	0.455	< 0.001	0.01	0.01	No	
5266525	4 - Albany St 6th Floor Scaffolding	11/19/2007	7:37 AM	11/20/2007	7:14 AM	1,417	3,543	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	0.028	< 0.001	0.01	0.01	No	
5266529	5 - Washington St 6th Floor Scaffolding	11/19/2007	7:51 AM	11/20/2007	7:27 AM	1,416	3,540	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	< 0.028	< 0.001	0.01	0.01	No	
5266535	6 - Cedar St 6th Floor Scaffolding	11/19/2007	8:05 AM	11/20/2007	7:56 AM	1,431	3,578	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	0.042	< 0.001	0.01	0.01	No	
5266539	7 - Roof, East Facade	11/19/2007	7:32 AM	11/20/2007	7:36 AM	1,444	3,754	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	< 0.027	< 0.001	0.01	0.01	No	
5266544	8 - Roof, North Facade	11/19/2007	8:03 AM	11/20/2007	8:14 AM	1,451	3,700	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/21/2007	< 0.027	< 0.001	0.01	0.01	No	
5266548	3 - 90 West Courtyard at 2nd Floor Level	11/20/2007	7:01 AM	11/21/2007	6:59 AM	1,438	3,595	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.028	< 0.001	0.01	0.01	No	
5266552	4 - Albany St 6th Floor Scaffolding	11/20/2007	7:20 AM	11/21/2007	7:17 AM	1,437	3,593	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.028	< 0.001	0.01	0.01	No	
5266556	5 - Washington St 6th Floor Scaffolding	11/20/2007	7:37 AM	11/21/2007	7:26 AM	1,429	3,644	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.027	< 0.001	0.01	0.01	No	
5266561	6 - Cedar St 6th Floor Scaffolding	11/20/2007	8:00 AM	11/21/2007	7:38 AM	1,418	3,545	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.028	< 0.001	0.01	0.01	No	
5266565	7 - Roof, East Facade	11/20/2007	7:49 AM	11/21/2007	6:52 AM	1,383	3,596	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.028	< 0.001	0.01	0.01	No	
5266572	8 - Roof, North Facade	11/20/2007	8:23 AM	11/21/2007	7:32 AM	1,389	3,542	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/23/2007	< 0.028	< 0.001	0.01	0.01	No	
5269656	3 - 90 West Courtyard at 2nd Floor Level	11/21/2007	7:05 AM	11/22/2007	7:20 AM	1,455	3,638	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.040	< 0.001	0.01	0.01	No	
5269636	4 - Albany St 6th Floor Scaffolding	11/21/2007	7:21 AM	11/22/2007	7:44 AM	1,463	3,658	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.045	< 0.001	0.01	0.01	No	
5269616	5 - Washington St 6th Floor Scaffolding	11/21/2007	7:31 AM	11/22/2007	7:53 AM	1,462	3,582	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.047	< 0.001	0.01	0.01	No	
5269095	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:54 AM	11/22/2007	8:09 AM	1,455	3,638	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.051	< 0.001	0.01	0.01	No	
5269620	6 - Cedar St 6th Floor Scaffolding	11/21/2007	7:43 AM	11/22/2007	8:02 AM	1,459	3,648	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.047	< 0.001	0.01	0.01	No	
5269664	7 - Roof, East Facade	11/21/2007	7:02 AM	11/22/2007	7:00 AM	1,438	3,667	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.047	< 0.001	0.01	0.01	No	
5269628	8 - Roof, North Facade	11/21/2007	7:44 AM	11/22/2007	7:30 AM	1,426	3,636	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	0.044	< 0.001	0.01	0.01	No	
5269930	3 - 90 West Courtyard at 2nd Floor Level	11/22/2007	7:24 AM	11/23/2007	7:04 AM	1,420	3,550	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.028	< 0.001	0.01	0.01	No	
5269935	4 - Albany St 6th Floor Scaffolding	11/22/2007	7:48 AM	11/23/2007	7:22 AM	1,414	3,464	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.029	< 0.001	0.01	0.01	No	
5269940	5 - Washington St 6th Floor Scaffolding	11/22/2007	7:53 AM	11/23/2007	7:33 AM	1,420	3,550	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.028	< 0.001	0.01	0.01	No	
5269945	6 - Cedar St 6th Floor Scaffolding	11/22/2007	8:13 AM	11/23/2007	7:43 AM	1,410	3,525	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.028	< 0.001	0.01	0.01	No	
5269950	7 - Roof, East Facade	11/22/2007	7:10 AM	11/23/2007	6:44 AM	1,414	3,464	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.029	< 0.001	0.01	0.01	No	
5269955	8 - Roof, North Facade	11/22/2007	7:39 AM	11/23/2007	7:15 AM	1,416	3,398	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/24/2007	< 0.029	< 0.001	0.01	0.01	No	
5261337	3 - 90 West Courtyard at 2nd Floor Level	11/23/2007	7:08 AM	11/24/2007	6:56 AM	1,428	3,978	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269684	4 - Albany St 6th Floor Scaffolding	11/23/2007	7:27 AM	11/24/2007	7:15 AM	1,428	3,570	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269640	5 - Washington St 6th Floor Scaffolding	11/23/2007	7:37 AM	11/24/2007	7:25 AM	1,428	3,570	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269692	6 - Cedar St 6th Floor Scaffolding	11/23/2007	7:51 AM	11/24/2007	7:38 AM	1,427	3,568	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269624	7 - Roof, East Facade	11/23/2007	6:54 AM	11/24/2007	6:42 AM	1,428	3,570	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269652	8 - Roof, North Facade	11/23/2007	7:25 AM	11/24/2007	7:14 AM	1,429	3,573	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/26/2007	< 0.028	< 0.001	0.01	0.01	No	
5269632	3 - 90 West Courtyard at 2nd Floor Level	11/24/2007	7:01 AM	11/25/2007	6:15 AM	1,574	3,817	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.026	< 0.001	0.01	0.01	No	
5269612	4 - Albany St 6th Floor Scaffolding	11/24/2007	7:20 AM	11/25/2007	7:31 PM	1,451	3,555	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.023	< 0.001	0.01	0.01	No	
5269668	5 - Washington St 6th Floor Scaffolding	11/24/2007	7:30 AM	11/25/2007	7:58 AM	1,468	3,670	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.027	< 0.001	0.01	0.01	No	
5269672	6 - Cedar St 6th Floor Scaffolding	11/24/2007	7:45 AM	11/25/2007	8:30 AM	1,485	3,713	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.027	< 0.001	0.01	0.01	No	
5269696	7 - Roof, East Facade	11/24/2007	6:53 AM	11/25/2007	8:16 AM	1,523	3,808	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.026	< 0.001	0.01	0.01	No	
5269675	8 - Roof, North Facade	11/24/2007	7:24 AM	11/25/2007	8:35 AM	1,511	3,929	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/27/2007	< 0.025	< 0.001	0.01	0.01	No	


MasterWorks - 130 Cedar Building, Community Monitoring														
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>2.5</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>2.5</sub> (µg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	10	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	10	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	10	65	No	
N/A	7 - Roof, East	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	8	65	No	
N/A	8 - Roof, North	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	9	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	10	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	11	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	11	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	12	65	No	
N/A	7 - Roof, East	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	14	65	No	
N/A	8 - Roof, North	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	13	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	16	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	16	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	18	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	19	65	No	
N/A	7 - Roof, East	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	29	65	No	
N/A	8 - Roof, North	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	21	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	32	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	36	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	39	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	39	65	No	
N/A	7 - Roof, East	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	41	65	No	
N/A	8 - Roof, North	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	38	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	24	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	24	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	24	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	27	65	No	
N/A	7 - Roof, East	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	36	65	No	
N/A	8 - Roof, North	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	31	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	8	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	7	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	7	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	8	65	No	
N/A	7 - Roof, East	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	7	65	No	
N/A	8 - Roof, North	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	7	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	10	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	9	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	9	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	10	65	No	
N/A	7 - Roof, East	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	9	65	No	
N/A	8 - Roof, North	11/24/2007	12:00 AM	11/25/2007	12:00 AM	905	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4607	N/A	12	65	No	Partial sampling time - instrument malfunction

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>10</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>10</sub> (µg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	12	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	13	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	12	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	12	150	No	
N/A	7 - Roof, East	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	13	150	No	
N/A	8 - Roof, North	11/18/2007	12:00 AM	11/19/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	12	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	17	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	23	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	28	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	32	150	No	
N/A	7 - Roof, East	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	27	150	No	
N/A	8 - Roof, North	11/19/2007	12:00 AM	11/20/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	33	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	29	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	29	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	28	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	34	150	No	
N/A	7 - Roof, East	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	34	150	No	
N/A	8 - Roof, North	11/20/2007	12:00 AM	11/21/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	40	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	45	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	57	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	49	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	49	150	No	
N/A	7 - Roof, East	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	67	150	No	
N/A	8 - Roof, North	11/21/2007	12:00 AM	11/22/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	52	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	30	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	40	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	44	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	51	150	No	
N/A	7 - Roof, East	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	71	150	No	
N/A	8 - Roof, North	11/22/2007	12:00 AM	11/23/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	45	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	8	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	8	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	9	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	9	150	No	
N/A	7 - Roof, East	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	9	150	No	
N/A	8 - Roof, North	11/23/2007	12:00 AM	11/24/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	9	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	11	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	11	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	11	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	11	150	No	
N/A	7 - Roof, East	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	14	150	No	
N/A	8 - Roof, North	11/24/2007	12:00 AM	11/25/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	12	150	No	

350 Hochberg Road, Monroeville, PA 15146  
Phone: (724) 325-1776 Fax: (724) 733-1799

Mercury Vapor ( $Hg^0$ ) Air Results for Outdoor Community  
Monitoring Stations by Location as recorded by the Lumex Analyzer

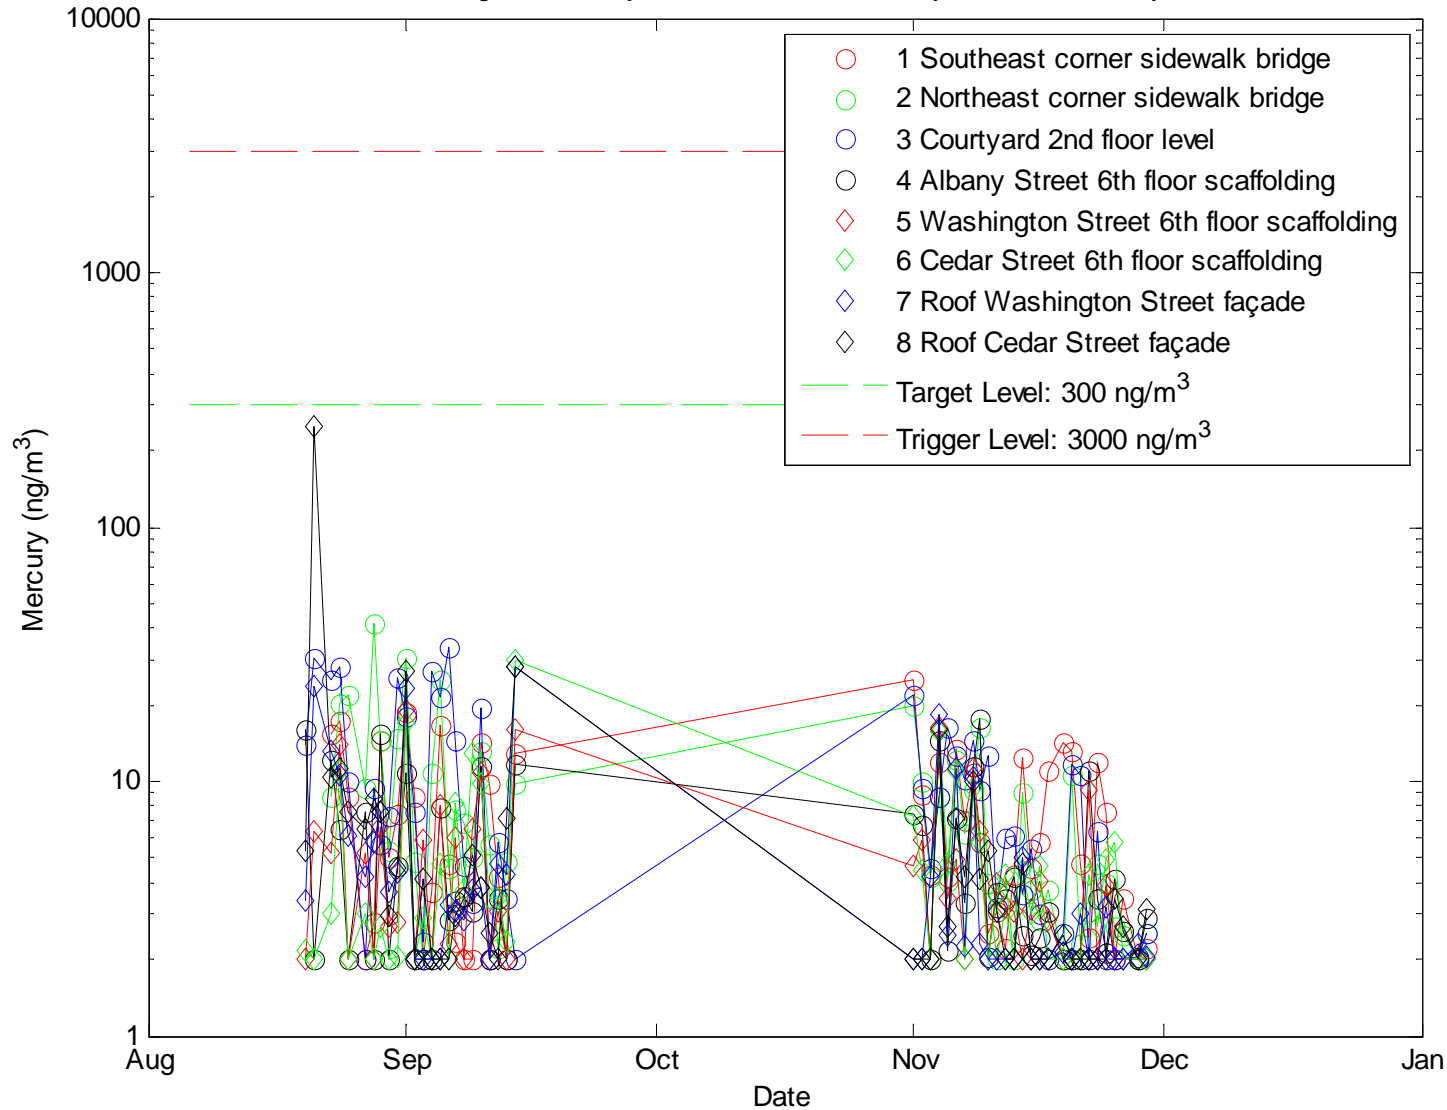

350 Hochberg Road, Monroeville, PA 15146  
Phone: (724) 325-1776 Fax: (724) 733-1799

## Report Summary

Air Mercury Results (Hg<sup>0</sup>, ng/m<sup>3</sup>) as recorded by the Lumex RA915+ analyzer

Week of 11/18/07 to 11/24/07

Date	Mercury (Hg <sup>0</sup> ) ng/m <sup>3</sup> 30-sec readings	1 Southeast corner sidewalk bridge	2 Northeast corner sidewalk bridge	3 Courtyard 2nd floor level	4 Albany Street 6th floor scaffolding	5 Washington Street 6th floor scaffolding	6 Cedar Street 6th floor scaffolding	7 Roof Washington Street façade	8 Roof Cedar Street façade
19-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	14	2	3	2	2	2	2	3
	Maximum	30	2	4	3	4	4	5	4
20-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	13	11	12	2	2	2	2	2
	Maximum	49	44	54	4	6	2	3	2
21-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	5	2	11	2	2	2	3	2
	Maximum	13	4	24	3	2	3	6	4
22-Nov-07	# Samples	9	9	9	9	9	9	9	9
	Average	2	3	2	11	9	4	2	2
	Maximum	4	3	3	12	11	7	2	2
23-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	12	5	6	3	2	3	2	2
	Maximum	21	8	12	6	6	7	4	3
24-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	8	4	2	2	4	5	3	2
	Maximum	14	7	7	10	11	9	9	7