

Sample Nos. - 130 Cedar Building, Community Monitoring																					
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Total Structure Count			Asbestos < 5 µm	Asbestos ≥ 5 µm	Result (µm/m ³)	Concentration (µg/cf)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
												All Asbestos	Chrysotile	Amphibole							
5269755	3-90 West Courtyard at 2nd Floor Level	12/23/2007	8:12 AM	12/23/2007	12:15 PM	243	1,458	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.2	< .0019	70 µm/m ²	No	
5269756	4-Albany St 6th Floor Scalloiding	12/23/2007	8:20 AM	12/23/2007	12:24 PM	236	1,428	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.2	< .002	70 µm/m ²	No	
5269757	5-Washington St 6th Floor Scalloiding	12/23/2007	8:30 AM	12/23/2007	12:25 PM	235	1,410	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.2	< .002	70 µm/m ²	No	
5269758	6-Cedar St 6th Floor Scalloiding	12/23/2007	8:33 AM	12/23/2007	12:26 PM	233	1,421	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.2	< .002	70 µm/m ²	No	
5269759	7-Roof, East Facade	12/23/2007	7:58 AM	12/23/2007	12:07 PM	249	2,009	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	1	1	0	1	0	8.8	< .001	70 µm/m ²	No	
5269760	8-Roof, North Facade	12/23/2007	8:00 AM	12/23/2007	12:08 PM	248	2,039	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 10.5	< .002	70 µm/m ²	No	
5269761	3-90 West Courtyard at 2nd Floor Level	12/24/2007	7:46 AM	12/24/2007	11:33 AM	228	1,379	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 6.8	< .0019	70 µm/m ²	No	
5269766	4-Albany St 6th Floor Scalloiding	12/24/2007	7:50 AM	12/24/2007	11:39 AM	221	1,359	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 6.8	< .0019	70 µm/m ²	No	
5269767	5-Washington St 6th Floor Scalloiding	12/24/2007	7:50 AM	12/24/2007	11:40 AM	221	1,348	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 6.8	< .0019	70 µm/m ²	No	
5269768	6-Cedar St 6th Floor Scalloiding	12/24/2007	8:00 AM	12/24/2007	11:41 AM	221	1,326	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 6.8	< .002	70 µm/m ²	No	
5269769	7-Roof, East Facade	12/24/2007	7:23 AM	12/24/2007	11:26 AM	243	1,495	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.7	< .002	70 µm/m ²	No	
5269770	8-Roof, North Facade	12/24/2007	7:25 AM	12/24/2007	11:27 AM	242	1,488	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/26/2007	0	0	0	0	0	< 7.7	< .002	70 µm/m ²	No	
5269775	3-90 West Courtyard at 2nd Floor Level	12/25/2007	7:52 AM	12/25/2007	12:08 PM	256	1,562	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269776	4-Albany St 6th Floor Scalloiding	12/25/2007	8:06 AM	12/25/2007	12:01 PM	235	1,434	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.2	< .0019	70 µm/m ²	No	
5269777	5-Washington St 6th Floor Scalloiding	12/25/2007	8:08 AM	12/25/2007	12:02 PM	234	1,427	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.2	< .002	70 µm/m ²	No	
5269778	6-Cedar St 6th Floor Scalloiding	12/25/2007	8:10 AM	12/25/2007	12:03 PM	233	1,433	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.2	< .0019	70 µm/m ²	No	
5269779	7-Roof, East Facade	12/25/2007	7:40 AM	12/25/2007	11:57 AM	257	1,606	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269780	8-Roof, North Facade	12/25/2007	7:42 AM	12/25/2007	11:58 AM	256	1,587	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269782	3-90 West Courtyard at 2nd Floor Level	12/26/2007	8:09 AM	12/26/2007	3:46 PM	457	1,600	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269783	4-Albany St 6th Floor Scalloiding	12/26/2007	7:58 AM	12/26/2007	3:27 PM	449	1,616	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269784	5-Washington St 6th Floor Scalloiding	12/26/2007	8:00 AM	12/26/2007	3:28 PM	448	1,590	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269785	6-Cedar St 6th Floor Scalloiding	12/26/2007	8:02 AM	12/26/2007	3:30 PM	448	1,568	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269786	7-Roof, East Facade	12/26/2007	7:49 AM	12/26/2007	3:36 PM	466	1,676	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269787	8-Roof, North Facade	12/26/2007	7:51 AM	12/26/2007	3:36 PM	465	1,651	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/27/2007	1	1	0	1	0	8.3	0.0019	70 µm/m ²	No	
5269892	3-90 West Courtyard at 2nd Floor Level	12/26/2007	3:46 PM	12/26/2007	10:50 PM	424	1,484	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 7.2	< .0019	70 µm/m ²	No	
5269893	4-Albany St 6th Floor Scalloiding	12/26/2007	3:27 PM	12/26/2007	11:11 PM	464	1,624	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269894	5-Washington St 6th Floor Scalloiding	12/26/2007	3:28 PM	12/26/2007	11:12 PM	464	1,601	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269895	6-Cedar St 6th Floor Scalloiding	12/26/2007	3:30 PM	12/26/2007	11:14 PM	464	1,578	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269896	7-Roof, East Facade	12/26/2007	3:35 PM	12/26/2007	10:55 PM	440	1,540	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 7.7	< .0019	70 µm/m ²	No	
5269897	8-Roof, North Facade	12/26/2007	3:36 PM	12/26/2007	10:57 PM	441	1,522	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 7.7	< .002	70 µm/m ²	No	
5269870	3-90 West Courtyard at 2nd Floor Level	12/27/2007	7:06 AM	12/27/2007	3:45 PM	520	1,846	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269571	4-Albany St 6th Floor Scalloiding	12/27/2007	6:53 AM	12/27/2007	3:25 PM	512	1,816	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269572	5-Washington St 6th Floor Scalloiding	12/27/2007	6:54 AM	12/27/2007	3:26 PM	512	1,843	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269573	6-Cedar St 6th Floor Scalloiding	12/27/2007	6:55 AM	12/27/2007	3:28 PM	513	1,873	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	1	1	0	1	0	9.6	0.002	70 µm/m ²	No	
5269574	7-Roof, East Facade	12/27/2007	6:56 AM	12/27/2007	3:35 PM	516	1,832	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269575	8-Roof, North Facade	12/27/2007	7:00 AM	12/27/2007	3:36 PM	516	1,832	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/28/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269537	3-90 West Courtyard at 2nd Floor Level	12/27/2007	3:45 PM	12/27/2007	11:06 PM	443	1,573	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 7.8	< .0019	70 µm/m ²	No	
5269538	4-Albany St 6th Floor Scalloiding	12/27/2007	3:25 PM	12/27/2007	11:26 PM	481	1,729	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269539	5-Washington St 6th Floor Scalloiding	12/27/2007	3:26 PM	12/27/2007	11:27 PM	481	1,708	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269540	6-Cedar St 6th Floor Scalloiding	12/27/2007	3:28 PM	12/27/2007	11:24 PM	476	1,666	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269541	7-Roof, East Facade	12/27/2007	3:36 PM	12/27/2007	11:13 PM	458	1,649	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269542	8-Roof, North Facade	12/27/2007	3:37 PM	12/27/2007	11:14 PM	458	1,637	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .002	70 µm/m ²	No	
5269745	3-90 West Courtyard at 2nd Floor Level	12/28/2007	7:28 AM	12/28/2007	3:25 PM	477	1,717	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0019	70 µm/m ²	No	
5269746	4-Albany St 6th Floor Scalloiding	12/28/2007	6:59 AM	12/28/2007	3:36 PM	517	1,810	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269747	5-Washington St 6th Floor Scalloiding	12/28/2007	7:00 AM	12/28/2007	3:36 PM	516	1,780	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.9	< .0019	70 µm/m ²	No	
5269748	6-Cedar St 6th Floor Scalloiding	12/28/2007	7:01 AM	12/28/2007	3:37 PM	516	1,858	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 8.3	< .0017	70 µm/m ²	No	
5269749	7-Roof, East Facade	12/28/2007	7:07 AM	12/28/2007	3:20 PM	493	1,726	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 9.1	< .002	70 µm/m ²	No	
5269750	8-Roof, North Facade	12/28/2007	7:08 AM	12/28/2007	3:20 PM	492	1,771	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/29/2007	0	0	0	0	0	< 9.1	< .0019	70 µm/m ²	No	
5270948	3-90 West Courtyard at 2nd Floor Level	12/29/2007	7:26 AM	12/29/2007	3:41 PM	496	1,786	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/31/2007	0	0	0	0	0	< 9	< .0019	70 µm/m ²	No	
5270949	4-Albany St 6th Floor Scalloiding	12/29/2007	7:08 AM	12/29/2007	3:26 PM	496	1,768	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/31/2007	0	0	0	0	0	< 9.1	< .0019	70 µm/m ²	No	
5270950	5-Washington St 6th Floor Scalloiding	12/29/2007	7:09 AM	12/29/2007	3:27 PM	498	1,818	Asbestos	AMERA 40 CFR Part 763, October 30, 1987 (Modified)	R/LG TEM	12/31/2007	0	0								

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Barium	Chromium	Manganese	Zinc	Beryllium	Copper	Mercury Particulate	Cadmium	Lead	Nickel	Antimony	Exceeds Target Air Quality Levels	Exceeds EPA Site Specific Trigger Levels	Comments			
												Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)				Concentration (µg/m ³)	Concentration (µg/m ³)	Concentration (µg/m ³)
												0.50	0.50	0.50	10.00	0.50	10.00	0.30	0.50	0.50	0.50	0.50				0.50	0.50	0.50
5268119	3 - 90 West Courtyard at 2nd Floor Level	12/23/2007	7:58 AM	12/24/2007	7:35 AM	1,417	4,960	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	0.009	0.051	< 0.008	0.12	< 0.002	0.018	< 0.002	< 0.002	< 0.002	0.010	< 0.012	No	No				
5268123	4 - Albany St 6th Floor Scaffolding	12/23/2007	8:43 AM	12/24/2007	8:39 AM	1,436	4,954	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	0.009	0.046	< 0.008	0.10	< 0.002	0.012	< 0.002	< 0.002	< 0.002	0.008	< 0.012	No	No				
5268137	5 - Washington St 6th Floor Scaffolding	12/23/2007	9:02 AM	N/A	N/A	N/A	N/A	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A				
5268151	6 - Cedar St 6th Floor Scaffolding	12/23/2007	9:48 AM	12/24/2007	9:03 AM	1,395	5,182	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	0.009	0.050	< 0.008	0.11	< 0.002	0.012	< 0.002	< 0.002	< 0.002	0.009	< 0.012	No	No	Sample Voided in Field - Cassette Malfunction			
5268135	7 - Roof, East Facade	12/23/2007	8:10 AM	12/24/2007	7:35 AM	1,398	4,360	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	0.009	0.054	< 0.009	0.12	< 0.002	0.013	< 0.002	< 0.002	< 0.009	0.013	< 0.014	No	No				
5268139	8 - Roof, North Facade	12/23/2007	8:25 AM	12/24/2007	7:41 AM	1,396	4,855	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/26/2007	0.009	0.057	< 0.008	0.12	< 0.002	0.015	< 0.002	< 0.002	< 0.008	0.011	< 0.013	No	No				
5268160	3 - 90 West Courtyard at 2nd Floor Level	12/24/2007	7:41 AM	12/25/2007	7:45 AM	1,444	5,090	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.014	0.056	0.019	0.12	< 0.002	0.019	< 0.002	< 0.002	< 0.009	0.032	< 0.014	No	No				
5268164	4 - Albany St 6th Floor Scaffolding	12/24/2007	8:44 AM	12/25/2007	8:44 AM	1,440	5,040	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.013	0.059	0.008	0.12	< 0.002	0.020	< 0.002	< 0.002	< 0.008	0.016	< 0.012	No	No				
5268168	5 - Washington St 6th Floor Scaffolding	12/24/2007	8:56 AM	12/25/2007	8:55 AM	1,439	5,037	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.015	0.060	0.008	0.12	< 0.002	0.020	< 0.002	< 0.002	< 0.008	0.013	< 0.012	No	No				
5268172	6 - Cedar St 6th Floor Scaffolding	12/24/2007	9:11 AM	12/25/2007	9:06 AM	1,435	5,043	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.016	0.057	0.011	0.13	< 0.002	0.022	< 0.002	< 0.002	< 0.008	0.013	< 0.012	No	No				
5268176	7 - Roof, East Facade	12/24/2007	7:33 AM	12/25/2007	7:43 AM	1,450	4,713	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.012	0.057	< 0.009	0.12	< 0.002	0.021	< 0.002	< 0.002	< 0.009	0.014	< 0.013	No	No				
5268180	8 - Roof, North Facade	12/24/2007	7:45 AM	12/25/2007	7:52 AM	1,447	5,055	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.014	0.042	0.011	0.11	< 0.002	0.024	< 0.002	< 0.002	< 0.008	0.015	< 0.012	No	No				
5255962	3 - 90 West Courtyard at 2nd Floor Level	12/25/2007	7:45 AM	12/26/2007	7:11 AM	1,406	4,821	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.013	0.061	< 0.008	0.11	< 0.002	0.023	< 0.002	< 0.002	< 0.008	0.008	< 0.012	No	No				
5268184	4 - Albany St 6th Floor Scaffolding	12/25/2007	8:48 AM	12/26/2007	7:28 AM	1,360	4,838	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.011	0.058	< 0.008	0.12	< 0.002	0.023	< 0.002	< 0.002	< 0.008	0.009	< 0.012	No	No				
5268227	5 - Washington St 6th Floor Scaffolding	12/25/2007	9:00 AM	12/26/2007	7:40 AM	1,360	4,760	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.013	0.071	< 0.008	0.11	< 0.002	0.030	< 0.002	< 0.002	< 0.008	0.008	< 0.013	No	No				
5268231	6 - Cedar St 6th Floor Scaffolding	12/25/2007	9:12 AM	12/26/2007	7:51 AM	1,359	4,689	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.013	0.063	< 0.009	0.10	< 0.002	0.025	< 0.002	< 0.002	< 0.009	0.009	< 0.013	No	No				
5268235	7 - Roof, East Facade	12/25/2007	7:46 AM	12/26/2007	7:07 AM	1,401	4,589	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.012	0.055	< 0.008	0.11	< 0.002	0.025	< 0.002	< 0.002	< 0.008	0.008	< 0.012	No	No				
5268239	8 - Roof, North Facade	12/25/2007	7:56 AM	12/26/2007	7:36 AM	1,420	4,781	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/27/2007	0.011	0.054	< 0.008	0.11	< 0.002	0.025	< 0.002	< 0.002	< 0.008	0.008	< 0.012	No	No				
5268264	3 - 90 West Courtyard at 2nd Floor Level	12/26/2007	7:15 AM	12/27/2007	7:07 AM	1,432	5,012	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.040	0.064	0.026	0.21	< 0.002	0.033	< 0.002	< 0.002	0.061	0.022	< 0.012	No	No				
5268268	4 - Albany St 6th Floor Scaffolding	12/26/2007	7:52 AM	12/27/2007	7:34 AM	1,442	4,939	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.027	0.067	0.024	0.17	< 0.002	0.028	< 0.002	< 0.002	0.012	0.022	< 0.012	No	No				
5268272	5 - Washington St 6th Floor Scaffolding	12/26/2007	7:46 AM	12/27/2007	7:46 AM	1,440	4,968	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.024	0.053	0.024	0.17	< 0.002	0.025	< 0.002	< 0.002	0.012	0.024	< 0.012	No	No				
5268276	6 - Cedar St 6th Floor Scaffolding	12/26/2007	7:56 AM	12/27/2007	8:02 AM	1,446	5,278	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.026	0.053	0.028	0.17	< 0.002	0.025	< 0.002	< 0.002	0.011	0.024	< 0.012	No	No				
5268280	7 - Roof, East Facade	12/26/2007	7:14 AM	12/27/2007	7:08 AM	1,434	4,923	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.026	0.048	0.026	0.16	< 0.002	0.028	< 0.002	< 0.002	0.016	0.023	< 0.012	No	No				
5268284	8 - Roof, North Facade	12/26/2007	7:44 AM	12/27/2007	7:39 AM	1,435	5,137	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/28/2007	0.025	0.058	0.027	0.15	< 0.002	0.040	< 0.002	< 0.002	0.011	0.022	< 0.012	No	No				
5268288	3 - 90 West Courtyard at 2nd Floor Level	12/27/2007	7:12 AM	12/28/2007	7:14 AM	1,442	4,903	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.032	0.049	0.016	0.21	< 0.002	0.146	< 0.002	< 0.002	0.020	0.019	< 0.012	No	No				
5268292	4 - Albany St 6th Floor Scaffolding	12/27/2007	7:38 AM	12/28/2007	7:40 AM	1,442	4,939	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.021	0.056	< 0.002	0.15	< 0.002	0.265	< 0.002	< 0.002	< 0.008	0.019	< 0.012	No	No				
5268296	5 - Washington St 6th Floor Scaffolding	12/27/2007	7:50 AM	12/28/2007	8:01 AM	1,451	4,897	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.022	0.045	0.013	0.13	< 0.002	0.241	< 0.002	< 0.002	< 0.008	0.016	< 0.012	No	No				
5268300	6 - Cedar St 6th Floor Scaffolding	12/27/2007	8:16 AM	12/28/2007	8:28 AM	1,453	5,267	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.025	< 0.008	0.018	0.13	< 0.002	0.265	< 0.002	< 0.002	0.010	0.021	< 0.011	No	No				
5268304	7 - Roof, East Facade	12/27/2007	7:16 AM	12/28/2007	7:05 AM	1,429	4,814	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.023	< 0.042	0.018	0.14	< 0.002	0.208	< 0.002	< 0.002	< 0.008	0.022	< 0.012	No	No				
5268308	8 - Roof, North Facade	12/27/2007	7:49 AM	12/28/2007	7:37 AM	1,428	5,185	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/29/2007	0.022	< 0.039	0.017	0.14	< 0.002	0.228	< 0.002	< 0.002	< 0.008	0.020	< 0.012	No	No				
5268312	3 - 90 West Courtyard at 2nd Floor Level	12/28/2007	7:20 AM	12/29/2007	7:15 AM	1,435	5,053	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/30/2007	0.026	0.052	0.017	0.14	< 0.002	0.036	< 0.002	< 0.002	0.023	0.017	< 0.012	No	No				
5268316	4 - Albany St 6th Floor Scaffolding	12/28/2007	7:52 AM	12/29/2007	7:44 AM	1,432	5,012	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.026	0.051	0.018	0.16	< 0.002	0.042	< 0.002	< 0.002	0.017	0.022	< 0.012	No	No				
5268320	5 - Washington St 6th Floor Scaffolding	12/28/2007	8:07 AM	12/29/2007	8:00 AM	1,433	5,016	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.027	< 0.040	0.014	0.11	< 0.002	0.041	< 0.002	< 0.002	0.011	0.018	< 0.012	No	No				
5268324	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:34 AM	12/29/2007	8:16 AM	1,422	4,977	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.025	0.043	0.020	0.15	< 0.002	0.041	< 0.002	< 0.002	0.010	0.024	< 0.012	No	No				
5268328	7 - Roof, East Facade	12/28/2007	8:45 AM	12/29/2007	8:39 AM	1,434	4,661	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.031	0.056	0.016	0.10	< 0.002	0.028	< 0.002	< 0.002	< 0.008	0.013	< 0.012	No	No				
5268332	8 - Roof, North Facade	12/28/2007	7:13 AM	12/29/2007	7:54 AM	1,421	5,270	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.029	< 0.008	0.012	0.08	< 0.002	0.028	< 0.002	< 0.002	0.010	0.019	< 0.011	No	No				
5268336	3 - 90 West Courtyard at 2nd Floor Level	12/29/2007	7:47 AM	12/29/2007	7:40 AM	1,433	5,283	Metals	NIOH 7300 Modified ICP-MS	R.L.G. Metals	12/31/2007	0.030	0.055	0.018	0.09	< 0.002	0.039	< 0.002	< 0.002	0.010	0.022	< 0.011	No					

MasterWorks - 130 Cedar Building, Community Monitoring															
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Mercury Concentration (ng/m ³)	EPA Site Specific Trigger Level for Mercury (ng/m ³)	Exceeds Target Air Quality or EPA Site Specific Level?	Comments
5268122	3 - 90 West Courtyard at 2nd Floor Level	12/23/2007	7:58 AM	12/24/2007	7:35 AM	1,417	581	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	< 5	3000 ng/m3	No	
5268126	4 - Albany St 6th Floor Scaffolding	12/23/2007	8:43 AM	12/24/2007	8:39 AM	1,436	531	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	< 6	3000 ng/m3	No	
5268130	5 - Washington St 6th Floor Scaffolding	12/23/2007	9:02 AM	12/24/2007	8:50 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	8	3000 ng/m3	No	
5268134	6 - Cedar St 6th Floor Scaffolding	12/23/2007	9:48 AM	12/24/2007	9:03 AM	1,395	544	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	< 6	3000 ng/m3	No	
5268138	7 - Roof, East Facade	12/23/2007	8:10 AM	12/24/2007	7:28 AM	1,398	573	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	< 5	3000 ng/m3	No	
5268142	8 - Roof, North Facade	12/23/2007	8:25 AM	12/24/2007	7:41 AM	1,396	524	Mercury	EPA 324/1631 mod.	BRL	12/26/2007	< 6	3000 ng/m3	No	
5268363	3 - 90 West Courtyard at 2nd Floor Level	12/24/2007	7:41 AM	12/25/2007	7:45 AM	1,444	592	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268367	4 - Albany St 6th Floor Scaffolding	12/24/2007	8:44 AM	12/25/2007	8:44 AM	1,440	562	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	7	3000 ng/m3	No	
5268371	5 - Washington St 6th Floor Scaffolding	12/24/2007	8:56 AM	12/25/2007	8:55 AM	1,439	597	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268375	6 - Cedar St 6th Floor Scaffolding	12/24/2007	9:11 AM	12/25/2007	9:06 AM	1,435	531	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 6	3000 ng/m3	No	
5268379	7 - Roof, East Facade	12/24/2007	7:33 AM	12/25/2007	7:43 AM	1,450	580	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268383	8 - Roof, North Facade	12/24/2007	7:45 AM	12/25/2007	7:52 AM	1,447	564	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	6	3000 ng/m3	No	
5270699	3 - 90 West Courtyard at 2nd Floor Level	12/25/2007	7:45 AM	12/26/2007	7:11 AM	1,406	562	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	7	3000 ng/m3	No	
5268226	4 - Albany St 6th Floor Scaffolding	12/25/2007	8:48 AM	12/26/2007	7:28 AM	1,360	524	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 6	3000 ng/m3	No	
5268230	5 - Washington St 6th Floor Scaffolding	12/25/2007	9:00 AM	12/26/2007	7:40 AM	1,360	585	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268234	6 - Cedar St 6th Floor Scaffolding	12/25/2007	9:12 AM	12/26/2007	7:51 AM	1,359	516	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 6	3000 ng/m3	No	
5268238	7 - Roof, East Facade	12/25/2007	7:46 AM	12/26/2007	7:07 AM	1,401	595	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268242	8 - Roof, North Facade	12/25/2007	7:56 AM	12/26/2007	7:36 AM	1,420	568	Mercury	EPA 324/1631 mod.	BRL	12/27/2007	< 5	3000 ng/m3	No	
5268267	3 - 90 West Courtyard at 2nd Floor Level	12/26/2007	7:15 AM	12/27/2007	7:07 AM	1,432	544	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 6	3000 ng/m3	No	
5268271	4 - Albany St 6th Floor Scaffolding	12/26/2007	7:32 AM	12/27/2007	7:34 AM	1,442	577	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 5	3000 ng/m3	No	
5268275	5 - Washington St 6th Floor Scaffolding	12/26/2007	7:46 AM	12/27/2007	7:46 AM	1,440	583	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 5	3000 ng/m3	No	
5268279	6 - Cedar St 6th Floor Scaffolding	12/26/2007	7:56 AM	12/27/2007	8:02 AM	1,446	550	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 6	3000 ng/m3	No	
5268283	7 - Roof, East Facade	12/26/2007	7:14 AM	12/27/2007	7:08 AM	1,434	559	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 6	3000 ng/m3	No	
5268287	8 - Roof, North Facade	12/26/2007	7:44 AM	12/27/2007	7:39 AM	1,435	538	Mercury	EPA 324/1631 mod.	BRL	12/28/2007	< 6	3000 ng/m3	No	
5268291	3 - 90 West Courtyard at 2nd Floor Level	12/27/2007	7:12 AM	12/28/2007	7:14 AM	1,442	562	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 5	3000 ng/m3	No	
5268295	4 - Albany St 6th Floor Scaffolding	12/27/2007	7:38 AM	12/28/2007	7:40 AM	1,442	577	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 5	3000 ng/m3	No	
5268299	5 - Washington St 6th Floor Scaffolding	12/27/2007	7:50 AM	12/28/2007	8:01 AM	1,451	595	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 5	3000 ng/m3	No	
5268303	6 - Cedar St 6th Floor Scaffolding	12/27/2007	8:16 AM	12/28/2007	8:29 AM	1,453	552	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 6	3000 ng/m3	No	
5268307	7 - Roof, East Facade	12/27/2007	7:46 AM	12/28/2007	7:05 AM	1,429	550	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 6	3000 ng/m3	No	
5268311	8 - Roof, North Facade	12/27/2007	7:19 AM	12/28/2007	7:37 AM	1,428	550	Mercury	EPA 324/1631 mod.	BRL	12/29/2007	< 6	3000 ng/m3	No	
5268315	3 - 90 West Courtyard at 2nd Floor Level	12/28/2007	7:20 AM	12/29/2007	7:15 AM	1,435	287	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 11	3000 ng/m3	No	Pump flow fault, sample volume estimated
5268319	4 - Albany St 6th Floor Scaffolding	12/28/2007	7:52 AM	12/29/2007	7:44 AM	1,432	573	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 5	3000 ng/m3	No	
5268323	5 - Washington St 6th Floor Scaffolding	12/28/2007	8:07 AM	12/29/2007	8:00 AM	1,433	566	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 5	3000 ng/m3	No	
5268327	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:34 AM	12/29/2007	8:16 AM	1,422	597	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 5	3000 ng/m3	No	
5268345	8 - Cedar St 6th Floor Scaffolding	12/28/2007	8:45 AM	12/29/2007	8:39 AM	1,434	287	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 11	3000 ng/m3	No	Pump flow fault, sample volume estimated
5268331	7 - Roof, East Facade	12/28/2007	7:13 AM	12/29/2007	6:54 AM	1,421	540	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 6	3000 ng/m3	No	
5268335	8 - Roof, North Facade	12/28/2007	7:47 AM	12/29/2007	7:40 AM	1,433	552	Mercury	EPA 324/1631 mod.	BRL	12/31/2007	< 6	3000 ng/m3	No	
5268339	3 - 90 West Courtyard at 2nd Floor Level	12/29/2007	9:13 AM	12/30/2007	7:30 AM	1,337	535	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 6	3000 ng/m3	No	
5268343	4 - Albany St 6th Floor Scaffolding	12/29/2007	7:51 AM	12/30/2007	7:50 AM	1,439	576	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 5	3000 ng/m3	No	
5268347	5 - Washington St 6th Floor Scaffolding	12/29/2007	8:08 AM	12/30/2007	8:05 AM	1,437	611	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 5	3000 ng/m3	No	
5268351	6 - Cedar St 6th Floor Scaffolding	12/29/2007	8:23 AM	12/30/2007	8:19 AM	1,436	574	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 5	3000 ng/m3	No	
5268355	7 - Roof, East Facade	12/29/2007	7:07 AM	12/30/2007	7:21 AM	1,454	567	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 5	3000 ng/m3	No	
5268359	8 - Roof, North Facade	12/29/2007	7:48 AM	12/30/2007	7:45 AM	1,437	553	Mercury	EPA 324/1631 mod.	BRL	01/02/2008	< 6	3000 ng/m3	No	

MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Asbestos Concentration (f/cc)	MMVF Concentration (f/cc)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments
5268121	3 - 90 West Courtyard at 2nd Floor Level	12/23/2007	7:58 AM	12/24/2007	7:35 AM	1,417	4,393	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268125	4 - Albany St 6th Floor Scaffolding	12/23/2007	8:43 AM	12/24/2007	8:39 AM	1,436	4,380	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268129	5 - Washington St 6th Floor Scaffolding	12/23/2007	9:02 AM	12/24/2007	8:50 AM	1,428	4,355	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268133	6 - Cedar St 6th Floor Scaffolding	12/23/2007	9:48 AM	12/24/2007	9:03 AM	1,395	4,185	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268137	7 - Roof, East Facade	12/23/2007	8:10 AM	12/24/2007	7:28 AM	1,398	4,557	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5268141	8 - Roof, North Facade	12/23/2007	8:25 AM	12/24/2007	7:41 AM	1,396	4,614	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/26/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5268362	3 - 90 West Courtyard at 2nd Floor Level	12/24/2007	7:41 AM	12/25/2007	7:45 AM	1,444	4,332	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268366	4 - Albany St 6th Floor Scaffolding	12/24/2007	8:44 AM	12/25/2007	8:44 AM	1,440	4,248	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268370	5 - Washington St 6th Floor Scaffolding	12/24/2007	8:56 AM	12/25/2007	8:55 AM	1,439	4,389	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268374	6 - Cedar St 6th Floor Scaffolding	12/24/2007	9:11 AM	12/25/2007	9:06 AM	1,435	4,377	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268378	7 - Roof, East Facade	12/24/2007	7:33 AM	12/25/2007	7:43 AM	1,450	4,350	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268382	8 - Roof, North Facade	12/24/2007	7:45 AM	12/25/2007	7:52 AM	1,447	4,341	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5270698	3 - 90 West Courtyard at 2nd Floor Level	12/25/2007	7:45 AM	12/26/2007	7:11 AM	1,406	4,183	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268199	4 - Albany St 6th Floor Scaffolding	12/25/2007	8:48 AM	12/26/2007	7:28 AM	1,360	4,080	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268229	5 - Washington St 6th Floor Scaffolding	12/25/2007	9:00 AM	12/26/2007	7:40 AM	1,360	4,080	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268233	6 - Cedar St 6th Floor Scaffolding	12/25/2007	9:12 AM	12/26/2007	7:51 AM	1,359	3,873	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268237	7 - Roof, East Facade	12/25/2007	7:46 AM	12/26/2007	7:07 AM	1,401	4,100	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268241	8 - Roof, North Facade	12/25/2007	7:56 AM	12/26/2007	7:36 AM	1,420	3,908	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/27/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268266	3 - 90 West Courtyard at 2nd Floor Level	12/26/2007	7:15 AM	12/27/2007	7:07 AM	1,432	4,153	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00006	<0.00006	0.0009 f/cc	No	
5268270	4 - Albany St 6th Floor Scaffolding	12/26/2007	7:32 AM	12/27/2007	7:34 AM	1,442	4,146	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00005	0.00005	0.0009 f/cc	No	
5268274	5 - Washington St 6th Floor Scaffolding	12/26/2007	7:46 AM	12/27/2007	7:46 AM	1,440	4,248	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268278	6 - Cedar St 6th Floor Scaffolding	12/26/2007	7:56 AM	12/27/2007	8:02 AM	1,446	4,049	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268282	7 - Roof, East Facade	12/26/2007	7:14 AM	12/27/2007	7:08 AM	1,434	4,224	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268286	8 - Roof, North Facade	12/26/2007	7:44 AM	12/27/2007	7:39 AM	1,435	4,292	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/28/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268290	3 - 90 West Courtyard at 2nd Floor Level	12/27/2007	7:12 AM	12/28/2007	7:14 AM	1,442	4,398	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268294	4 - Albany St 6th Floor Scaffolding	12/27/2007	7:38 AM	12/28/2007	7:40 AM	1,442	4,326	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00005	0.00005	0.0009 f/cc	No	
5268298	5 - Washington St 6th Floor Scaffolding	12/27/2007	7:50 AM	12/28/2007	8:01 AM	1,451	4,353	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268302	6 - Cedar St 6th Floor Scaffolding	12/27/2007	8:16 AM	12/28/2007	8:29 AM	1,453	4,541	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5268306	7 - Roof, East Facade	12/27/2007	7:16 AM	12/28/2007	7:05 AM	1,429	4,484	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268310	8 - Roof, North Facade	12/27/2007	7:49 AM	12/28/2007	7:37 AM	1,428	4,413	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/29/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268314	3 - 90 West Courtyard at 2nd Floor Level	12/28/2007	7:20 AM	12/29/2007	7:15 AM	1,435	4,449	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	0.00005	0.00009	0.0009 f/cc	No	
5268318	4 - Albany St 6th Floor Scaffolding	12/28/2007	7:52 AM	12/29/2007	7:44 AM	1,432	3,723	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	N/A	N/A	0.0009 f/cc	N/A	No Filter in Cassette - Sample Not Suitable for Analysis
5268322	5 - Washington St 6th Floor Scaffolding	12/28/2007	8:07 AM	12/29/2007	8:00 AM	1,433	4,263	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268326	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:34 AM	12/29/2007	8:16 AM	1,422	6,399	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	N/A	N/A	0.0009 f/cc	N/A	No Filter in Cassette - Sample Not Suitable for Analysis
5269839	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:45 AM	12/29/2007	8:39 AM	1,424	4,266	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	<0.00005	<0.00005	0.0009 f/cc	No	
5268330	7 - Roof, East Facade	12/28/2007	7:13 AM	12/29/2007	6:54 AM	1,421	5,948	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	N/A	N/A	0.0009 f/cc	N/A	No Filter in Cassette - Sample Not Suitable for Analysis
5268334	8 - Roof, North Facade	12/28/2007	7:47 AM	12/29/2007	7:40 AM	1,433	4,793	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	12/31/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5268338	3 - 90 West Courtyard at 2nd Floor Level	12/29/2007	7:20 AM	12/30/2007	7:30 AM	1,450	4,314	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	<0.00005	<0.00005	0.0009 f/cc	No	
5269843	4 - Albany St 6th Floor Scaffolding	12/29/2007	9:36 AM	12/30/2007	7:50 AM	1,334	3,802	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	N/A	N/A	0.0009 f/cc	N/A	No Filter in Cassette - Sample Not Suitable for Analysis
5268346	5 - Washington St 6th Floor Scaffolding	12/29/2007	8:08 AM	12/30/2007	8:05 AM	1,437	4,383	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	N/A	N/A	0.0009 f/cc	N/A	No Filter in Cassette - Sample Not Suitable for Analysis
5269844	6 - Cedar St 6th Floor Scaffolding	12/29/2007	9:42 AM	12/30/2007	8:19 AM	1,357	4,003	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	<0.00005	<0.00005	0.0009 f/cc	No	
5268354	7 - Roof, East Facade	12/29/2007	7:07 AM	12/30/2007	7:21 AM	1,454	4,525	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	<0.00004	<0.00004	0.0009 f/cc	No	
5268358	8 - Roof, North Facade	12/29/2007	7:48 AM	12/30/2007	7:45 AM	1,437	5,000	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	1/2/2008	<0.00005	<0.00005	0.0009 f/cc	No	


Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Respirable Dust Concentration (mg/m ³)	Respirable Quartz Concentration (mg/m ³)	Target Air quality Level for Respirable Quartz (mg/m ³)	EPA Site Specific Trigger Level for Respirable Quartz (mg/m ³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5268120	3 - 90 West Courtyard at 2nd Floor Level	12/23/2007	7:58 AM	12/24/2007	7:36 AM	1,417	3,613	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268124	4 - Albany St 6th Floor Scaffolding	12/23/2007	8:43 AM	12/24/2007	8:38 AM	1,436	3,518	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268126	5 - Washington St 6th Floor Scaffolding	12/23/2007	9:02 AM	12/24/2007	8:50 AM	1,428	3,499	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .029	< .001	0.01	0.01	No	
5268132	6 - Cedar St 6th Floor Scaffolding	12/23/2007	9:48 AM	12/24/2007	9:03 AM	1,395	3,348	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .03	< .001	0.01	0.01	No	
5268136	7 - Roof, East Facade	12/23/2007	8:10 AM	12/24/2007	7:28 AM	1,398	3,565	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268140	8 - Roof, North Facade	12/23/2007	8:25 AM	12/24/2007	7:41 AM	1,396	3,420	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .029	< .001	0.01	0.01	No	
5268361	3 - 90 West Courtyard at 2nd Floor Level	12/24/2007	7:41 AM	12/25/2007	7:45 AM	1,444	3,662	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .027	< .001	0.01	0.01	No	
5268365	4 - Albany St 6th Floor Scaffolding	12/24/2007	8:44 AM	12/25/2007	8:44 AM	1,440	3,636	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .028	< .001	0.01	0.01	No	
5268369	5 - Washington St 6th Floor Scaffolding	12/24/2007	8:56 AM	12/25/2007	8:56 AM	1,439	3,670	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .027	< .001	0.01	0.01	No	
5268373	6 - Cedar St 6th Floor Scaffolding	12/24/2007	9:11 AM	12/25/2007	9:06 AM	1,435	3,516	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .028	< .001	0.01	0.01	No	
5268377	7 - Roof, East Facade	12/24/2007	7:33 AM	12/25/2007	7:43 AM	1,450	3,625	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .028	< .001	0.01	0.01	No	
5268381	8 - Roof, North Facade	12/24/2007	7:49 AM	12/25/2007	7:52 AM	1,447	3,690	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .027	< .001	0.01	0.01	No	
5268963	3 - 90 West Courtyard at 2nd Floor Level	12/25/2007	7:45 AM	12/26/2007	7:11 AM	1,406	3,515	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .028	< .001	0.01	0.01	No	
5268198	4 - Albany St 6th Floor Scaffolding	12/25/2007	8:48 AM	12/26/2007	7:28 AM	1,360	3,400	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .029	< .001	0.01	0.01	No	
5268228	5 - Washington St 6th Floor Scaffolding	12/25/2007	9:00 AM	12/26/2007	7:40 AM	1,360	3,400	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .029	< .001	0.01	0.01	No	
5268232	6 - Cedar St 6th Floor Scaffolding	12/25/2007	9:12 AM	12/26/2007	7:51 AM	1,359	3,126	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .032	< .001	0.01	0.01	No	
5268236	7 - Roof, East Facade	12/25/2007	7:46 AM	12/26/2007	7:07 AM	1,401	3,503	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .029	< .001	0.01	0.01	No	
5268240	8 - Roof, North Facade	12/25/2007	7:56 AM	12/26/2007	7:36 AM	1,420	3,479	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/27/2007	< .029	< .001	0.01	0.01	No	Sample stand/cassette knocked over by strong wind.
5268265	3 - 90 West Courtyard at 2nd Floor Level	12/26/2007	7:15 AM	12/27/2007	7:07 AM	1,432	3,580	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268269	4 - Albany St 6th Floor Scaffolding	12/26/2007	7:32 AM	12/27/2007	7:34 AM	1,442	3,533	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268273	5 - Washington St 6th Floor Scaffolding	12/26/2007	7:46 AM	12/27/2007	7:46 AM	1,440	3,600	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .028	< .001	0.01	0.01	No	
5268277	6 - Cedar St 6th Floor Scaffolding	12/26/2007	7:56 AM	12/27/2007	8:02 AM	1,446	3,326	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .03	< .002	0.01	0.01	No	
5268281	7 - Roof, East Facade	12/26/2007	7:14 AM	12/27/2007	7:08 AM	1,434	3,657	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .027	< .001	0.01	0.01	No	
5268285	8 - Roof, North Facade	12/26/2007	7:44 AM	12/27/2007	7:39 AM	1,435	3,659	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/28/2007	< .027	< .001	0.01	0.01	No	
5268289	3 - 90 West Courtyard at 2nd Floor Level	12/27/2007	7:14 AM	12/28/2007	7:14 AM	1,442	3,749	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .027	< .001	0.01	0.01	No	
5268293	4 - Albany St 6th Floor Scaffolding	12/27/2007	7:38 AM	12/28/2007	7:40 AM	1,442	3,461	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .029	< .001	0.01	0.01	No	
5268297	5 - Washington St 6th Floor Scaffolding	12/27/2007	7:50 AM	12/28/2007	8:01 AM	1,451	3,664	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .027	< .001	0.01	0.01	No	
5268301	6 - Cedar St 6th Floor Scaffolding	12/27/2007	8:16 AM	12/28/2007	8:29 AM	1,453	3,323	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .029	< .001	0.01	0.01	No	
5268305	7 - Roof, East Facade	12/27/2007	7:16 AM	12/28/2007	7:06 AM	1,429	3,644	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .027	< .001	0.01	0.01	No	
5268309	8 - Roof, North Facade	12/27/2007	7:49 AM	12/28/2007	7:37 AM	1,428	3,641	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/29/2007	< .027	< .001	0.01	0.01	No	
5268313	3 - 90 West Courtyard at 2nd Floor Level	12/28/2007	7:20 AM	12/29/2007	7:15 AM	1,435	3,157	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .032	< .001	0.01	0.01	No	
5268317	4 - Albany St 6th Floor Scaffolding	12/28/2007	7:52 AM	12/29/2007	7:44 AM	1,432	3,795	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .026	< .001	0.01	0.01	No	
5268321	5 - Washington St 6th Floor Scaffolding	12/28/2007	8:07 AM	12/29/2007	8:00 AM	1,433	3,480	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .028	< .001	0.01	0.01	No	
5268325	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:34 AM	12/29/2007	8:16 AM	1,422	3,626	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .028	< .001	0.01	0.01	No	
5268329	7 - Roof, East Facade	12/28/2007	7:13 AM	12/29/2007	6:54 AM	1,421	3,624	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .028	< .001	0.01	0.01	No	
5268333	8 - Roof, North Facade	12/28/2007	7:47 AM	12/29/2007	7:40 AM	1,433	3,654	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .027	< .001	0.01	0.01	No	
5268338	6 - Cedar St 6th Floor Scaffolding	12/28/2007	8:45 AM	12/29/2007	8:39 AM	1,434	4,067	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	12/31/2007	< .024	< .001	0.01	0.01	No	
5268337	3 - 90 West Courtyard at 2nd Floor Level	12/29/2007	7:20 AM	12/30/2007	7:30 AM	1,450	3,553	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	
5268341	4 - Albany St 6th Floor Scaffolding	12/29/2007	7:51 AM	12/30/2007	7:50 AM	1,439	3,598	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	
5268345	5 - Washington St 6th Floor Scaffolding	12/29/2007	8:08 AM	12/30/2007	8:06 AM	1,437	3,557	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	
5268349	6 - Cedar St 6th Floor Scaffolding	12/29/2007	8:23 AM	12/30/2007	8:19 AM	1,436	3,690	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	
5268353	7 - Roof, East Facade	12/29/2007	7:07 AM	12/30/2007	7:21 AM	1,454	3,535	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	
5268357	8 - Roof, North Facade	12/29/2007	7:48 AM	12/30/2007	7:45 AM	1,437	3,593	Dust and Quartz	NIOSH 0600/7500	RJL&G XRD	1/2/2008	< .028	< .001	0.01	0.01	No	

MasterWorks - 130 Cedar Building, Community Monitoring														
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM _{2.5} Avg. Concentration (µg/m ³)	EPA Site Specific Trigger Level for PM _{2.5} (µg/m ³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	14	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	24	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	26	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	25	65	No	
N/A	7 - Roof, East	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	9	65	No	
N/A	8 - Roof, North	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	10	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	9	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	8	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	10	65	No	
N/A	7 - Roof, East	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	8	65	No	
N/A	8 - Roof, North	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	9	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	13	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	11	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	12	65	No	
N/A	7 - Roof, East	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	11	65	No	
N/A	8 - Roof, North	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	12	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	21	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	19	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	20	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	20	65	No	
N/A	7 - Roof, East	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,380	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	24	65	No	
N/A	8 - Roof, North	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	25	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	19	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	19	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	19	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	22	65	No	
N/A	7 - Roof, East	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	27	65	No	
N/A	8 - Roof, North	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	25	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	24	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	21	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	22	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	21	65	No	
N/A	7 - Roof, East	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	23	65	No	
N/A	8 - Roof, North	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	26	65	No	
N/A	3 - Courtyard, 2nd Floor Level	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4526	N/A	16	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4728	N/A	17	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4729	N/A	15	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4527	N/A	20	65	No	
N/A	7 - Roof, East	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # F5003	N/A	12	65	No	
N/A	8 - Roof, North	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM _{2.5}	Direct Read	Met One E-BAM Unit # G4607	N/A	13	65	No	

MasterWorks - 130 Cedar Building, Community Monitoring														
Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM ₁₀ Avg. Concentration (µg/m ³)	EPA Site Specific Trigger Level for PM ₁₀ (µg/m ³)	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	41	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	21	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	84	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	43	150	No	
N/A	7 - Roof, East	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	55	150	No	
N/A	8 - Roof, North	12/23/2007	12:00 AM	12/24/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	90	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	10	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	10	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	10	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	10	150	No	
N/A	7 - Roof, East	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	11	150	No	
N/A	8 - Roof, North	12/24/2007	12:00 AM	12/25/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	9	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	11	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	12	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	12	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	12	150	No	
N/A	7 - Roof, East	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	15	150	No	
N/A	8 - Roof, North	12/25/2007	12:00 AM	12/26/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	12	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	20	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	24	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	24	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	23	150	No	
N/A	7 - Roof, East	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,415	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	29	150	No	
N/A	8 - Roof, North	12/26/2007	12:00 AM	12/27/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	33	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	36	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	23	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	21	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	23	150	No	
N/A	7 - Roof, East	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	34	150	No	
N/A	8 - Roof, North	12/27/2007	12:00 AM	12/28/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	36	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	33	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	25	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	31	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	43	150	No	
N/A	7 - Roof, East	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	29	150	No	
N/A	8 - Roof, North	12/28/2007	12:00 AM	12/29/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	29	150	No	
N/A	3 - Courtyard, 2nd Floor Level	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4606	N/A	33	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4731	N/A	17	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4604	N/A	29	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # G4605	N/A	33	150	No	
N/A	7 - Roof, East	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # E3364	N/A	21	150	No	
N/A	8 - Roof, North	12/29/2007	12:00 AM	12/30/2007	12:00 AM	1,440	PM ₁₀	Direct Read	Met One E-BAM Unit # F5001	N/A	34	150	No	

350 Hochberg Road, Monroeville, PA 15146
Phone: (724) 325-1776 Fax: (724) 733-1799

Mercury Vapor (Hg^0) Air Results for Outdoor Community
Monitoring Stations by Location as recorded by the Lumex Analyzer

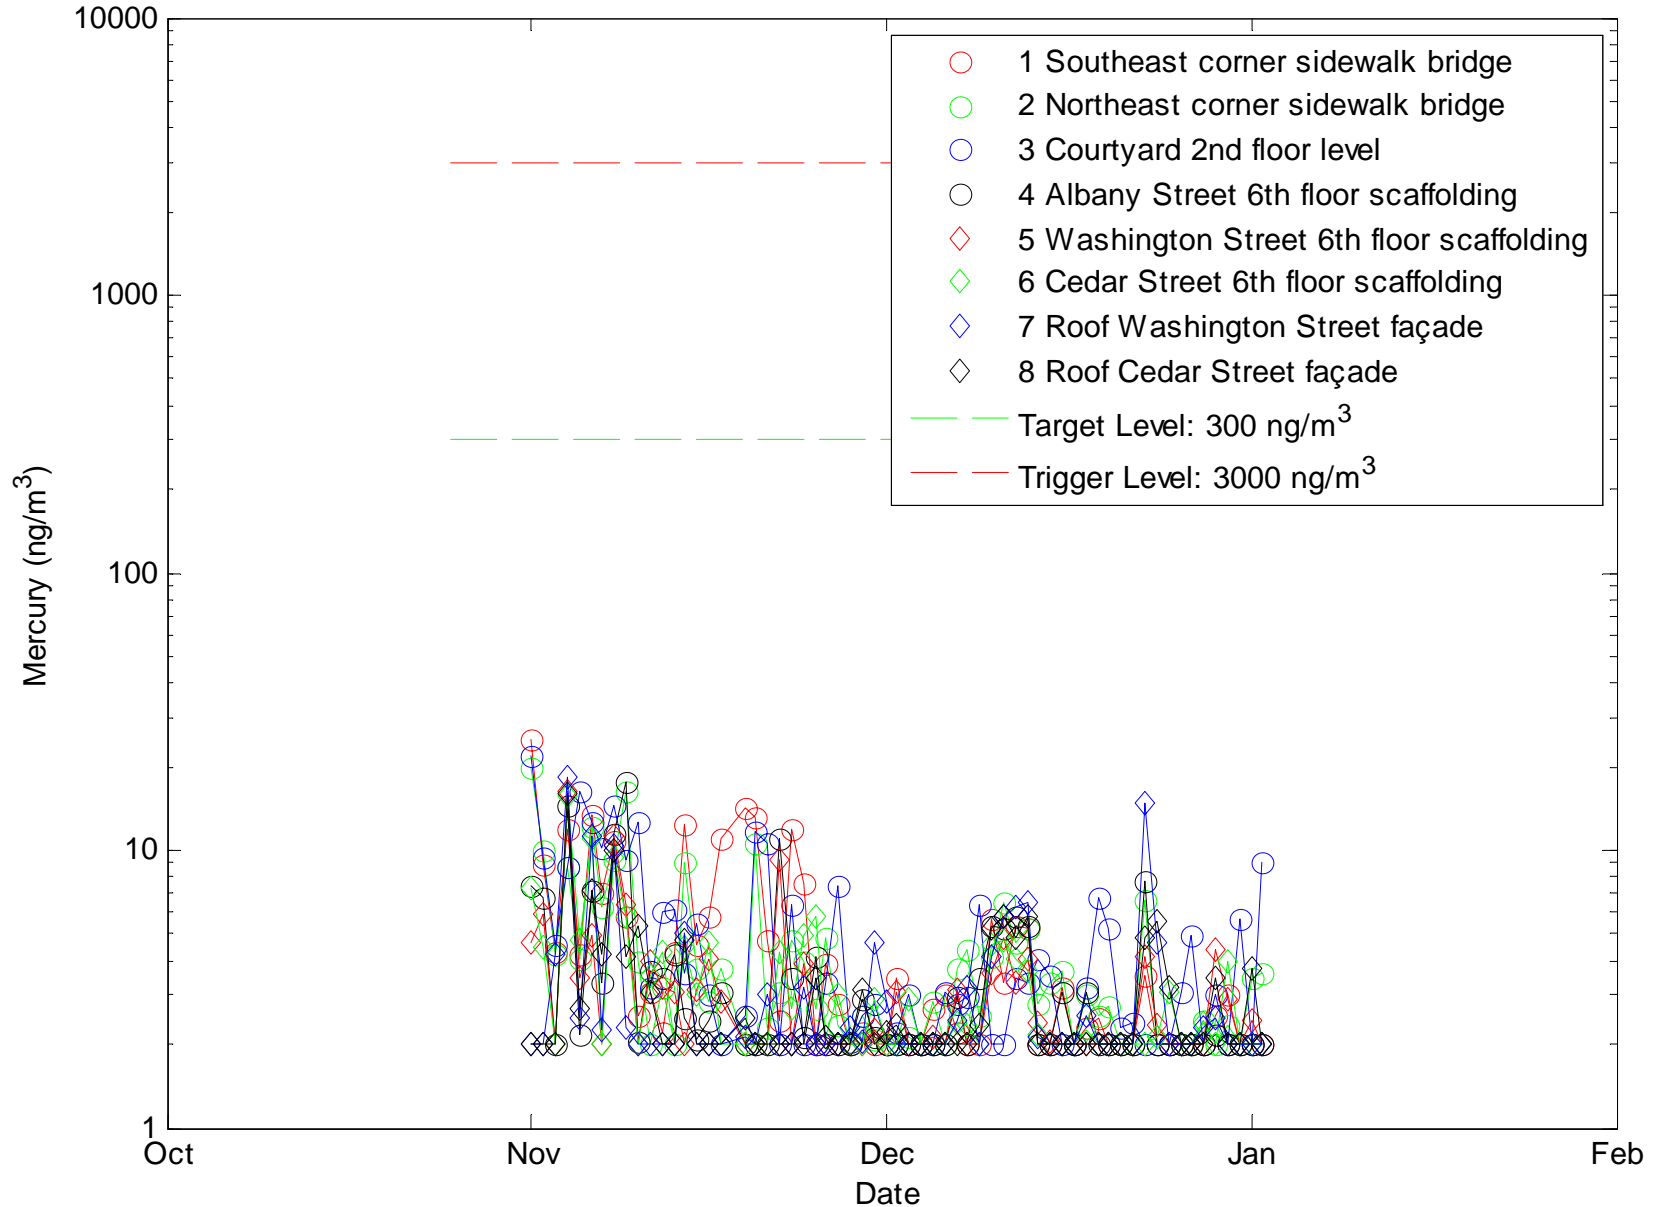

Report Summary
Air Mercury Results (Hg⁰, ng/m³) as recorded by the Lumex RA915+ analyzer
Week of 12/23/07 to 12/29/07

Date	Mercury (Hg ⁰) ng/m ³ 30-sec readings	1 Southeast corner sidewalk bridge	2 Northeast corner sidewalk bridge	3 Courtyard 2nd floor level	4 Albany Street 6th floor scaffolding	5 Washington Street 6th floor scaffolding	6 Cedar Street 6th floor scaffolding	7 Roof Washington Street façade	8 Roof Cedar Street façade
23-Dec-07	# Samples	9	9	9	9	9	9	9	9
	Average	4	7	2	8	4	2	15	5
	Maximum	6	8	2	9	5	2	15	6
24-Dec-07	# Samples	9	9	9	9	9	9	9	9
	Average	2	2	2	2	2	2	5	6
	Maximum	2	2	2	3	3	3	6	7
25-Dec-07	# Samples	9	9	9	9	9	9	9	9
	Average	2	2	2	2	2	3	2	3
	Maximum	2	4	2	2	2	4	2	4
26-Dec-07	# Samples	36	36	36	36	36	36	36	36
	Average	2	2	3	2	2	2	2	2
	Maximum	4	4	6	3	5	4	2	4
27-Dec-07	# Samples	36	36	36	36	36	36	36	39
	Average	2	2	5	2	2	2	2	2
	Maximum	2	4	13	2	2	3	2	2
28-Dec-07	# Samples	18	18	18	18	18	18	18	18
	Average	2	2	2	2	2	2	2	2
	Maximum	2	4	2	4	2	3	4	2
29-Dec-07	# Samples	18	18	18	18	18	18	18	18
	Average	3	2	3	2	4	2	3	3
	Maximum	4	2	4	3	6	3	4	5