

MasterWorks - 130 Cedar Building, Community Monitoring																						
Sample No.	Sampling Location	Collection Start Date	Collection Time	Collection End Date	Collection Time (off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	Total Structure Count			Asbestos < 5 µm	Asbestos ≥ 5 µm	Result (fem/m³)	Concentration (f/c)	EPA Site Specific Trigger Level	Exceeds EPA Site Specific Trigger Level?	Comments	
												All Asbestos	Chrysotile	Amphibole								
5269340	3 - 90 West Courtyard at 2nd Floor Level	11/4/2007	7:43 AM	11/4/2007	11:24 AM	238	1,904	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	8.4	< 0.019	70 Smm2		
5269341	4 - Albany St 6th Floor Scalloping	11/4/2007	7:26 AM	11/4/2007	11:24 AM	238	1,904	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	8.4	< 0.019	70 Smm2		
5269342	5 - Washington St 6th Floor Scalloping	11/4/2007	7:27 AM	11/4/2007	11:26 AM	239	1,912	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	8.9	< 0.02	70 Smm2		
5269343	6 - Cedar St 6th Floor Scalloping	11/4/2007	7:27 AM	11/4/2007	11:26 AM	239	1,912	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	8.9	< 0.02	70 Smm2		
5269344	7 - Roof, East Facade	11/4/2007	7:33 AM	11/4/2007	11:37 AM	244	1,891	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	9.8	< 0.02	70 Smm2		
5269345	8 - Roof, North Facade	11/4/2007	7:34 AM	11/4/2007	11:40 AM	246	1,968	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	9.8	< 0.019	70 Smm2		
5269346	9 - 90 West Courtyard at 2nd Floor Level	11/5/2007	7:19 AM	11/5/2007	11:38 PM	478	1,653	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	0	0	0	
5269347	4 - Albany St 6th Floor Scalloping	11/5/2007	7:41 AM	11/5/2007	11:38 PM	478	1,653	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	0	0	0	
5269348	5 - Washington St 6th Floor Scalloping	11/5/2007	7:41 AM	11/5/2007	11:38 PM	478	1,653	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	0	0	0	
5269349	6 - Cedar St 6th Floor Scalloping	11/5/2007	7:41 AM	11/5/2007	11:38 PM	478	1,653	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	0	0	0	
5269350	7 - Roof, East Facade	11/5/2007	7:56 AM	11/5/2007	12:42 PM	468	1,632	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	8.4	< 0.02	70 Smm2	
5269351	8 - Roof, North Facade	11/5/2007	7:10 AM	11/5/2007	13:49 PM	519	1,860	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/6/2007	0	0	0	0	0	0	0	9.9	< 0.019	70 Smm2	
5269352	3 - 90 West Courtyard at 2nd Floor Level	11/5/2007	3:18 PM	11/5/2007	10:50 PM	452	1,605	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269353	4 - Albany St 6th Floor Scalloping	11/5/2007	3:18 PM	11/5/2007	10:50 PM	452	1,605	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269354	5 - Washington St 6th Floor Scalloping	11/5/2007	3:40 PM	11/5/2007	11:15 PM	455	1,593	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269355	6 - Cedar St 6th Floor Scalloping	11/5/2007	3:42 PM	11/5/2007	11:15 PM	455	1,593	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269356	7 - Roof, East Facade	11/5/2007	3:47 PM	11/5/2007	11:22 PM	456	1,596	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269357	8 - Roof, North Facade	11/5/2007	3:48 PM	11/5/2007	10:55 PM	450	1,575	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269358	3 - 90 West Courtyard at 2nd Floor Level	11/6/2007	3:31 PM	11/6/2007	10:53 PM	422	1,519	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269359	4 - Albany St 6th Floor Scalloping	11/6/2007	3:31 PM	11/6/2007	10:53 PM	422	1,519	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269360	5 - Washington St 6th Floor Scalloping	11/6/2007	3:33 PM	11/6/2007	11:02 PM	445	1,575	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269361	6 - Cedar St 6th Floor Scalloping	11/6/2007	3:34 PM	11/6/2007	11:02 PM	445	1,575	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269362	7 - Roof, East Facade	11/6/2007	3:33 PM	11/6/2007	11:02 PM	445	1,575	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269363	8 - Cedar St 6th Floor Scalloping	11/6/2007	3:34 PM	11/6/2007	11:02 PM	445	1,575	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269364	9 - Roof, East Facade	11/6/2007	3:38 PM	11/6/2007	11:05 PM	439	1,558	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269365	8 - Roof, North Facade	11/6/2007	3:40 PM	11/6/2007	10:57 PM	437	1,530	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269370	3 - 90 West Courtyard at 2nd Floor Level	11/6/2007	7:09 AM	11/6/2007	3:51 PM	522	1,801	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269371	4 - Albany St 6th Floor Scalloping	11/6/2007	7:29 AM	11/6/2007	3:51 PM	522	1,801	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269372	5 - Washington St 6th Floor Scalloping	11/6/2007	7:29 AM	11/6/2007	3:51 PM	522	1,801	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269373	6 - Cedar St 6th Floor Scalloping	11/6/2007	7:29 AM	11/6/2007	3:51 PM	522	1,801	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269374	7 - Roof, East Facade	11/6/2007	7:23 AM	11/6/2007	3:31 PM	488	1,732	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269375	8 - Albany St 6th Floor Scalloping	11/6/2007	7:25 AM	11/6/2007	3:33 PM	488	1,732	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269376	9 - Washington St 6th Floor Scalloping	11/6/2007	7:25 AM	11/6/2007	3:34 PM	488	1,732	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269377	4 - Albany St 6th Floor Scalloping	11/6/2007	7:34 AM	11/6/2007	3:38 PM	485	1,701	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	1	1	0	0	0	0	0	8.4	< 0.019	70 Smm2	
5269378	5 - Washington St 6th Floor Scalloping	11/6/2007	7:34 AM	11/6/2007	3:38 PM	485	1,701	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	1	1	0	0	0	0	0	8.4	< 0.019	70 Smm2	
5269379	6 - Cedar St 6th Floor Scalloping	11/6/2007	7:35 AM	11/6/2007	3:40 PM	485	1,701	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269380	7 - Roof, East Facade	11/6/2007	7:34 AM	11/6/2007	3:40 PM	485	1,701	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/7/2007	0	0	0	0	0	0	0	0	0	0	
5269381	3 - 90 West Courtyard at 2nd Floor Level	11/7/2007	7:35 AM	11/7/2007	3:40 PM	485	1,722	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269382	4 - Albany St 6th Floor Scalloping	11/7/2007	7:18 AM	11/7/2007	3:21 PM	481	1,708	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269383	5 - Washington St 6th Floor Scalloping	11/7/2007	7:20 AM	11/7/2007	3:21 PM	481	1,708	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269384	6 - Cedar St 6th Floor Scalloping	11/7/2007	7:22 AM	11/7/2007	3:23 PM	481	1,684	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269385	7 - Roof, East Facade	11/7/2007	7:25 AM	11/7/2007	3:27 PM	482	1,687	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5269386	8 - Roof, North Facade	11/7/2007	7:26 AM	11/7/2007	3:28 PM	483	1,691	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5270136	3 - 90 West Courtyard at 2nd Floor Level	11/7/2007	3:40 PM	11/7/2007	10:16 PM	395	1,353	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	1	1	0	1	0	0	0	8.8	0.019	70 Smm2	
5270137	4 - Albany St 6th Floor Scalloping	11/7/2007	3:19 PM	11/7/2007	10:28 PM	427	1,463	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5270138	5 - Washington St 6th Floor Scalloping	11/7/2007	3:21 PM	11/7/2007	10:28 PM	427	1,484	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5270139	6 - Cedar St 6th Floor Scalloping	11/7/2007	3:23 PM	11/7/2007	10:30 PM	427	1,452	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5270140	7 - Roof, East Facade	11/7/2007	3:23 PM	11/7/2007	10:35 PM	429	1,452	Asbestos	ASHERA 40 CFR Part 763, October 30, 1987 (Modified)	RJLG TEM	11/8/2007	0	0	0	0	0	0	0	0	0	0	
5270141	8 - Roof, North Facade	11/7/2007	3:25 PM	11/7																		

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Sample Receipt Date	EPA Site Specific Trigger Levels										Exceeds Target Air Quality Levels	Exceeds EPA Site Specific Trigger Levels	Comments	
												Barium Concentration (µg/m³)	Chromium Concentration (µg/m³)	Manganese Concentration (µg/m³)	Zinc Concentration (µg/m³)	Beryllium Concentration (µg/m³)	Copper Concentration (µg/m³)	Mercury Particulate Concentration (µg/m³)	Cadmium Concentration (µg/m³)	Lead Concentration (µg/m³)	Nickel Concentration (µg/m³)				Antimony Concentration (µg/m³)
												6.00	6.60	6.50	16.00	0.20	19.00	0.30	0.84	1.50	2.00				5.00
5269395	B - 90 West Courtyard at 2nd Floor Level	11/4/2007	10:59 AM	11/5/2007	7:14 AM	1,215	3,985	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.022	< 0.078	0.018	0.073	< 0.0026	0.026	< 0.0026	0.017	0.014	0.048	No	No		
5269391	H - Albany St 6th Floor Scaffolding	11/4/2007	10:30 AM	11/5/2007	7:36 AM	1,266	4,040	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.023	0.066	0.020	0.067	< 0.0026	0.029	< 0.0026	< 0.0026	0.015	0.014	< 0.015	No	No	
5269387	B - Washington St 6th Floor Scaffolding	11/4/2007	10:20 AM	11/5/2007	7:50 AM	1,293	4,244	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.021	0.063	0.016	0.126	< 0.0024	0.031	< 0.0024	< 0.0024	0.011	0.013	< 0.014	No	No	
5269383	B - Cedar St 6th Floor Scaffolding	11/4/2007	9:30 AM	11/5/2007	8:05 AM	1,295	4,338	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.013	0.079	0.020	0.087	< 0.0023	0.017	< 0.0023	< 0.0023	< 0.009	0.011	< 0.014	No	No	
5269379	F - Roof East Facade	11/4/2007	7:56 AM	11/5/2007	6:48 AM	1,372	4,889	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.012	0.056	0.011	0.050	< 0.0021	0.014	< 0.0021	< 0.0021	0.012	0.008	< 0.012	No	No	
5269371	B - Roof North Facade	11/4/2007	8:57 AM	11/5/2007	7:28 AM	1,351	4,494	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/6/2007	0.050	0.073	0.013	0.211	< 0.0022	0.019	< 0.0022	< 0.0022	0.016	0.011	< 0.013	No	No	
5256362	B - 90 West Courtyard at 2nd Floor Level	11/5/2007	7:19 AM	11/6/2007	7:01 AM	1,422	4,764	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.024	0.060	0.015	0.128	< 0.0021	0.020	< 0.0021	< 0.0021	0.019	0.008	< 0.012	No	No	
5256367	A - Albany St 6th Floor Scaffolding	11/5/2007	7:41 AM	11/6/2007	7:30 AM	1,429	4,537	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.037	0.045	0.027	0.193	< 0.0022	0.039	< 0.0022	< 0.0022	0.025	0.009	< 0.013	No	No	
5261155	B - Washington St 6th Floor Scaffolding	11/5/2007	7:54 AM	11/6/2007	7:44 AM	1,430	4,626	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.025	< 0.041	0.019	0.095	< 0.0021	0.025	< 0.0021	< 0.0021	0.017	0.008	< 0.012	No	No	
5261150	B - Cedar St 6th Floor Scaffolding	11/5/2007	8:11 AM	11/6/2007	8:02 AM	1,431	5,223	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.029	0.048	0.023	0.132	< 0.0019	0.036	< 0.0019	< 0.0019	0.133	0.012	< 0.012	No	No	
5256347	F - Roof East Facade	11/5/2007	6:58 AM	11/6/2007	6:44 AM	1,428	5,205	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.040	0.043	0.026	0.164	< 0.0019	0.045	< 0.0019	< 0.0019	0.046	0.012	< 0.012	No	No	
5256355	B - Roof North Facade	11/5/2007	7:59 AM	11/6/2007	7:09 AM	1,410	4,985	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/7/2007	0.033	0.044	0.023	0.100	< 0.0020	0.031	< 0.0020	< 0.0020	0.029	0.011	< 0.012	No	No	
5261159	B - 90 West Courtyard at 2nd Floor Level	11/5/2007	7:09 AM	11/7/2007	6:56 AM	1,427	4,709	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.025	0.058	0.010	0.139	< 0.0021	0.015	< 0.0021	< 0.0021	0.009	0.009	< 0.013	No	No	
5261183	H - Albany St 6th Floor Scaffolding	11/6/2007	7:24 AM	11/7/2007	7:19 AM	1,435	4,563	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.021	0.038	0.010	0.118	< 0.0018	0.019	< 0.0018	< 0.0018	0.033	0.015	< 0.011	No	No	
5261175	A - Albany St 6th Floor Scaffolding	11/6/2007	7:35 AM	11/7/2007	7:30 AM	1,435	4,620	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.011	0.058	< 0.009	0.081	< 0.0022	0.014	< 0.0022	< 0.0022	0.010	0.010	< 0.013	No	No	
5261207	B - Washington St 6th Floor Scaffolding	11/6/2007	7:55 AM	11/7/2007	7:42 AM	1,427	4,709	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.014	0.072	< 0.009	0.139	< 0.0021	0.016	< 0.0021	< 0.0021	< 0.009	0.010	< 0.013	No	No	
5261227	B - Cedar St 6th Floor Scaffolding	11/6/2007	8:08 AM	11/7/2007	8:05 AM	1,437	4,491	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.020	0.052	0.017	0.194	< 0.0022	0.027	< 0.0022	< 0.0022	0.009	0.015	< 0.013	No	No	
5261239	F - Roof East Facade	11/6/2007	6:52 AM	11/7/2007	6:44 AM	1,432	5,187	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.022	0.047	0.013	0.096	< 0.0019	0.020	< 0.0019	< 0.0019	< 0.008	0.013	< 0.012	No	No	
5270118	B - Roof North Facade	11/6/2007	7:20 AM	11/7/2007	7:21 AM	1,441	5,330	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.025	0.042	0.015	0.188	< 0.0019	0.025	< 0.0019	< 0.0019	0.028	0.014	< 0.011	No	No	
5261452	B - 90 West Courtyard at 2nd Floor Level	11/7/2007	7:07 AM	11/8/2007	6:58 AM	1,431	4,846	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.041	< 0.041	0.020	0.167	< 0.0021	0.032	< 0.0021	< 0.0021	0.036	0.010	< 0.012	No	No	
5261203	A - Albany St 6th Floor Scaffolding	11/7/2007	7:36 AM	11/8/2007	7:25 AM	1,429	4,653	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.016	0.050	0.010	0.131	< 0.0022	0.023	< 0.0022	< 0.0022	0.011	0.009	< 0.013	No	No	
5261219	B - Washington St 6th Floor Scaffolding	11/7/2007	7:47 AM	11/8/2007	7:36 AM	1,428	4,795	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.017	0.051	0.013	0.131	< 0.0021	0.019	< 0.0021	< 0.0021	0.011	0.008	< 0.013	No	No	
5261231	B - Cedar St 6th Floor Scaffolding	11/7/2007	8:09 AM	11/8/2007	7:46 AM	1,417	4,745	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.021	0.050	0.018	0.236	< 0.0021	0.025	< 0.0021	< 0.0021	0.016	0.009	< 0.013	No	No	
5270106	F - Roof East Facade	11/7/2007	6:51 AM	11/8/2007	6:37 AM	1,426	5,333	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.022	0.039	0.012	0.128	< 0.0019	0.024	< 0.0019	< 0.0019	0.021	0.008	< 0.011	No	No	
5270122	B - Roof North Facade	11/7/2007	7:29 AM	11/8/2007	7:14 AM	1,425	5,212	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/9/2007	0.019	0.040	0.011	0.124	< 0.0019	0.021	< 0.0019	< 0.0019	0.015	0.008	< 0.012	No	No	
5261167	B - 90 West Courtyard at 2nd Floor Level	11/8/2007	7:04 AM	11/9/2007	6:52 AM	1,428	4,712	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.043	< 0.029	0.020	0.265	< 0.0027	0.054	< 0.0027	< 0.0027	0.066	0.012	< 0.016	No	No	
5261187	H - Albany St 6th Floor Scaffolding	11/8/2007	7:30 AM	11/9/2007	7:10 AM	1,430	4,473	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.043	< 0.056	0.021	0.221	< 0.0028	0.120	< 0.0028	< 0.0028	0.019	0.016	< 0.017	No	No	
5261199	B - Washington St 6th Floor Scaffolding	11/8/2007	7:41 AM	11/9/2007	7:25 AM	1,424	4,567	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.045	< 0.056	0.027	0.195	< 0.0027	0.044	< 0.0027	< 0.0027	0.014	0.016	< 0.017	No	No	
5261223	B - Cedar St 6th Floor Scaffolding	11/8/2007	7:52 AM	11/9/2007	7:34 AM	1,422	5,119	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.051	< 0.049	0.073	0.208	< 0.0024	0.065	< 0.0024	< 0.0024	0.028	0.018	< 0.015	No	No	
5270100	F - Roof East Facade	11/8/2007	6:44 AM	11/9/2007	6:52 AM	1,448	5,198	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.021	< 0.048	0.013	0.175	< 0.0024	0.021	< 0.0024	< 0.0024	0.015	0.011	< 0.014	No	No	
5270114	B - Roof North Facade	11/8/2007	7:23 AM	11/9/2007	7:34 AM	1,441	5,224	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/10/2007	0.037	< 0.048	0.019	0.113	< 0.0024	0.037	< 0.0024	< 0.0024	0.025	0.011	< 0.014	No	No	
5270154	B - 90 West Courtyard at 2nd Floor Level	11/9/2007	6:57 AM	11/10/2007	7:14 AM	1,457	4,772	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.129	< 0.052	0.022	0.278	< 0.0026	0.050	< 0.0026	< 0.0026	0.035	0.025	< 0.016	No	No	
5261191	H - Albany St 6th Floor Scaffolding	11/9/2007	7:19 AM	11/10/2007	7:35 AM	1,456	4,586	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.030	< 0.054	0.020	0.159	< 0.0027	0.026	< 0.0027	< 0.0027	0.019	0.019	< 0.016	No	No	
5261215	B - Washington St 6th Floor Scaffolding	11/9/2007	7:29 AM	11/10/2007	7:48 AM	1,459	4,705	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.026	< 0.053	0.021	0.199	< 0.0027	0.028	< 0.0027	< 0.0027	0.023	0.023	< 0.016	No	No	
5261235	B - Cedar St 6th Floor Scaffolding	11/9/2007	7:39 AM	11/10/2007	7:58 AM	1,459	4,924	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.025	0.071	0.015	0.150	< 0.0025	0.024	< 0.0025	< 0.0025	0.019	0.020	< 0.015	No	No	
5270110	F - Roof East Facade	11/9/2007	7:02 AM	11/10/2007	6:48 AM	1,428	4,975	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.030	< 0.050	0.020	0.202	< 0.0026	0.028	< 0.0026	< 0.0026	0.020	0.015	< 0.015	No	No	
5270158	B - Roof North Facade	11/9/2007	7:33 AM	11/10/2007	7:20 AM	1,427	5,040	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/12/2007	0.037	< 0.050	0.020	0.193	< 0.0026	0.033	< 0.0026	< 0.0026	0.028	0.021	< 0.015	No	No	
5270498	B - 90 West Courtyard at 2nd Floor Level	11/10/2007	7:19 AM	11/11/2007	7:16 AM	1,437	4,670	Metals	NIOSH 7300 Modified ICP-MS	R/L/G Metals	11/13/2007	0.080	0.048	0.014	0.189	< 0.0021	0.031	< 0							

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Mercury Concentration (ng/m <sup>3</sup> )	EPA Site Specific Trigger Level for Mercury (ng/m <sup>3</sup> )	Exceeds Target Air Quality or EPA Site Specific Level?	Comments
5269398	3 - 90 West Courtyard at 2nd Floor Level	11/4/2007	10:59 AM	11/5/2007	7:14 AM	1,215	451	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 7	3000 ng/m3	No	
5269394	4 - Albany St 6th Floor Scaffolding	11/4/2007	10:30 AM	11/5/2007	7:36 AM	1,266	464	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 7	3000 ng/m3	No	
5269390	5 - Washington St 6th Floor Scaffolding	11/4/2007	10:20 AM	11/5/2007	7:50 AM	1,290	492	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 6	3000 ng/m3	No	
5269386	6 - Cedar St 6th Floor Scaffolding	11/4/2007	9:30 AM	11/5/2007	8:05 AM	1,355	518	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 6	3000 ng/m3	No	
5269382	7 - Roof, East Facade	11/4/2007	8:00 AM	11/5/2007	6:48 AM	1,368	523	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 6	3000 ng/m3	No	
5269374	8 - Roof, North Facade	11/4/2007	8:57 AM	11/5/2007	7:28 AM	1,351	516	Mercury	EPA 324/1631 mod.	BRL	11/06/2007	< 6	3000 ng/m3	No	
5256365	3 - 90 West Courtyard at 2nd Floor Level	11/5/2007	7:19 AM	11/6/2007	7:01 AM	1,422	569	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 5	3000 ng/m3	No	
5261148	4 - Albany St 6th Floor Scaffolding	11/5/2007	7:41 AM	11/6/2007	7:30 AM	1,429	572	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 5	3000 ng/m3	No	
5261158	5 - Washington St 6th Floor Scaffolding	11/5/2007	7:54 AM	11/6/2007	7:44 AM	1,430	558	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 6	3000 ng/m3	No	
5261153	6 - Cedar St 6th Floor Scaffolding	11/5/2007	8:11 AM	11/6/2007	8:02 AM	1,431	515	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 6	3000 ng/m3	No	
5256350	7 - Roof, East Facade	11/5/2007	6:56 AM	11/6/2007	6:44 AM	1,428	571	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 5	3000 ng/m3	No	
5256358	8 - Roof, North Facade	11/5/2007	7:39 AM	11/6/2007	7:09 AM	1,410	557	Mercury	EPA 324/1631 mod.	BRL	11/07/2007	< 6	3000 ng/m3	No	
5261162	3 - 90 West Courtyard at 2nd Floor Level	11/6/2007	7:09 AM	11/7/2007	6:56 AM	1,427	571	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5261178	4 - Albany St 6th Floor Scaffolding	11/6/2007	7:35 AM	11/7/2007	7:30 AM	1,435	567	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5261186	4 - Albany St 6th Floor Scaffolding	11/6/2007	7:24 AM	11/7/2007	7:19 AM	1,435	567	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5261210	5 - Washington St 6th Floor Scaffolding	11/6/2007	7:55 AM	11/7/2007	7:42 AM	1,427	457	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 7	3000 ng/m3	No	
5261230	6 - Cedar St 6th Floor Scaffolding	11/6/2007	8:08 AM	11/7/2007	8:05 AM	1,437	575	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5270105	7 - Roof, East Facade	11/6/2007	6:52 AM	11/7/2007	6:44 AM	1,432	580	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5270121	8 - Roof, North Facade	11/6/2007	7:20 AM	11/7/2007	7:21 AM	1,441	591	Mercury	EPA 324/1631 mod.	BRL	11/08/2007	< 5	3000 ng/m3	No	
5261174	3 - 90 West Courtyard at 2nd Floor Level	11/7/2007	7:07 AM	11/8/2007	6:58 AM	1,431	567	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5261206	4 - Albany St 6th Floor Scaffolding	11/7/2007	7:36 AM	11/8/2007	7:25 AM	1,429	581	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5261222	5 - Washington St 6th Floor Scaffolding	11/7/2007	7:59 AM	11/8/2007	7:36 AM	1,417	591	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5261234	6 - Cedar St 6th Floor Scaffolding	11/7/2007	8:09 AM	11/8/2007	7:46 AM	1,417	606	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5270109	7 - Roof, East Facade	11/7/2007	6:51 AM	11/8/2007	6:37 AM	1,426	587	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5270125	8 - Roof, North Facade	11/7/2007	7:29 AM	11/8/2007	7:14 AM	1,425	609	Mercury	EPA 324/1631 mod.	BRL	11/09/2007	< 5	3000 ng/m3	No	
5261190	4 - Albany St 6th Floor Scaffolding	11/8/2007	7:30 AM	11/9/2007	7:10 AM	1,420	525	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261202	5 - Washington St 6th Floor Scaffolding	11/8/2007	7:41 AM	11/9/2007	7:25 AM	1,424	570	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261226	6 - Cedar St 6th Floor Scaffolding	11/8/2007	7:52 AM	11/9/2007	9:20 AM	88	35	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261477	7 - Roof, East Facade	11/8/2007	6:44 AM	11/9/2007	6:52 AM	1,448	579	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270103	7 - Roof, East Facade	11/8/2007	6:44 AM	11/9/2007	6:52 AM	1,448	579	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270117	8 - Roof, North Facade	11/8/2007	7:23 AM	11/9/2007	7:24 AM	1,441	584	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261194	4 - Albany St 6th Floor Scaffolding	11/9/2007	7:19 AM	11/10/2007	7:35 AM	1,456	568	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261218	5 - Washington St 6th Floor Scaffolding	11/9/2007	7:29 AM	11/10/2007	7:48 AM	1,459	584	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5261238	6 - Cedar St 6th Floor Scaffolding	11/9/2007	8:05 AM	11/10/2007	7:58 AM	1,433	573	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270113	7 - Roof, East Facade	11/9/2007	7:02 AM	11/10/2007	6:48 AM	1,426	285	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270157	3 - 90 West Courtyard at 2nd Floor Level	11/9/2007	6:57 AM	11/10/2007	7:14 AM	1,457	539	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270161	8 - Roof, North Facade	11/9/2007	7:33 AM	11/10/2007	7:20 AM	1,427	285	Mercury	EPA 324/1631 mod.	BRL	N/A	N/A	3000 ng/m3	N/A	Samples lost in sample prep. - Laboratory Error.
5270169	3 - 90 West Courtyard at 2nd Floor Level	11/10/2007	7:19 AM	11/11/2007	7:16 AM	1,437	546	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 6	3000 ng/m3	No	
5270481	8 - Roof, North Facade	11/10/2007	7:29 AM	11/11/2007	7:44 AM	1,455	597	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 5	3000 ng/m3	No	
5270485	7 - Roof, East Facade	11/10/2007	7:00 AM	11/11/2007	7:13 AM	1,453	574	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 5	3000 ng/m3	No	
5270489	6 - Cedar St 6th Floor Scaffolding	11/10/2007	8:03 AM	11/11/2007	8:22 AM	1,459	584	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 5	3000 ng/m3	No	
5270493	5 - Washington St 6th Floor Scaffolding	11/10/2007	7:53 AM	11/11/2007	8:57 AM	1,504	572	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 5	3000 ng/m3	No	
5270497	4 - Albany St 6th Floor Scaffolding	11/10/2007	7:41 AM	11/11/2007	8:39 AM	1,498	569	Mercury	EPA 324/1631 mod.	BRL	11/13/2007	< 5	3000 ng/m3	No	

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Volume (liters)	Analysis	Analytical Method	Lab	Lab Sample Receipt Date	Asbestos Concentration (f/cc)	MMVF Concentration (f/cc)	EPA Site Specific Trigger Level?	Exceeds EPA Site Specific Trigger Level?	Comments
5269397	3 - 90 West Courtyard at 2nd Floor Level	11/4/2007	10:59 AM	11/5/2007	7:14 AM	1,215	3,985	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269393	4 - Albany St 6th Floor Scaffolding	11/4/2007	10:30 AM	11/5/2007	7:36 AM	1,266	4,100	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269389	5 - Washington St 6th Floor Scaffolding	11/4/2007	10:20 AM	11/5/2007	7:50 AM	1,290	4,244	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5269385	6 - Cedar St 6th Floor Scaffolding	11/4/2007	9:30 AM	11/5/2007	8:05 AM	1,355	4,371	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	0.00003	<0.00003	0.0009 f/cc	No	
5269381	7 - Roof, East Facade	11/4/2007	7:54 AM	11/5/2007	6:48 AM	1,374	4,924	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	0.00003	<0.00003	0.0009 f/cc	No	
5269373	8 - Roof, North Facade	11/4/2007	8:57 AM	11/5/2007	7:28 AM	1,351	4,467	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/6/2007	0.00003	0.00003	0.0009 f/cc	No	
5256363	3 - 90 West Courtyard at 2nd Floor Level	11/5/2007	7:19 AM	11/6/2007	7:01 AM	1,422	4,515	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	0.00003	0.00003	0.0009 f/cc	No	
5261147	4 - Albany St 6th Floor Scaffolding	11/5/2007	7:41 AM	11/6/2007	7:30 AM	1,429	4,323	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	<0.00004	<0.00004	0.0009 f/cc	No	
5261157	5 - Washington St 6th Floor Scaffolding	11/5/2007	7:54 AM	11/6/2007	7:44 AM	1,430	4,576	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261152	6 - Cedar St 6th Floor Scaffolding	11/5/2007	8:11 AM	11/6/2007	8:02 AM	1,431	4,436	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	<0.00003	0.00007	0.0009 f/cc	No	
5256351	7 - Roof, East Facade	11/5/2007	6:56 AM	11/6/2007	6:44 AM	1,428	5,012	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5256357	8 - Roof, North Facade	11/5/2007	7:39 AM	11/6/2007	7:09 AM	1,410	4,933	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/7/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261161	3 - 90 West Courtyard at 2nd Floor Level	11/6/2007	7:09 AM	11/7/2007	6:56 AM	1,427	4,495	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	0.00003	0.0009 f/cc	No	
5261177	4 - Albany St 6th Floor Scaffolding	11/6/2007	7:35 AM	11/7/2007	7:30 AM	1,435	4,700	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261185	4 - Albany St 6th Floor Scaffolding	11/6/2007	7:24 AM	11/7/2007	7:19 AM	1,435	5,202	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261209	5 - Washington St 6th Floor Scaffolding	11/6/2007	7:55 AM	11/7/2007	7:42 AM	1,427	4,566	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261229	6 - Cedar St 6th Floor Scaffolding	11/6/2007	8:08 AM	11/7/2007	8:05 AM	1,437	4,563	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	0.00003	<0.00003	0.0009 f/cc	No	
5270104	7 - Roof, East Facade	11/6/2007	6:52 AM	11/7/2007	6:44 AM	1,432	5,095	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270120	8 - Roof, North Facade	11/6/2007	7:20 AM	11/7/2007	7:21 AM	1,441	5,187	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261173	3 - 90 West Courtyard at 2nd Floor Level	11/7/2007	7:07 AM	11/8/2007	6:58 AM	1,431	4,958	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	0.00003	0.0009 f/cc	No	
5261205	4 - Albany St 6th Floor Scaffolding	11/7/2007	7:36 AM	11/8/2007	7:25 AM	1,429	4,988	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261221	5 - Washington St 6th Floor Scaffolding	11/7/2007	7:47 AM	11/8/2007	7:36 AM	1,429	4,765	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	0.00003	<0.00003	0.0009 f/cc	No	
5261233	6 - Cedar St 6th Floor Scaffolding	11/7/2007	8:09 AM	11/8/2007	7:46 AM	1,417	5,133	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270108	7 - Roof, East Facade	11/7/2007	6:51 AM	11/8/2007	6:37 AM	1,426	5,232	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	0.00009	0.0009 f/cc	No	
5270124	8 - Roof, North Facade	11/7/2007	7:29 AM	11/8/2007	7:14 AM	1,425	5,314	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/9/2007	<0.00003	0.00003	0.0009 f/cc	No	
5261169	3 - 90 West Courtyard at 2nd Floor Level	11/8/2007	7:04 AM	11/9/2007	6:52 AM	1,428	4,463	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	<0.00003	0.00017	0.0009 f/cc	No	
5261189	4 - Albany St 6th Floor Scaffolding	11/8/2007	7:30 AM	11/9/2007	7:10 AM	1,420	4,722	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261201	5 - Washington St 6th Floor Scaffolding	11/8/2007	7:41 AM	11/9/2007	7:25 AM	1,424	4,877	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5261225	6 - Cedar St 6th Floor Scaffolding	11/8/2007	7:52 AM	11/9/2007	7:34 AM	1,422	4,373	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	0.00003	0.00003	0.0009 f/cc	No	
5270102	7 - Roof, East Facade	11/8/2007	6:44 AM	11/9/2007	6:52 AM	1,448	5,169	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	<0.00003	0.00006	0.0009 f/cc	No	
5270116	8 - Roof, North Facade	11/8/2007	7:23 AM	11/9/2007	7:24 AM	1,441	5,010	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/10/2007	<0.00003	0.00006	0.0009 f/cc	No	
5270156	3 - 90 West Courtyard at 2nd Floor Level	11/9/2007	6:57 AM	11/10/2007	7:14 AM	1,457	4,682	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	0.00003	0.00003	0.0009 f/cc	No	
5261193	4 - Albany St 6th Floor Scaffolding	11/9/2007	7:19 AM	11/10/2007	7:35 AM	1,456	4,914	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	0.00003	<0.00003	0.0009 f/cc	No	
5261217	5 - Washington St 6th Floor Scaffolding	11/9/2007	7:29 AM	11/10/2007	7:48 AM	1,459	5,435	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	0.00003	0.00003	0.0009 f/cc	No	
5261237	6 - Cedar St 6th Floor Scaffolding	11/9/2007	7:39 AM	11/10/2007	7:58 AM	1,459	5,180	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	<0.00003	0.00006	0.0009 f/cc	No	
5270112	7 - Roof, East Facade	11/9/2007	7:02 AM	11/10/2007	6:48 AM	1,426	4,963	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	0.00003	0.00003	0.0009 f/cc	No	
5270160	8 - Roof, North Facade	11/9/2007	7:33 AM	11/10/2007	7:20 AM	1,427	5,056	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/12/2007	<0.00003	0.00003	0.0009 f/cc	No	
5270168	3 - 90 West Courtyard at 2nd Floor Level	11/10/2007	7:19 AM	11/11/2007	7:16 AM	1,437	4,958	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270496	4 - Albany St 6th Floor Scaffolding	11/10/2007	7:41 AM	11/11/2007	8:39 AM	1,498	5,393	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270492	5 - Washington St 6th Floor Scaffolding	11/10/2007	7:53 AM	11/11/2007	8:57 AM	1,504	5,527	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270488	6 - Cedar St 6th Floor Scaffolding	11/10/2007	8:03 AM	11/11/2007	8:22 AM	1,459	4,961	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	<0.00003	<0.00003	0.0009 f/cc	No	
5270484	7 - Roof, East Facade	11/10/2007	7:00 AM	11/11/2007	7:13 AM	1,453	5,115	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	0.00003	<0.00003	0.0009 f/cc	No	
5261490	8 - Roof, North Facade	11/10/2007	7:29 AM	11/11/2007	7:44 AM	1,455	5,050	Asbestos PCME fibers	ISO 14966 mod	RJLG SEM	11/13/2007	<0.00003	0.00003	0.0009 f/cc	No	

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total collection time, minutes	Sample Volume (liters)	Analyte	Analytical Method	Lab	Lab Report Date	Respirable Dust Concentration (mg/m <sup>3</sup> )	Respirable Quartz Concentration (mg/m <sup>3</sup> )	Target Air quality Level for Respirable Quartz (mg/m <sup>3</sup> )	EPA Site Specific Trigger Level for Respirable Quartz (mg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
5269396	3-90 West Courtyard at 2nd Floor Level	11/4/2007	10:59 AM	11/5/2007	7:14 AM	1,215	2,888	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.35	< 0.02	0.01	0.01	No	
5269392	4- Albany St 6th Floor Scaffolding	11/4/2007	10:30 AM	11/5/2007	7:36 AM	1,266	3,015	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.33	< 0.02	0.01	0.01	No	
5269388	5- Washington St 6th Floor Scaffolding	11/4/2007	10:20 AM	11/5/2007	7:50 AM	1,290	3,075	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.33	< 0.02	0.01	0.01	No	
5269384	6- Cedar St 6th Floor Scaffolding	11/4/2007	9:30 AM	11/5/2007	8:05 AM	1,355	3,302	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.30	< 0.02	0.01	0.01	No	
5269380	7- Roof, East Facade	11/4/2007	7:59 AM	11/5/2007	6:48 AM	1,370	3,343	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.30	< 0.01	0.01	0.01	No	
5269372	8- Roof, North Facade	11/4/2007	8:57 AM	11/5/2007	7:28 AM	1,351	3,228	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.31	< 0.02	0.01	0.01	No	
5256364	3-90 West Courtyard at 2nd Floor Level	11/5/2007	7:19 AM	11/6/2007	7:01 AM	1,422	3,555	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	< 0.28	< 0.01	0.01	0.01	No	
5256368	4- Albany St 6th Floor Scaffolding	11/5/2007	7:41 AM	11/6/2007	7:30 AM	1,429	3,573	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	< 0.28	< 0.01	0.01	0.01	No	
5261156	5- Washington St 6th Floor Scaffolding	11/5/2007	7:54 AM	11/6/2007	7:44 AM	1,430	3,575	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	< 0.28	< 0.01	0.01	0.01	No	
5261151	6- Cedar St 6th Floor Scaffolding	11/5/2007	8:11 AM	11/6/2007	8:02 AM	1,431	3,578	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	0.30	< 0.01	0.01	0.01	No	
5256348	7- Roof, East Facade	11/5/2007	6:56 AM	11/6/2007	6:44 AM	1,428	3,570	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	< 0.28	< 0.01	0.01	0.01	No	
5256356	8- Roof, North Facade	11/5/2007	7:39 AM	11/6/2007	7:39 AM	1,410	3,596	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/7/2007	0.034	< 0.01	0.01	0.01	No	
5261160	3-90 West Courtyard at 2nd Floor Level	11/6/2007	7:09 AM	11/7/2007	6:56 AM	1,427	3,496	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.29	< 0.01	0.01	0.01	No	
5261176	4- Albany St 6th Floor Scaffolding	11/6/2007	7:35 AM	11/7/2007	7:30 AM	1,435	3,588	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.28	< 0.01	0.01	0.01	No	
5261184	4- Albany St 6th Floor Scaffolding	11/6/2007	7:24 AM	11/7/2007	7:19 AM	1,435	4,018	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.25	< 0.01	0.01	0.01	No	
5261208	5- Washington St 6th Floor Scaffolding	11/6/2007	7:55 AM	11/7/2007	7:42 AM	1,427	3,568	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.28	< 0.01	0.01	0.01	No	
5261228	6- Cedar St 6th Floor Scaffolding	11/6/2007	8:08 AM	11/7/2007	8:05 AM	1,437	3,593	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.28	< 0.01	0.01	0.01	No	
5261240	7- Roof, East Facade	11/6/2007	6:52 AM	11/7/2007	6:44 AM	1,432	3,590	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.28	< 0.01	0.01	0.01	No	
5270119	8- Roof, North Facade	11/6/2007	7:20 AM	11/7/2007	7:21 AM	1,441	3,603	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.28	< 0.01	0.01	0.01	No	
5261172	3-90 West Courtyard at 2nd Floor Level	11/7/2007	7:07 AM	11/8/2007	6:58 AM	1,431	3,728	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5261204	4- Albany St 6th Floor Scaffolding	11/7/2007	7:36 AM	11/8/2007	7:25 AM	1,429	3,723	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5261220	5- Washington St 6th Floor Scaffolding	11/7/2007	7:47 AM	11/8/2007	7:36 AM	1,429	3,648	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5261232	6- Cedar St 6th Floor Scaffolding	11/7/2007	8:09 AM	11/8/2007	7:46 AM	1,417	3,693	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5270107	7- Roof, East Facade	11/7/2007	6:51 AM	11/8/2007	6:37 AM	1,426	3,641	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5270123	8- Roof, North Facade	11/7/2007	7:29 AM	11/8/2007	7:14 AM	1,425	3,713	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/8/2007	< 0.27	< 0.01	0.01	0.01	No	
5261188	3-90 West Courtyard at 2nd Floor Level	11/8/2007	7:04 AM	11/9/2007	6:52 AM	1,428	3,570	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.28	< 0.01	0.01	0.01	No	
5261188	4- Albany St 6th Floor Scaffolding	11/8/2007	7:30 AM	11/9/2007	7:10 AM	1,420	3,479	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.29	< 0.01	0.01	0.01	No	
5261200	5- Washington St 6th Floor Scaffolding	11/8/2007	7:41 AM	11/9/2007	7:25 AM	1,424	3,631	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.28	< 0.01	0.01	0.01	No	
5261224	6- Cedar St 6th Floor Scaffolding	11/8/2007	7:52 AM	11/9/2007	7:34 AM	1,422	3,555	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.28	< 0.01	0.01	0.01	No	
5270101	7- Roof, East Facade	11/8/2007	6:44 AM	11/9/2007	6:52 AM	1,446	3,620	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.28	< 0.01	0.01	0.01	No	
5270115	8- Roof, North Facade	11/8/2007	7:23 AM	11/9/2007	7:24 AM	1,441	3,747	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/10/2007	< 0.27	< 0.01	0.01	0.01	No	
5270155	3-90 West Courtyard at 2nd Floor Level	11/8/2007	6:57 AM	11/10/2007	7:14 AM	1,457	3,643	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	< 0.27	< 0.01	0.01	0.01	No	
5261192	4- Albany St 6th Floor Scaffolding	11/8/2007	7:19 AM	11/10/2007	7:35 AM	1,456	3,786	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	0.027	< 0.01	0.01	0.01	No	
5261216	5- Washington St 6th Floor Scaffolding	11/8/2007	7:29 AM	11/10/2007	7:48 AM	1,459	3,648	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	< 0.27	< 0.01	0.01	0.01	No	
5261236	6- Cedar St 6th Floor Scaffolding	11/8/2007	7:39 AM	11/10/2007	7:58 AM	1,459	3,648	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	< 0.27	< 0.01	0.01	0.01	No	
5270111	7- Roof, East Facade	11/8/2007	7:02 AM	11/10/2007	6:48 AM	1,426	3,484	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	< 0.29	< 0.01	0.01	0.01	No	
5270159	8- Roof, North Facade	11/8/2007	7:33 AM	11/10/2007	7:20 AM	1,427	3,603	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/12/2007	0.032	< 0.01	0.01	0.01	No	
5270499	3-90 West Courtyard at 2nd Floor Level	11/10/2007	7:19 AM	11/11/2007	7:16 AM	1,437	3,305	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	0.030	< 0.02	0.01	0.01	No	
5270495	4- Albany St 6th Floor Scaffolding	11/10/2007	7:41 AM	11/11/2007	8:39 AM	1,498	3,745	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	< 0.27	< 0.01	0.01	0.01	No	
5270491	5- Washington St 6th Floor Scaffolding	11/10/2007	7:53 AM	11/11/2007	8:57 AM	1,504	3,760	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	< 0.27	< 0.01	0.01	0.01	No	
5270487	6- Cedar St 6th Floor Scaffolding	11/10/2007	8:03 AM	11/11/2007	8:22 AM	1,459	3,575	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	< 0.28	< 0.01	0.01	0.01	No	
5270483	7- Roof, East Facade	11/10/2007	7:00 AM	11/11/2007	7:13 AM	1,453	3,705	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	< 0.27	< 0.01	0.01	0.01	No	
5261489	8- Roof, North Facade	11/10/2007	7:29 AM	11/11/2007	7:44 AM	1,455	3,492	Dust and Quartz	NIOSH 0600/7500	RJLG XRD	11/13/2007	< 0.29	< 0.01	0.01	0.01	No	


## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>2.5</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>2.5</sub> (µg/m <sup>3</sup> )	Exceeds Target Air Quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	11.2	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	11.6	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	11.9	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	13.7	65	No	
N/A	7 - Roof, East	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	11	65	No	
N/A	8 - Roof, North	11/4/2007	12:00 AM	11/5/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	11.2	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	15.9	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	15.9	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	15.6	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	17.3	65	No	
N/A	7 - Roof, East	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	14.8	65	No	
N/A	8 - Roof, North	11/5/2007	12:00 AM	11/6/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	14.4	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	13	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	18.4	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	17	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	18.2	65	No	
N/A	7 - Roof, East	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	14.6	65	No	
N/A	8 - Roof, North	11/6/2007	12:00 AM	11/7/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	15.8	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	9.4	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	8.6	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	8.5	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	11.1	65	No	
N/A	7 - Roof, East	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	7.3	65	No	
N/A	8 - Roof, North	11/7/2007	12:00 AM	11/8/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	7.8	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	12.2	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	12.2	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	12.8	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	13.6	65	No	
N/A	7 - Roof, East	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	11.3	65	No	
N/A	8 - Roof, North	11/8/2007	12:00 AM	11/9/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	11.7	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	16.6	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	21.5	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	21	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	27	65	No	
N/A	7 - Roof, East	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	25.3	65	No	
N/A	8 - Roof, North	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	22.8	65	No	
N/A	3 - Courtyard, 2nd Floor Level	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4526	N/A	11.6	65	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4728	N/A	12.6	65	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4729	N/A	15.9	65	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # G4527	N/A	17.8	65	No	
N/A	7 - Roof, East	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # F5003	N/A	14.9	65	No	
N/A	8 - Roof, North	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>2.5</sub>	Direct Read	Met One E-BAM Unit # E3363	N/A	15.3	65	No	

## MasterWorks - 130 Cedar Building, Community Monitoring

Sample No.	Sampling Location	Collection Start Date	Collection (Time on)	Collection End Date	Collection (Time off)	Total Collection Time, minutes	Analysis	Analytical Method	Instrument	Lab Sample Receipt Date	PM <sub>10</sub> Avg. Concentration (µg/m <sup>3</sup> )	EPA Site Specific Trigger Level for PM <sub>10</sub> (µg/m <sup>3</sup> )	Exceeds Target Air quality or EPA Site Specific Level?	Comments
N/A	3 - Courtyard, 2nd Floor Level	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	13.0	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	13.7	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	13.9	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	15.9	150	No	
N/A	7 - Roof, East	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	15.2	150	No	
N/A	8 - Roof, North	11/4/2007	12:00 AM	11/05/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	15.7	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	20.8	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	21.0	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	21.2	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	22.6	150	No	
N/A	7 - Roof, East	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	22.1	150	No	
N/A	8 - Roof, North	11/5/2007	12:00 AM	11/06/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	23.4	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	26.2	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	21.3	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	20.3	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	25.3	150	No	
N/A	7 - Roof, East	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	28.2	150	No	
N/A	8 - Roof, North	11/6/2007	12:00 AM	11/07/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	32.8	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	12.6	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	10.3	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	11.0	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	13.6	150	No	
N/A	7 - Roof, East	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	11.4	150	No	
N/A	8 - Roof, North	11/7/2007	12:00 AM	11/08/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	12.3	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	16.1	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	14.5	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	15.2	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	16.8	150	No	
N/A	7 - Roof, East	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	17.2	150	No	
N/A	8 - Roof, North	11/8/2007	12:00 AM	11/09/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	16.0	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	24.1	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	23.8	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	24.5	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	25.2	150	No	
N/A	7 - Roof, East	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	28.5	150	No	
N/A	8 - Roof, North	11/9/2007	12:00 AM	11/10/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	48.3	150	No	
N/A	3 - Courtyard, 2nd Floor Level	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4606	N/A	16.4	150	No	
N/A	4 - Albany St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4731	N/A	19.5	150	No	
N/A	5 - Washington St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4604	N/A	22.3	150	No	
N/A	6 - Cedar St 6th Floor Level Scaffolding	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # G4605	N/A	20.7	150	No	
N/A	7 - Roof, East	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # E3364	N/A	18.5	150	No	
N/A	8 - Roof, North	11/10/2007	12:00 AM	11/11/2007	12:00 AM	1,440	PM <sub>10</sub>	Direct Read	Met One E-BAM Unit # F5001	N/A	23.2	150	No	

Mercury Vapor ( $Hg^0$ ) Air Results for Outdoor Community  
Monitoring Stations by Location as recorded by the Lumex Analyzer

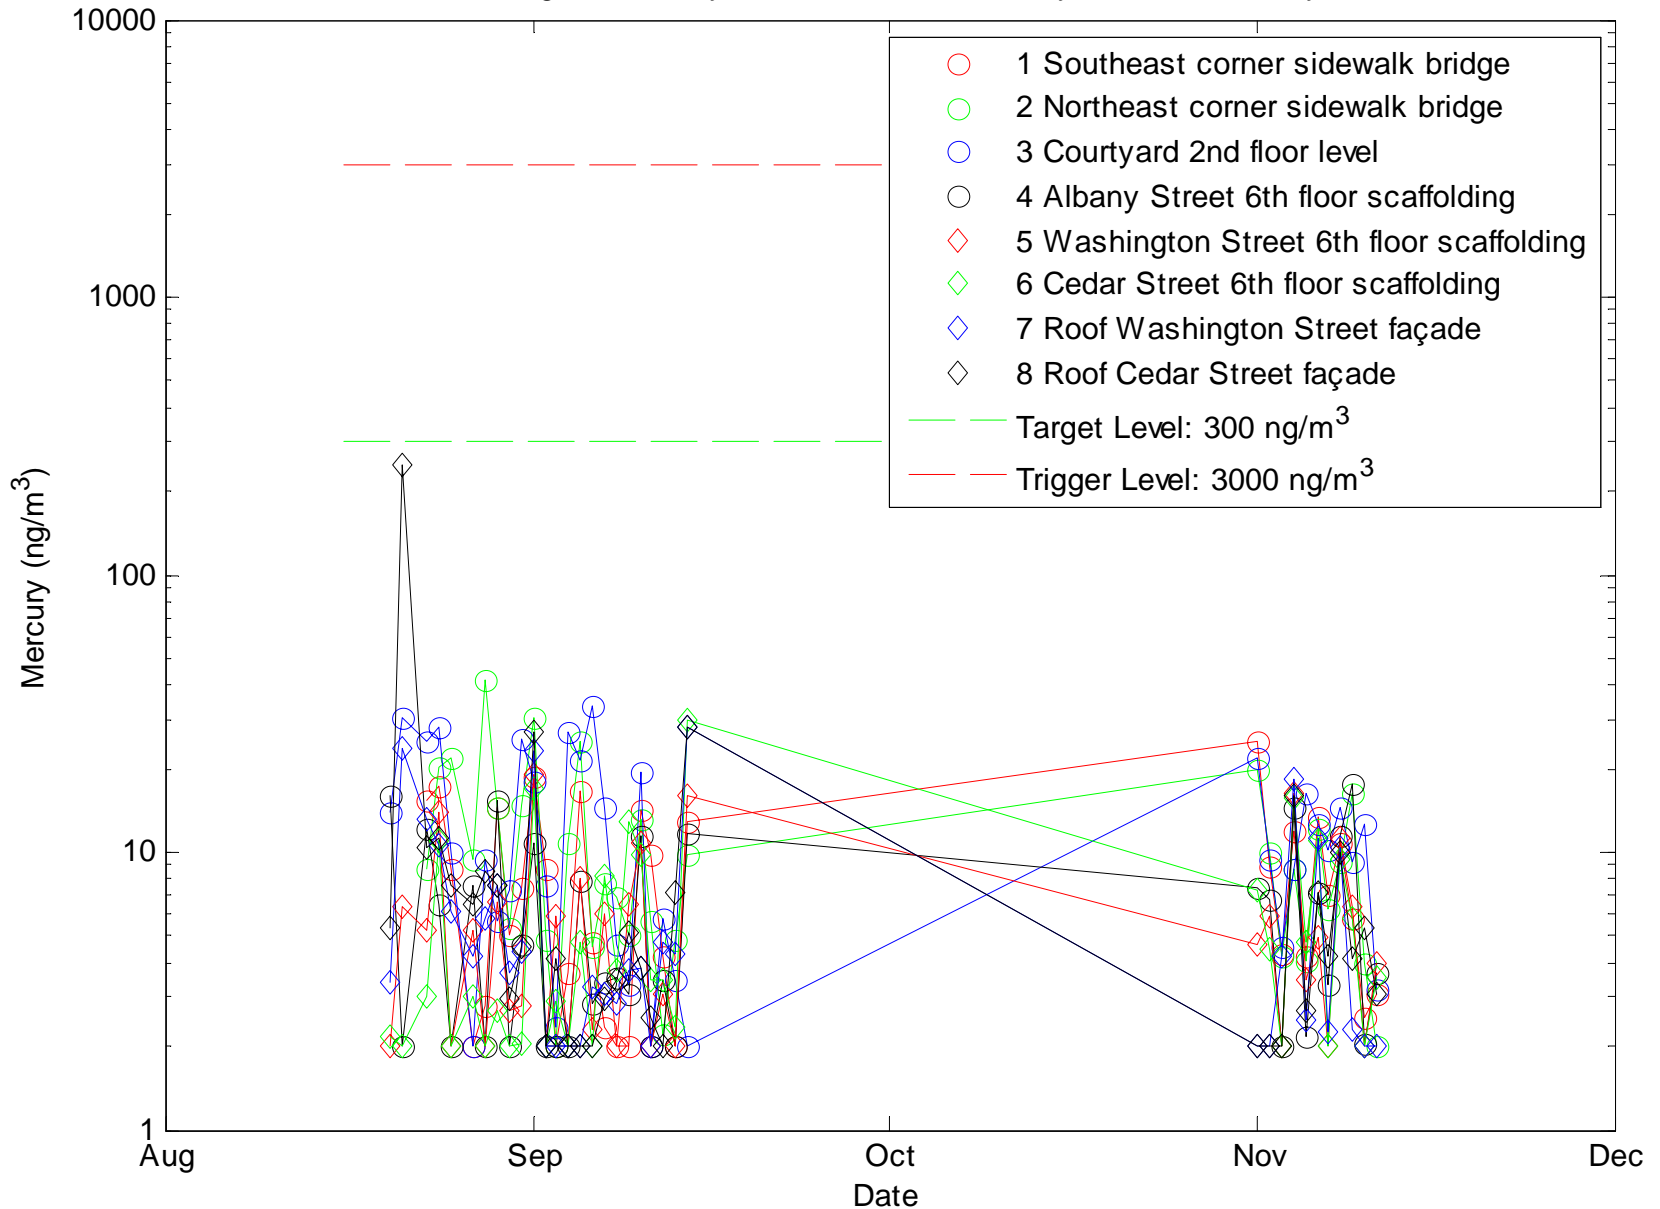

**Report Summary**  
Air Mercury Results (Hg<sup>0</sup>, ng/m<sup>3</sup>) as recorded by the Lumex RA915+ analyzer  
Week of 11/4/07 to 11/10/07

Date	Mercury (Hg <sup>0</sup> ) ng/m <sup>3</sup> 30-sec readings	1 Southeast corner sidewalk bridge	2 Northeast corner sidewalk bridge	3 Courtyard 2nd floor level	4 Albany Street 6th floor scaffolding	5 Washington Street 6th floor scaffolding	6 Cedar Street 6th floor scaffolding	7 Roof Washington Street façade	8 Roof Cedar Street façade
4-Nov-07	# Samples	9	9	9	9	9	9	9	9
	Average	12	9	9	15	16	16	18	16
	Maximum	13	11	10	16	17	17	19	17
5-Nov-07	# Samples	27	27	36	27	27	27	30	27
	Average	4	4	16	2	3	5	3	3
	Maximum	6	6	36	5	7	9	9	5
6-Nov-07	# Samples	45	45	36	45	54	36	39	36
	Average	13	12	13	7	5	11	11	7
	Maximum	48	44	52	33	37	35	29	26
7-Nov-07	# Samples	36	36	36	36	36	36	39	45
	Average	7	6	10	3	2	2	2	4
	Maximum	23	21	26	7	5	2	30	28
8-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	11	9	14	12	11	9	10	10
	Maximum	30	28	30	24	24	21	36	38
9-Nov-07	# Samples	36	36	36	36	39	36	36	36
	Average	6	16	9	18	6	6	2	4
	Maximum	11	72	37	59	20	14	5	12
10-Nov-07	# Samples	36	36	36	36	36	36	36	36
	Average	3	4	13	2	2	2	2	5
	Maximum	10	11	48	6	3	3	4	12